



**MC68HC11E20 DEVICE INFORMATION**  
**(Rev. 1 -5/27/93)**  
**E82K / E22B Mask Sets**

The following contains information and errata that pertains to E82K and E22B mask set devices.

**ERRATA**

The Timer Overflow Flag in the TGLG2 register does not operate correctly when a Prescaler factor of 4, 8, or 16 is selected. Instead of setting at the \$FFFF - \$0000 transition of the Timer Counter Register (TCNT) the TOF also sets at intermediate transitions of the TCNT. The TOF operates correctly when a Prescaler factor of 1 is selected.

Revision 0.0, 20 NOV 96

last update: Mar 26, 1998