ES_LPC11Axx Errata sheet LPC11Axx Rev. 2 — 15 January 2013

Errata sheet

Document information

Info	Content
Keywords	LPC11A02UK; LPC11A04UK; LPC11A11FHN33; LPC11A12FHN33; LPC11A12FBD48; LPC11A13FHI33; LPC11A14FHN33; LPC11A14FBD48 LPC11Axx errata
Abstract	This errata sheet describes both the known functional problems and any deviations from the electrical specifications known at the release date of this document.
	Each deviation is assigned a number and its history is tracked in a table.





Errata sheet LPC11Axx

Revision history

Rev	Date	Description
2	20130115	Added I2C.1.
1.2	20120719	Added UVLO.1.
1.1	20120601	Added Rev. 'B'.
1	20120401	Initial version.

Contact information

For more information, please visit: http://www.nxp.com

For sales office addresses, please send an email to: salesaddresses@nxp.com

1. Product identification

The LPC11Axx devices typically have the following top-side marking:

LPC11Axx

/xxx

XXXXXX

xxYYWWxR[x]

The last letter in the last line (field 'R') will identify the device revision. This Errata Sheet covers the following revisions of the LPC11Axx:

Table 1. Device revision table

Revision identifier (R)	Revision description
'A'	Initial device revision
'B'	Second device revision

Field 'YY' states the year the device was manufactured. Field 'WW' states the week the device was manufactured during that year.

2. Errata overview

Table 2. Errata summary table

Functional problems	Short description	Revision identifier	Detailed description
I2C.1	In the slave-transmitter mode, the device set in the monitor mode must write a dummy value of 0xFF into the DAT register.	'A', 'B'	Section 3.1
UVLO.1	Double reset occurs during initial cold start-up when temperature is $-20~^{\circ}\text{C}$ and V_{DD} ramp rate is $>40~\text{ms}$	'A', 'B'	Section 3.2

Table 3. AC/DC deviations table

AC/DC deviations	Short description	Revision identifier	Detailed description
n/a	n/a	n/a	n/a

Table 4. Errata notes table

Errata notes	Short description	Revision identifier	Detailed description
Note.1	During power-up, an unexpected glitch (low pulse) could occur on the port pins as the V_{DD} supply ramps up.	'A', 'B'	Section 5.1
Note.2	Rev A version does not support boot ROM power profiles.	'A'	Section 5.2

3. Functional problems detail

3.1 I2C.1: In the slave-transmitter mode, the device set in the monitor mode must write a dummy value of 0xFF into the DAT register

Introduction:

The I2C monitor allows the device to monitor the I2C traffic on the I2C bus in a non-intrusive way.

Problem:

In the slave-transmitter mode, the device set in the monitor mode must write a dummy value of 0xFF into the DAT register. If this is not done, the received data from the slave device will be corrupted. To allow the monitor mode to have sufficient time to process the data on the I2C bus, the device may need to have the ability to stretch the I2C clock. Under this condition, the I2C monitor mode is not 100% non-intrusive.

Work-around:

When setting the device in monitor mode, enable the ENA_SCL bit in the MMCTRL register to allow clock stretching.

Software code example to enable the ENA_SCL bit:

```
LPC_I2C_MMCTRL |= (1<<1); //Enable ENA_SCL bit
```

In the I2C ISR routine, for the status code related to the slave-transmitter mode, write the value of 0xFF into the DAT register to prevent data corruption. In order to avoid stretching the SCL clock, the data byte can be saved in a buffer and processed in the Main loop. This ensures the SI flag is cleared as fast as possible.

Software code example for the slave-transmitter mode:



3.2 UVLO.1: Double reset occurs during initial cold start-up when temperature is -20 °C and V_{DD} ramp rate is >40 ms

Introduction:

The UnderVoltage LockOut (UVLO) provides protection against power supply droop below 2.4 V. When the V_{DD} ramps up to 2.4 V (UVLO threshold voltage level), the device comes out of reset and starts executing the boot ROM and application code.

Problem:

For cold start-ups only, as V_{DD} initially ramps up from ground, the device comes briefly out of reset and starts execution of the program code before the device returns to reset. Under the conditions where the temperature is below $-20~^{\circ}$ C and the a V_{DD} ramp rate is 40 ms or greater, a double reset of the LPC11Axx occurs during the initial cold power-up.

Work-around:

For a hardware fix, a decoupling capacitor can be placed on the $\overline{\text{RESET}}$ pin with a minimum value of 5 μF .

If a software fix is desired, the BOD reset flag can be monitored. The software should loop until the BOD reset flag is set. The software fix is restricted to a V_{DD} ramp time of 0.9 ms or greater at all operating temperatures.

Software fix loop code example:

```
while (!(LPC_SYSCON->SYSRSTSTAT & (0x1<<3))) //while no reset is detected... 
 \{LPC\_SYSCON->SYSRSTSTAT \mid = (1<<3); \} //clear BOD status bit and repeat loop
```

4. AC/DC deviations detail

4.1 n/a

5. Errata notes detail

5.1 Note.1

The General Purpose I/O (GPIO) pins have configurable pull-up/pull-down resistors where the pins are pulled up to the V_{DD} level by default. During power-up, an unexpected glitch (low pulse) could occur on the port pins as the V_{DD} supply ramps up.

5.2 Note.2

Rev A version does not support boot ROM power profiles.

Errata sheet LPC11Axx

6. Legal information

6.1 Definitions

Draft — The document is a draft version only. The content is still under internal review and subject to formal approval, which may result in modifications or additions. NXP Semiconductors does not give any representations or warranties as to the accuracy or completeness of information included herein and shall have no liability for the consequences of use of such information.

6.2 Disclaimers

Limited warranty and liability — Information in this document is believed to be accurate and reliable. However, NXP Semiconductors does not give any representations or warranties, expressed or implied, as to the accuracy or completeness of such information and shall have no liability for the consequences of use of such information. NXP Semiconductors takes no responsibility for the content in this document if provided by an information source outside of NXP Semiconductors.

In no event shall NXP Semiconductors be liable for any indirect, incidental, punitive, special or consequential damages (including - without limitation - lost profits, lost savings, business interruption, costs related to the removal or replacement of any products or rework charges) whether or not such damages are based on tort (including negligence), warranty, breach of contract or any other legal theory.

Notwithstanding any damages that customer might incur for any reason whatsoever, NXP Semiconductors' aggregate and cumulative liability towards customer for the products described herein shall be limited in accordance with the *Terms and conditions of commercial sale* of NXP Semiconductors.

Right to make changes — NXP Semiconductors reserves the right to make changes to information published in this document, including without limitation specifications and product descriptions, at any time and without notice. This document supersedes and replaces all information supplied prior to the publication hereof.

Suitability for use — NXP Semiconductors products are not designed, authorized or warranted to be suitable for use in life support, life-critical or safety-critical systems or equipment, nor in applications where failure or

malfunction of an NXP Semiconductors product can reasonably be expected to result in personal injury, death or severe property or environmental damage. NXP Semiconductors and its suppliers accept no liability for inclusion and/or use of NXP Semiconductors products in such equipment or applications and therefore such inclusion and/or use is at the customer's own risk.

Applications — Applications that are described herein for any of these products are for illustrative purposes only. NXP Semiconductors makes no representation or warranty that such applications will be suitable for the specified use without further testing or modification.

Customers are responsible for the design and operation of their applications and products using NXP Semiconductors products, and NXP Semiconductors accepts no liability for any assistance with applications or customer product design. It is customer's sole responsibility to determine whether the NXP Semiconductors product is suitable and fit for the customer's applications and products planned, as well as for the planned application and use of customer's third party customer(s). Customers should provide appropriate design and operating safeguards to minimize the risks associated with their applications and products.

NXP Semiconductors does not accept any liability related to any default, damage, costs or problem which is based on any weakness or default in the customer's applications or products, or the application or use by customer's third party customer(s). Customer is responsible for doing all necessary testing for the customer's applications and products using NXP Semiconductors products in order to avoid a default of the applications and the products or of the application or use by customer's third party customer(s). NXP does not accept any liability in this respect.

Export control — This document as well as the item(s) described herein may be subject to export control regulations. Export might require a prior authorization from competent authorities.

6.3 Trademarks

Notice: All referenced brands, product names, service names and trademarks are the property of their respective owners.



Errata sheet LPC11Axx

7. Contents

1	Product identification
2	Errata overview 3
3	Functional problems detail 3
3.1	I2C.1: In the slave-transmitter mode, the device set in the monitor mode must write a dummy value of 0xFF into the DAT register 4
3.2	UVLO.1: Double reset occurs during initial cold start-up when temperature is -20 °C and V _{DD} ramp rate is >40 ms
4	AC/DC deviations detail 6
4.1	n/a6
5	Errata notes detail 6
5.1	Note.1
5.2	Note.2 6
6	Legal information 7
6.1	Definitions
6.2	Disclaimers
6.3	Trademarks 7
7	Contents

Please be aware that important notices concerning this document and the product(s) described herein, have been included in section 'Legal information'.