

Mask Set Errata for Mask 2N22J

This report applies to mask 2N22J for these products:

- KEA64

Errata ID	Errata Title
6946	Core: A debugger write to the I/O port might be corrupted during a processor write
6945	Core: Processor executing at HardFault priority might enter Lockup state if an NMI occurs during a waited debugger transaction
6484	FTM: The process of clearing the FTMx_SC[TOF] bit does not work as expected under a certain condition when the FTM counter reaches FTM_MOD value.
6749	I2C: The I2C_C1[MST] bit is not automatically cleared when arbitration is lost
7331	IO: High current drive pins not in high-Z state during power up
7914	PIT: After enabling the Periodic Interrupt Timer (PIT) clock gate, an attempt to immediately enable the PIT module may not be successful.

e6946: Core: A debugger write to the I/O port might be corrupted during a processor write

Errata type: Errata

Description: A debugger can perform memory accesses through the Cortex-M0+ processor bus matrix while the processor is running.

Because of this erratum, a debugger write to the I/O port might be corrupted if it occurs while the processor is executing a write. The processor write completes successfully. However, under specific timing conditions, the matrix might incorrectly replace the debugger write data with the value zero.

This erratum does not affect debugger writes outside the I/O port region of the memory map, or debugger reads.

Conditions:

The following timing-specific conditions must all be met:

- The processor is running (not halted in Debug state).

- The debugger performs a write within the I/O port region of the memory map.
- The processor performs a write.

Implications:

The debugger might corrupt the targeted memory or configure the targeted device incorrectly.

Workaround: The debugger can work around this erratum by halting the processor in Debug state before performing writes to the I/O port region of the memory map.

e6945: Core: Processor executing at HardFault priority might enter Lockup state if an NMI occurs during a waited debugger transaction

Errata type: Errata

Description: A debugger can perform memory accesses through the Cortex-M0+ processor bus matrix while the processor is running.

Because of this erratum, the processor might erroneously enter Lockup state if a debugger-initiated access on the AHB-Lite master port is subject to wait states while the processor is running, executing at HardFault priority and taking a Non Maskable Interrupt (NMI). Under very specific timing conditions, the processor might incorrectly stack a ReturnAddress of 0xFFFFFFFF on NMI entry. On NMI return, the processor unstacks the incorrectly stacked ReturnAddress and enters Lockup state at HardFault priority.

Conditions:

The following timing-specific conditions must all be met:

- The processor is running (not halted in Debug state) and is executing at HardFault priority.
- The processor executes a single-cycle instruction at a word-aligned address.
- The debugger performs an access through the AHB-Lite master port that is subject to wait states.
- An NMI becomes pending.

Implications:

The processor stops executing the code in the HardFault handler and enters Lockup state at HardFault priority as if a fault had occurred.

Workaround: The debugger can work around this erratum by halting the processor in Debug state before performing accesses outside the Private Peripheral Bus (PPB) region of the memory map.

e6484: FTM: The process of clearing the FTMx_SC[TOF] bit does not work as expected under a certain condition when the FTM counter reaches FTM_MOD value.

Errata type: Errata

Description: The process of clearing the TOF bit does not work as expected when $FTMx_CONF[UMTOF] \neq 0$ and the current TOF count is less than $FTMx_CONF[UMTOF]$, if the FTM counter reaches the FTM_MOD value between the reading of the TOF bit and the writing of 0 to the TOF bit. If the above condition is met, the TOF bit remains set, and if the TOF interrupt is enabled ($FTMx_SC[TOIE] = 1$), the TOF interrupt also remains asserted.

Workaround: Two possible workarounds exist for this erratum and the decision on which one to use is based on the requirements of your particular application.

1) Repeat the clearing sequence mechanism until the TOF bit is cleared.

Below is a pseudo-code snippet that would need to be included in the TOF interrupt routine.

```
while (FTM_SC[TOF]!=0)
{
void FTM_SC() ; // Read SC register
FTM_SC[TOF]=0 ; // Write 0 to TOF bit
}
```

2) With `FTMx_CONF[TOFNUM] = 0` and a variable in the software, count the number of times that the TOF bit is set. In the TOF interrupt routine, clear the TOF bit and increment the variable that counts the number of times that the TOF bit was set.

e6749: I2C: The I2C_C1[MST] bit is not automatically cleared when arbitration is lost

Errata type: Errata

Description: When the I2C module is used as a master device and loses bus arbitration, it correctly switches to be a slave device. The I2C_C1[MST] bit is not automatically cleared when this occurs but it does correctly operate as a slave.

Workaround: When the I2C module has been configured as a master device and the I2C_S[ARB] bit is set, indicating arbitration has been lost, the I2C_C1[MST] bit must be cleared by software before the I2C_S[ARB] bit is cleared.

e7331: IO: High current drive pins not in high-Z state during power up

Errata type: Errata

Description: The high current drive pins on the chip are unexpectedly driven low for a short period during power up. All other I/O pins are high impedance. The issue happens only before VDD reaches the power-on reset voltage. After power up the normal I/O functions on the high current drive pins are not impacted.

Workaround: Use one or more combination of the following methods to avoid possible issues:

- Use high current drive pins as current source for LED connection, but keep total $I_{DD} < 120\text{mA}$ (refer to device data sheet for I_{DD})
- Configure the corresponding Flextimer channel output polarity as active high which are muxed with high current drive pins
- Use high current drive pins with NPN transistor (active high) to drive relays
- Keep VDD ramp-up time greater than or equal to 1KV/s and less than or equal to 10KV/s to disable LED and/or driver action during power up

e7914: PIT: After enabling the Periodic Interrupt Timer (PIT) clock gate, an attempt to immediately enable the PIT module may not be successful.

Errata type: Errata

Description: If a write to the PIT module enable bit (PIT_MCR[MDIS]) occurs within two bus clock cycles of enabling the PIT clock gate in the SIM_CG register, the write will be ignored and the PIT will fail to enable.

Workaround: Insert a read of the PIT_MCR register before writing to the PIT_MCR register. This guarantees a minimum delay of two bus clocks to guarantee the write is not ignored.

How to Reach Us:

Home Page:

freescale.com

Web Support:

freescale.com/support

Information in this document is provided solely to enable system and software implementers to use Freescale products. There are no express or implied copyright licenses granted hereunder to design or fabricate any integrated circuits based on the information in this document. Freescale reserves the right to make changes without further notice to any products herein.

Freescale makes no warranty, representation, or guarantee regarding the suitability of its products for any particular purpose, nor does Freescale assume any liability arising out of the application or use of any product or circuit, and specifically disclaims any and all liability, including without limitation consequential or incidental damages. "Typical" parameters that may be provided in Freescale data sheets and/or specifications can and do vary in different applications, and actual performance may vary over time. All operating parameters, including "typicals," must be validated for each customer application by customer's technical experts. Freescale does not convey any license under its patent rights nor the rights of others. Freescale sells products pursuant to standard terms and conditions of sale, which can be found at the following address: freescale.com/SalesTermsandConditions.

Freescale, Freescale logo, and Kinetis are trademarks of Freescale Semiconductor, Inc. All other product or service names are the property of their respective owners.

© 2015 Freescale Semiconductor, Inc.