

MPC5746R_1N83M

Mask Set Errata

Rev. 4 — 6 June 2025

Errata

1 Mask Set Errata for Mask 1N83M

1.1 Revision History

This report applies to mask 1N83M for these products:

- MPC5746R

Table 1. Mask Specific Information

major_mask_rev_num	0x1
minor_mask_rev_num	0x1
jtag_id	0x1834_601D

Table 2. Revision History

Revision	Release Date	Significant Changes
4	6/2025	The following errata were added. <ul style="list-style-type: none">• ERR052559• ERR052226 The following errata were revised. <ul style="list-style-type: none">• ERR011235
3.2 February 2022	2/2022	The following errata were revised. <ul style="list-style-type: none">• ERR050575
3.1 August 2021	8/2021	The following errata were added. <ul style="list-style-type: none">• ERR010963• ERR050575 The following errata were revised. <ul style="list-style-type: none">• ERR011235• ERR010340• ERR050246
3.0 December 2019	12/2019	Revision history is now shown in reverse chronological order (newest first). Summary table now shows the complete erratum number. The following errata were added. <ul style="list-style-type: none">• ERR050130• ERR050090• ERR050246
Rev. 2.9 June 2019	6/2019	The following errata were removed. <ul style="list-style-type: none">• ERR011407 The following errata were added. <ul style="list-style-type: none">• ERR050159



Table 2. Revision History...continued

Revision	Release Date	Significant Changes
2.8 October 2018	10/2018	The following errata were added. <ul style="list-style-type: none"> • ERR011030 • ERR011407
2.7 May 2018	5/2018	Revision 2.7 May 2018 The following errata were added. <ul style="list-style-type: none"> • ERR011256 • ERR011235 • ERR011021 • ERR011295 • ERR011294 • ERR011293 The following errata were revised. <ul style="list-style-type: none"> • ERR010436 • ERR010900
2.6 August 2017	7/2017	The following errata were removed. <ul style="list-style-type: none"> • ERR007356 The following errata were added. <ul style="list-style-type: none"> • ERR010436 • ERR002340 • ERR010998 • ERR010900 The following errata were revised. <ul style="list-style-type: none"> • ERR009581
2.5 September 2016	9/2016	The following errata were added. <ul style="list-style-type: none"> • ERR010552 • ERR010506 • ERR010507 • ERR010088 • ERR010491 • ERR010340 • ERR007948 • ERR010505 • ERR010550 • ERR010489 • ERR010542 • ERR010327
2.4 February 2016	2/2016	The following errata were added. <ul style="list-style-type: none"> • ERR009783 • ERR009978 • ERR009656 • ERR010032 • ERR009809 • ERR009658 • ERR009664 The following errata were revised. <ul style="list-style-type: none"> • ERR008933
2.3 October 2015	10/2015	The following errata were removed.

Table 2. Revision History...continued

Revision	Release Date	Significant Changes
		<ul style="list-style-type: none"> • ERR008019 The following errata were added. <ul style="list-style-type: none"> • ERR008229
2.2 August 2015	8/2015	The following errata were added. <ul style="list-style-type: none"> • ERR009496 • ERR009631 • ERR009581 • ERR009493 The following errata were revised. <ul style="list-style-type: none"> • ERR006785 • ERR008555
2.1 July 2015	7/2015	The following errata were removed. <ul style="list-style-type: none"> • ERR008145 The following errata were added. <ul style="list-style-type: none"> • ERR007947 • ERR009250
2.0 May 2015	5/2015	The following errata were added. <ul style="list-style-type: none"> • ERR007274
1.0	2/2015	Initial Revision

1.2 Errata and Information Summary

Table 3. Errata and Information Summary

Erratum ID	Erratum Title
ERR002340	FEC: slot time is designed for 516 bit times; deviation from the 802.3
ERR003872	NAR: Emulation device may transmit random trace data during initialization
ERR003970	NAR: Trace messages include a 6-bit Source Identification field instead of 4-bits
ERR004136	XOSC and IRCOSC: Bus access errors are generated in only half of non-implemented address space of XOSC and IRCOSC, and the other half of address space is mirrored
ERR005570	SIUL2: Read operation of the SIUL2 MSCR bits that are permanently set (enabled) will return 1b0
ERR006350	LINFlexD: WLS feature cannot be used in buffered mode
ERR006425	LINFlexD: FIFO buffer can not be accessed without changing the RFC counter
ERR006428	LINFlexD: Data reception could terminate abruptly in LIN Slave mode when Time-out counter mode is enabled
ERR006775	SAR_ADC: Simultaneous calibration of SAR ADCs is not recommended
ERR006785	MEMU: ECC errors on FlexCAN RAM accesses indicate an incorrect error address in the peripheral RAM reporting table
ERR006788	DCI: Watchdog disable function is not available in the Emulation Device (ED) configuration
ERR006851	SWT: Software Timer interrupt may not cause device to exit STOP mode under certain clock configurations
ERR007204	SENT: Number of Expected Edges Error status flag spuriously set when operating with Option 1 of the Successive Calibration Check method

Table 3. Errata and Information Summary...continued

Erratum ID	Erratum Title
ERR007211	MC_ME: Core register IAC8 is cleared during a mode change when the core is reset
ERR007274	LINFlexD: Consecutive headers received by LIN Slave triggers the LIN FSM to an unexpected state
ERR007425	SENT: Unexpected NUM_EDGES_ERR error in certain conditions when message has a pause pulse
ERR007433	JTAGM: Nexus error bit is cleared by successful RWA
ERR007589	LINFlexD: Spurious timeout error when switching from UART to LIN mode or when resetting LINTCSR[MODE] bit in LIN mode
ERR007685	DSPI: A STOP mode transition hangs if a DSPI interrupt is issued between the STOP mode acknowledge (by DSPI module) and STOP mode entry
ERR007788	SIUL2: A transfer error is not generated for 8-bit accesses to non-existent MSCRs
ERR007844	FCCU: NCF status flag is not cleared after reset request from SWT_0 or SWT_3
ERR007845	FlexCAN: Limit Flexible Data rate (FD) baud rate to 6.67 Mbps
ERR007850	NXMC: XBAR data trace may overrun internal NXMC Message Buffers
ERR007871	SPC5746R:Current injection causes leakage path across the DSPI and LFAST LVDS pins
ERR007876	PASS: Debug interface state is not preserved through reset on secured devices after a functional reset
ERR007904	PASS: Programming Group Lock bit (PGL) can be de-asserted by multiple masters writing the correct password sections to the CINn registers.
ERR007905	PIT: Accessing the PIT by peripheral interface may fail immediately after enabling the PIT peripheral clock
ERR007929	SSCM: FLASH ECC errors are reported after the SSCM execution
ERR007947	XOSC: Incorrect external oscillator status flag after CMU event clear
ERR007948	TDM: Erase protection not enabled by reset
ERR007991	FLASH: Rapid Program or Erase Suspend fail status
ERR008004	FLASH: Array Integrity with Breakpoints enabled may skip addresses for certain RWSC and APC combinations
ERR008036	e200z425: Back to back XBAR transfers are not pipelined
ERR008039	SDADC: digital filter and FIFO not disabled when MCR[EN] is cleared
ERR008042	FCCU: EOUT signals are active, even when error out signaling is disabled
ERR008082	SENT: A message overflow can lead to a loss of frames combined with NUM_EDGES_ERR being set
ERR008225	SDADC: FIFO Flush Reset command requires clearing the Data FIFO Full Flag
ERR008229	FCCU: Enabling the programmable glitch filter on EIN may cause a destructive reset
ERR008252	eTPU: ETPU Angle Counter (EAC) Tooth Program Register (TPR) register write may fail
ERR008310	XBIC: Crossbar Integrity Checker may miss recording information from an initial fault event in the case of back-to-back faults
ERR008341	FlexCAN: Entering Freeze Mode or Low Power Mode from Normal Mode can cause the FlexCAN module to stop operating.
ERR008343	DCI: EVTO[1:0] outputs remain stuck low if asserted while the system clock source is the IRC

Table 3. Errata and Information Summary...continued

Erratum ID	Erratum Title
ERR008539	MEMU: Software Reset bit field is not protected by the Register Protection module
ERR008547	e200z425: Additional cycles required for Load/Store accesses to guarded/precise space
ERR008555	PMC: Over and under temperature flags may be set during reset
ERR008631	SDADC: low threshold watchdog cannot be used with signed data
ERR008730	XBIC: XBIC may store incorrect fault information when a fault occurs
ERR008759	FlexCAN: FD frame format not compliant to the new ISO/CD 11898-1: 2014-12-11
ERR008933	LINFlexD: Inconsistent sync field may cause an incorrect baud rate and the Sync Field Error Flag may not be set
ERR008935	JTAGM: write accesses to registers must be 32-bit wide
ERR008970	LINFlexD: Spurious bit error in extended frame mode may cause an incorrect Idle State
ERR009090	eTPU: Incorrect eTPU angle counter function under certain conditions
ERR009250	PASS: JTAG password not working during reset
ERR009493	STCU: FCCU NCF 6 does not automatically generate a destructive reset, when DCF_UTEST_Miscellaneous.STCU_CFB bit field is set (1)
ERR009496	PMC: FCCU NCF[4] fault may be triggered when DCF_PMC_REE_CTRL or DCF_PMC_RES_CTRL are programmed
ERR009581	FCCU: FOSU may assert destructive reset when a hardware recoverable fault of width less than one safe clock period occurs
ERR009631	MEMU: System RAM ECC errors on accesses by some masters report to MEMU Peripheral RAM table
ERR009656	DSPI: Frame transfer does not restart in case of SPI parity error in master mode
ERR009658	SPI: Inconsistent loading of shift register data into the receive FIFO following an overflow event
ERR009664	DSPI: Frame transfer does not restart in case of DSI parity error in master mode
ERR009783	DSPI: Frame transfer does not restart after DSI frame matches preprogrammed value
ERR009809	eTPU: MDU flags(Overflow/Carry) may be set incorrectly
ERR009978	eMIOS: Unexpected channel flag assertion during GPIO to MCB mode transition
ERR010032	FEC: MDC and MDIO signals are not on the FEC power supply segment
ERR010088	STCU2: Unexpected STCU self-test timeout can occur when a short sequence for external reset is triggered during execution of online self-test
ERR010327	ADC: Incorrect channel under measure is indicated after sampling phase of conversion until conversion completes
ERR010340	NZxC3: ICNT and HIST fields of a Nexus message are not properly reset following a device reset
ERR010436	ZipWire: SIPI can have only one initiator with one outstanding write frame at time
ERR010489	SIUL2: Open-drain or open-source configured outputs may briefly drive high or low during transitions
ERR010491	eDMA: When master ID replication is enabled, the stored ID and privilege level will change if read by another master

Table 3. Errata and Information Summary...continued

Erratum ID	Erratum Title
ERR010505	MC_CGM: The device can become stuck in reset after 'destructive' or external long 'functional' reset
ERR010506	MC_CGM: The device can become stuck in reset when a reset occurs during a system clock switch to any PLL
ERR010507	STCU: The device can become stuck in reset when destructive reset occurs during offline self-test when PLL is selected as BIST clock source
ERR010542	DSPI: Transmit, Command, and Receive FIFO fill flags in status register is not cleared when DMA is improperly configured
ERR010550	MC_CGM: Auxiliary clock dividers get stuck if programmed to divide by 2 and a reset occurs during operation
ERR010552	PASS: JTAG password match bypasses flash read protection set by PASS.LOCK3[RLx] bits
ERR010900	FCCU: False indication of a fault state for a single safe clock period can be generated on the error output pin
ERR010963	Flash: Memory accesses may be corrupted when flash is operating between 33MHz and 75MHz
ERR010998	BAF: Uncorrectable ECC error at flash location 0xFAC000 prevents device from booting
ERR011021	NAR: Trace to memory buffer pointers corrupted after break-point
ERR011030	PMC: Self Test can repeat when clearing the result flag
ERR011235	EMIOS: Any Unified Channel running in OPWMB or OPWMCB mode may function improperly if the source counter bus is generated by Unified channel in MC mode
ERR011256	FCCU: Redundancy control checker (RCC) reports false error in FCCU_SCFS register
ERR011293	EMIOS: For any UC operating in OPWFMB mode the Channel Count register should not be written with a value greater than Channel B Data register value
ERR011294	EMIOS: OPWFMB and MCB mode counter rollover resets the counter to 0x0 instead of 0x1 as mentioned in the specification
ERR011295	EMIOS: In OPWFMB mode, A1/B1 registers do not get reloaded with A2/B2 register values if counter value returns 0x1 after counter wrap condition
ERR050090	DSPI/SPI: Incorrect data may be transmitted in slave mode
ERR050130	PIT: Temporary incorrect value reported in LMTR64H register in lifetimer mode
ERR050159	CMU: Monitoring signal for sudden loss of clock from CMU does not signal the Fault Collection and Control Unit
ERR050246	FlexCAN: Receive Message Buffers may have its Code Field corrupted if the Receive FIFO function is used
ERR050575	eMIOS: Any Unified Channel running in OPWMCB mode may function improperly if the lead or trail dead time insertion features is used and its timebase is generated by Unified channel in MCB mode
ERR052226	SWT: Toggling watchdog enable may cause unexpected timeout in some boundary conditions
ERR052559	INTC: Register updated on bus error

2 Known Errata

ERR002340: FEC: slot time is designed for 516 bit times; deviation from the 802.3

Description

The Fast Ethernet Controller (FEC) slot time is 516 bit times which is longer than the 512 bit times specified by the IEEE 802.3 standard.

If a collision occurs after the standard 512 bit times (but prior to 516 bit times), the FEC may generate a retry that a remote ethernet device may identify as late. In addition, the slot time is used as an input to the backoff timer, therefore the FEC retry timing could be longer than expected.

Workaround

No software workaround is needed or available.

ERR003872: NAR: Emulation device may transmit random trace data during initialization

Description

On emulation devices with multiple instantiations of the Nexus Aurora Router (NAR), if the NAR module directly connected to the Nexus clients (e200zx core Nexus clients, Nexus CrossBar clients, Generic Timer Module Debug Interface) is enabled by the second NAR (NAR on the Buddy Die in the emulation device), then the first NAR may generate 8 words (32-bit) of random data packet that could be transmitted. These would occur after the Device ID is transmitted by the emulation device only NAR. The device ID from the first NAR (in the Production die) may not be transmitted.

Workaround

Either disregard the extraneous data, or enable the NAR (NAR Enable) connected directly to the MCU Nexus clients first in the NAR Control Register (NAR_CR[NEN]=0b1), then enable the additional emulation device NAR.

ERR003970: NAR: Trace messages include a 6-bit Source Identification field instead of 4-bits

Description

The source field (SRC) of trace messages from the Nexus Aurora Router are 6-bits in length. All other clients implement a 4-bit SRC field. Per the IEEE-ISTO 5001 Standard (Nexus) the SRC field of all clients on a device should be the same length. The two most significant bits of the SRC are 0b00.

Workaround

Tools should treat the SRC field as a 4-bit field for all Nexus clients. In addition, tools should ignore the extra 2-bits as an extra field with no meaning. In the case of the NAR Error Message (TCODE=8), these two bits are between the 4-bit SRC field and the 4-bit Error Type (ETYPE) field. For the NAR Watchpoint Message, these bits are between the 4-bit SRC and the 6-bit Watchpoint Hit (WPHIT) field.

ERR004136: XOSC and IRCOSC: Bus access errors are generated in only half of non-implemented address space of XOSC and IRCOSC, and the other half of address space is mirrored**Description**

Bus access errors are generated in only half of the non-implemented address space of Oscillator External Interface (40MHz XOSC) and IRCOSC Digital Interface (16MHz Internal RC oscillator [IRC]). In both cases, the other half of the address space is a mirrored version of the 1st half. Thus reads/writes to the 2nd half of address space will actually read/write the registers of corresponding offset in the 1st half of address space.

Workaround

Do not access unimplemented address space for XOSC and IRCOSC register areas OR write software that is not dependent on receiving an error when access to unimplemented XOSC and IRCOSC space occurs.

ERR005570: SIUL2: Read operation of the SIUL2 MSCR bits that are permanently set (enabled) will return 1b0**Description**

The System Integration Unit Lite2 (SIUL2) Multiplexed Signal Configuration Register (MSCR) bits for pad control which are permanently set (enabled) will be read as 1b0. These bits are read-only bits.

The MSCR bits which are not configurable are and permanently set (enabled) include SRC, OBE, ODE, SMC, APC, IBE, HYS, PUS, PUE, INV.

Please see the Section "Address map and configuration for MSCR/IMCR registers" in the Signal Description chapter for pad configuration options of the Reference Manual.

Workaround

Software should expect to read back 1b0 when reading the permanently set bits in the MSCR.

ERR006350: LINFlexD: WLS feature cannot be used in buffered mode**Description**

The Flexible Local Interconnect Network (LINFlex) module may not operate correctly if the Special Word Length (WLS) for enabling 12-bit data length is selected in the Universal Asynchronous Receiver/Transmitter (UART) Mode Control Register (UARTCR) and the module is configured in the receive buffered mode.

Workaround

When WLS mode is required, always use the First In, First Out (FIFO) mode of the UART LINFLEX module by setting the Receive FIFO/Buffer mode bit of the UARTCR (UARTCR[RFBM]=1). In addition, the UART word length bits must be set (UARTCR[WL0] = 0b1 and UARTCR[WL1] = 0b1).

ERR006425: LINFlexD: FIFO buffer can not be accessed without changing the RFC counter**Description**

When LINFlexD is enabled in First In, First Out (FIFO) mode by setting the Receive FIFO/Buffer mode (RFBM) bit in the Universal Asynchronous Receiver/Transmitter Control Register (UARTCR register), the Reception Data Field Length/receive FIFO Counter (RDFL_RFC) will be decremented on every read access of Buffer Data Register Most Significant (BDRM) register through the debugger.

Workaround

If the user does not want the debugger to decrement the RDFL_RFC, access to the BDRM must be avoided in the debugger.

ERR006428: LINFlexD: Data reception could terminate abruptly in LIN Slave mode when Time-out counter mode is enabled**Description**

When the Local Interconnect Network module (LINFlexD) is used in LIN Slave mode, and in the LIN Time-Out Control Status Register (LINTCSR) the time-out counter mode is configured to LIN mode (LINTCSR[MODE]=0), the Output Compare value 2 in LIN Output Compare Register (LINOOCR[OC2]) is loaded by hardware to monitor the response duration.

This loaded value may be incorrect and may lead to setting the Output Compare Flag in the LIN Error Status register (LINESR[OCF]) after which data reception is terminated by the LIN slave.

Workaround

Use the LINFlexD in LIN Slave mode with time-out control disabled in the LIN Time-out Control Status register (LINTCSR[TOCE]=0).

ERR006775: SAR_ADC: Simultaneous calibration of SAR ADCs is not recommended**Description**

If the Successive Approximation Analog to Digital Converter (SAR_ADC) calibration and built in self test control and status register (SAR_CALBISTREG) test enable bit (TEST_EN) bit are set for more than one SAR_ADC at a time, such that more than one SAR_ADC is executing calibration simultaneously, the resulting calibration calculations may be incorrect. This may cause performance degradation.

Workaround

Software should enable calibration for only one SAR_ADC at a time, by setting the CALBISTREG[TEST_EN] bit and then monitoring the calibration test busy bit (C_T_BUSY) bit in the CALBISTREG register. Do not start calibration on any other SAR_ADCs until the C_T_BUSY bit is cleared, indicating that the current calibration is complete.

ERR006785: MEMU: ECC errors on FlexCAN RAM accesses indicate an incorrect error address in the peripheral RAM reporting table

Description

Single bit correction and multi-bit error events detected in the FlexCAN RAM by an Error Correction Code (ECC) check are not captured in the Memory Error Management Unit (MEMU) peripheral RAM reporting table with the correct error address.

Workaround

If the Fault Collection and Control Unit (FCCU) receives an alarm alert from the Peripheral RAM Correctable Error (NCF[25]), software can confirm that Peripheral RAM is the source of the failure by checking the Peripheral RAM Correctable Error (PR_CE) flag in the MEMU Error Flag register (MEMU_ERR_FLAG) and by searching for address 0x00000000 in the correctable error reporting table (MEMU_PERIPH_RAM_CERR_ADDR0 and MEMU_PERIPH_RAM_CERR_ADDR1 registers).

If the FCCU receives an alarm alert from Peripheral RAM Uncorrectable Error (NCF[26]), software can confirm that Peripheral RAM is the source of the failure by checking the Peripheral RAM Uncorrectable Error (PR_UCE) flag in the MEMU_ERR_FLAG register and by searching for address 0x00000000 in the uncorrectable error reporting table (MEMU_PERIPH_RAM_UNCERR_ADDR register).

After the source of the failure has been confirmed, software can check the Correctable Error Interrupt Flag (CEIF), Host Access With Non-Correctable Error Interrupt Flag (HANCEIF), and FlexCAN Access With Non-Correctable Error Interrupt Flag (FANCEIF) flags in the FlexCAN Error Status Register (CAN_ERRSR) for all four instances of the FlexCAN in order to determine which specific instance generated the error. The software can then read the FlexCAN Error Report Address Register (CAN_RERRAR) corresponding to the instance which caused the error to obtain the correct relative error address.

ERR006788: DCI: Watchdog disable function is not available in the Emulation Device (ED) configuration

Description

The Debug and Calibration Interface (DCI) watchdog disable function is available only on the production device configuration. The feature to disable the Software Watchdog Timer (SWT) by asserting EVTIO is not available on the emulation device.

Workaround

Do not expect the DCI watchdog disable function to operate on the emulation device. Tools should disable the software watchdog timers by clearing the Software Watchdog Timer Control Register Watchdog Enable field (SWT_CR[WEN]) if required.

ERR006851: SWT: Software Timer interrupt may not cause device to exit STOP mode under certain clock configurations

Description

The Software Watchdog Timer (SWT) can generate a pulse that is latched by the Mode Entry module (MC_ME), which then initiates an exit from STOP mode.

The MC_ME is clocked at the peripheral bridge clock frequency (PBRIDGEx_CLK), which is the system clock frequency divided by 4. However, during STOP mode the system clock is switched by the Clock Generation Module (MC_CGM) to the 16MHz IRC (Internal RC Oscillator), so the resulting PBRIDGEx_CLK frequency is 4 MHz.

Because the SWT wakeup pulse to the MC_ME is generated on the undivided IRC reference (16 MHz), there is a chance that the MC_ME, being clocked at 4 MHz during STOP mode, may miss the wakeup pulse assertion and fail to exit STOP mode.

Workaround

- 1) Using the MC_ME, configure RUNn mode (n = 1,2, or 3) to use the IRC as the system clock source by setting the IRC On bit (IRCON) in the Mode Entry RUNn Mode Configuration register for the selected RUNn mode.
- 2) If the SWT 0/Core 0 pair is to be used to exit from STOP mode, configure Core 0 to be active in the selected RUNn mode, using the Mode Core 0 Control Register (For MPC5746R this is ME_MCCTL[1]). SWT 1/Core 1 are active for all run modes by default.
- 3) Switch to the RUNn mode chosen for the system configurations to take effect.
- 4) Reconfigure the CGM System Clock Divider Configuration 0, 1, and 2 registers (MC_CGM_SC_DC0, MC_CGM_SC_DC1 and MC_CGM_SC_DC2) so that the PBRIDGE_CLK is set to 16MHz.
- 5) Using the MC_ME, initiate the change to STOP mode.
- 6) When the SWT generates an interrupt, the system will exit STOP mode and resume in the last run mode selected.
- 7) Reconfigure the MC_CGM_SC_DC0, MC_CGM_SC_DC1 and MC_CGM_SC_DC2 divider registers to put the system back at the desired operating frequency.
- 8) Using the MC_ME initiate a mode change back to RUN0.

ERR007204: SENT: Number of Expected Edges Error status flag spuriously set when operating with Option 1 of the Successive Calibration Check method

Description

When configuring the Single Edge Nibble Transmission (SENT) Receiver (SRX) to receive message with the Option 1 of the successive calibration pulse check method (CHn_CONFIG[SUCC_CAL_CHK] = 1), the number of expected edges error (CHn_STATUS[NUM[EDGES_ERR]) gets randomly asserted. Option 2 is not affected as the number of expected edges are not checked in this mode.

The error occurs randomly when the channel input (on the MCU pin) goes from idle to toggling of the calibration pulse.

Note: The Successive Calibration Pulse Check Method Option 1 and Option 2 are defined as follows:

Option 2 : Low Latency Option per SAE specification

Option 1 : Preferred but High Latency Option per SAE specification

Workaround

To avoid getting the error, the sensor should be enabled first (by the MCU software) and when it starts sending messages, the SENT module should be enabled in the SENT Global Control register (by making GBL_CTRL[SENT_EN] = 1). The delay in start of the two can be controlled by counting a fixed delay in software between enabling the sensor and enabling the SENT module. The first message will not be received but

subsequent messages will get received and there will be no false assertions of the number of expected edges error status bit (CHn_STATUS[NUM[EDGES_ERR]]).

Alternatively, software can count the period from SENT enable (GBL_CTRL[SENT_EN] = 1) to the first expected calibration pulse. If the number of expected edges error status bit (CHn_STATUS[NUM[EDGES_ERR]]) is asserted, software can simply clear it as there have no messages which have been completely received.

Alternatively, the software can clear this bit at the start and move ahead. When pause pulse is enabled, then NUM_EDGES will not assert spuriously for subsequent messages which do not have errors in them or cause overflows.

ERR007211: MC_ME: Core register IAC8 is cleared during a mode change when the core is reset

Description

If a core is reset (ME_CADDR[0,1,2].RMC =1) in the Core Address register during a Mode Entry module (MC_ME) mode change then the Instruction Address Compare 8 (IAC8) register within the core which receives the reset will be cleared. In this implementation IAC8 is used as the Security watchdog service address. If a watchdog time-out occurs after this mode change and no valid service address exists, the core will attempt to execute code from the invalid address potentially resulting in an exception.

The watchdog (SWT) associated with that core is not reset by this change and retains its configuration. If fixed address execution is configured by the Service Mode in the software watchdog control register (SWT_CR.SMD= 0b10) when IAC8 is cleared to 0, it will not be possible to update IAC8 with the correct value. For other service modes the IAC8 register will be cleared to 0, but can be updated.

Workaround

If the software watchdog mode is in fixed address execution (SWT_CR.SMD= 0b10), do not reset the corresponding core upon mode change. For all other modes, IAC8 must be updated by software immediately after the mode transition completes.

ERR007274: LINFlexD: Consecutive headers received by LIN Slave triggers the LIN FSM to an unexpected state

Description

As per the Local Interconnect Network (LIN) specification, the processing of one frame should be aborted by the detection of a new header sequence and the LIN Finite State Machine (FSM) should move to the protected identifier (PID) state. In the PID state, the LIN FSM waits for the detection of an eight bit frame identifier value.

In LINFlexD, if the LIN Slave receives a new header instead of data response corresponding to a previous header received, it triggers a framing error during the new header's reception and returns to IDLE state.

Workaround

The following three steps should be followed -

- 1) Configure slave to Set the MODE bit in the LIN Time-Out Control Status Register (LINTCSR[MODE]) to '0'.
- 2) Configure slave to Set Idle on Timeout in the LINTCSR[IOT] register to '1'. This causes the LIN Slave to go to an IDLE state before the next header arrives, which will be accepted without any framing error.
- 3) Configure master to wait for Frame maximum time (T Frame_Maximum as per LIN specifications) before sending the next header.

Note:

$$THeader_Nominal = 34 * TBit$$

$$TResponse_Nominal = 10 * (NData + 1) * TBit$$

$$THeader_Maximum = 1.4 * THeader_Nominal$$

$$TResponse_Maximum = 1.4 * TResponse_Nominal$$

$$TFrame_Maximum = THeader_Maximum + TResponse_Maximum$$

where TBit is the nominal time required to transmit a bit and NData is number of bits sent.

ERR007425: SENT: Unexpected NUM_EDGES_ERR error in certain conditions when message has a pause pulse

Description

When the Single Edge Nibble Transmission (SENT) Receiver (SRX) is configured to receive a pause pulse (Channel 'n' Configuration Register - CHn_CONFIG[PAUSE_EN] = 1) the NUM_EDGES error can get asserted spuriously (Channel 'n' Status Register - CHn_STATUS[NUM_EDGES_ERR] = 1) when there is any diagnostic error (other than number of expected edges error) or overflow in the incoming messages from the sensor.

Workaround

Software can distinguish a spurious NUM_EDGES_ERR error from a real one by monitoring other error bits. The following tables will help distinguish between a false and real assertion of NUM_EDGES_ERR error and other errors. Software should handle the first error detected as per application needs and other bits can be evaluated based on these tables. The additional error may appear in the very next SENT frame. Table 1 contains information due to erratum behavior. Table 2 contains clarification of normal NUM_EDGES_ERR behavior.

Table 1. Erratum behavior of NUM_EDGES_ERR

Table:

First Error Detected	Other error bits asserted	Cause for extra error bits getting asserted	Action
NIB_VAL_ERR	NUM_EDGES_ERR asserted twice	Upon detection of the first error, the state machine goes into a state where it waits for a calibration pulse, the first NUM_EDGES_ERR error is for the current message as the state machine does not detect an end of message. The second error comes when both the Pause pulse and the Calibration pulse are seen as back to back calibration pulses and no edges in between.	Ignore both NUM_EDGES_ERR error

FMSG_CRC_ERR	NUM_EDGES_ERR asserted twice	Same as NIB_VAL_ERR.	Ignore both NUM_EDGES_ERR errors
CAL_LEN_ERR	NUM_EDGES_ERR asserted once	Since the calibration pulse is not detected as a valid calibration pulse, the internal edges counter does not detect the end of one message and start of bad message (which has CAL_LEN_ERR); hence the NUM_EDGES_ERR gets asserted.	Ignore NUM_EDGES_ERR error
FMSG_OFLW	NUM_EDGES_ERR asserted once (random occurrence)	A message buffer overflow may lead the state machine to enter a state where it waits for a calibration pulse (behavior also seen in ERR007404). When in this state, the state machine can detect both a Pause pulse and a Calibration pulse as back to back calibration pulses and no edges in between. Then, the NUM_EDGES_ERR can get asserted. Since entry into this state is random, the error can be seen occasionally.	Ignore NUM_EDGES_ERR error

Table 2. Expected behavior, clarification of NUM_EDGES_ERR cases

Table:

First Error Detected	Other error bits asserted	Cause for extra error bits getting asserted	Action
NUM_EDGES_ERR (when edges are less than expected)	NIB_VAL_ERR is asserted	When the actual number of edges in the message are less than expected, then a pause pulse gets detected as a nibble since the state machine expects nibbles when actually there is a pause pulse present. This generates NIB_VAL_ERR.	Ignore the NIB_VAL_ERR
NUM_EDGES_ERR (when edges are more than expected)	NIB_VAL_ERR and PP_DIAG_ERR are asserted	When the actual number of edges in a message are more than expected, then after receiving the programmed number of	Ignore NIB_VAL_ERR and PP_DIAG_ERR

	<p>data nibbles, the state machine expects a pause pulse. However, the pause pulse comes later and gets detected as a nibble and hence NIB_VAL_ERR is asserted. Since the message length is not correct, PP_DIAG_ERR is also asserted.</p>	
--	--	--

ERR007433: JTAGM: Nexus error bit is cleared by successful RWA

Description

The JTAG Master module status register includes a Nexus error status bit (JTAGM_SR[Nexus_err]) that indicates the status of the last Nexus Read/Write Access (RWA) command. Once this information is latched, it can only be cleared by performing a successful RWA transaction via the same core that caused the error. In addition, if a RWA transaction is performed by a different core, the error bit will not be cleared and it is not possible to determine if the access by the second core RWA was successful or generated another error.

In general, this bit should only be set when the Nexus RWA accesses non-existent or protected memory spaces.

Workaround

If the status information is required from a specific core, the user software or tool should read the error bit (ERR) of the e200zx core's Nexus Read/Write Access Control/Status register. To avoid setting the error bit, do not perform illegal memory accesses.

ERR007589: LINFlexD: Spurious timeout error when switching from UART to LIN mode or when resetting LINTCSR[MODE] bit in LIN mode

Description

If the LINFlexD module is enabled in Universal Asynchronous Receiver/Transmitter (UART) mode and the value of the MODE bit of the LIN Timeout Control Status register (LINTCSR) is 0 (default value after reset), any activity on the transmit or receive pins will cause an unwanted change in the value of the 8-bit field Output Compare Value 2 (OC2) of the LIN Output Compare register (LINOCR).

If the LINFlexD module is enabled in LIN mode and the value of the MODE bit of the LIN Timeout Control Status register (LINTCSR) is changed from '1' to '0', then the old value of the Output Compare Value 1 (OC1) and Output Compare Value 2 (OC2) of the LIN Output Compare register (LINOCR) is retained.

As a consequence, if the module is reconfigured from UART to Local Interconnect Network (LIN) mode, or LINTCSR MODE bit is changed from '1' to '0', an incorrect timeout exception is generated when the LIN communication starts.

Workaround

If the LINFlexD module needs to be switched from UART mode to LIN mode, before writing UARTCR[UART] to 1, ensure that the LINTCSR[MODE] is first set to 1.

If the LINFlexD module is in LIN mode and LINTCSR[MODE] needs to be switched from 1 to 0 in between frames, the LINOCCR must be set to 0xFFFF by software.

ERR007685: DSPI: A STOP mode transition hangs if a DSPI interrupt is issued between the STOP mode acknowledge (by DSPI module) and STOP mode entry

Description

The following sequence of events can cause the application to hang when a run mode change to STOP mode is initiated using the Mode Entry (MC_ME) module and the De-serial Serial Peripheral Interface module (DSPI) is running.

1. The application requests a transition to STOP by writing the Mode Entry Mode Control Register (MC_ME_MCTL) TARGET_MODE bit field with the value 0b1010 along with the KEY field (0xA000_A50F), and then writing MC_ME_MCTL again with the TARGET_MODE and inverted KEY field (0xA000_5AF0).
2. The MC_ME issues a STOP request to all running modules and they acknowledge this request when they are ready to go to STOP.
3. The DSPI generates an interrupt immediately before sending the STOP acknowledge to MC_ME module.
4. The e200z core is still active because the MC_ME is still waiting for all running modules to acknowledge the STOP request, and upon receiving the DSPI interrupt it initiates the service routine.
5. In the service routine, the core attempts to clear the DSPI interrupt flag by writing to the DSPI Status Register (DSPI_SR) but the write does not complete, because the DSPI module has issued the STOP acknowledge and is no longer running.

Since the interrupt from the DSPI module cannot be cleared, the mode transition to STOP mode hangs.

Workaround

Use one of the two possible workarounds:

1. The application software should ensure that the DSPI module is idle and no DSPI interrupt can be asserted before the MC_ME starts a STOP mode transition.
2. Clock gate the DSPI module before starting a STOP mode transition by clearing the Divider Enable (DE) bit in the Clock Generation Module Aux Clock x Divider Configuration y (MC_CGM_ACx_DCy) registers that configure the DSPI clocks.

ERR007788: SIUL2: A transfer error is not generated for 8-bit accesses to non-existent MSCRs

Description

An 8-bit access attempt to non-existent MSCRs (Multiplexed Signal Configuration Registers) in the SIUL2 (System Integration Unit Light 2) address space does not generate a transfer error. 16-bit or 32-bit accesses to non-existent MSCRs will generate a transfer error.

Workaround

Do not expect transfer errors on 8-bit accesses to non-existent MSCRs in the SIUL2 address space.

ERR007844: FCCU: NCF status flag is not cleared after reset request from SWT_0 or SWT_3**Description**

The fault status flag (NCF) in the Fault Control and Collection Unit (FCCU) will not be automatically cleared after a reset request from either of the Software Watchdog Timers (SWT_0 or SWT_3).

Workaround

After a SWT_0 or SWT_3 request to the FCCU and a subsequent reset, software should clear the corresponding NCF status flags (NCF index 21 for SWT_0 or NCF index 17 for SWT_3) in the FCCU_NCF_Sx register.

ERR007845: FlexCAN: Limit Flexible Data rate (FD) baud rate to 6.67 Mbps**Description**

When operating the FlexCAN module in flexible data rate (FD) mode, the maximum baud rate is limited to 6.67 Mega-bits per second (Mbps).

Workaround

Do not configure the FlexCAN baud rate to a value greater than 6.67 Mbps when using the flexible data rate (FD) mode.

ERR007850: NXMC: XBAR data trace may overrun internal NXMC Message Buffers**Description**

Data trace of the crossbar (XBAR or AXBS) master accesses by the Nexus XBAR Multi-Master Trace Client (NXMC) may overrun the Nexus Aurora Router (NAR) if an excessive amount of data trace data is requested by a tool.

Workaround

If an overrun of the NXMC output buffers are seen (errors are getting flagged by the NAR to the trace tool), reduce the number of successive data trace values to a maximum of 64 bytes when tracing reads or writes only (sixteen 32-bit words or 32 16-bit half-words). If both reads and writes are being traced, limit the consecutive data trace messages to successive 16 byte values at a time (four 32-bit words or eight 16-bit half-words). Sufficient time must be allowed for the NXMC buffers to be read by the NAR before resuming data trace. If data trace is limited on the NXDM to approximately 1 data trace message every 10 system clocks (5 Direct Memory Access module clocks), the buffers should not be overrun.

NXCM overflow errors will insert an error message (TCODE = 0x8), with the NXMC source id (SRC = 0xC), the Queue overrun error type (ETYPE = 0x0), and the Data Trace message(s) lost error code (ECODE = 0x02).

An alternative workaround is to allow errors to occur and expect missing data trace information.

ERR007871: SPC5746R: Current injection causes leakage path across the DSPI and LFAST LVDS pins

Description

The General Purpose Input/Output (GPIO) digital pins (including all digital CMOS input or output functions of the pin) connected to the differential LVDS drivers of the Deserial/Serial Peripheral Interface (DSPI) and LVDS Fast Asynchronous Serial Transmit Interface (LFAST) do not meet the current injection specification given in the operating conditions of the device electrical specification. When the LVDS transmitter or receiver is disabled and current is positively or negatively injected into one pin of the GPIO pins connected to the differential pair, a leakage path across the internal termination resistor of the receiver or through the output driver occurs potentially corrupting data on the complementary GPIO pin of the differential pair. All LFAST and DSPI LVDS receive and transmit GPIO pairs on the SPC5746R exhibit the current injection issue.

There is an additional leakage path for the LFAST receive pins through the loopback test path when current is negatively injected into a GPIO pin connected to an LFAST pair. In this case current will be injected into the same terminal of the GPIO pin connected through the loopback path (positive terminal to positive terminal, negative terminal to negative terminal). The pins affected by the loopback path on the SPC5746R are: PA[1] to/from PA[5], and PA[2] to/from PA[6].

There is no leakage issue when the pins are operating in normal LVDS mode (both LVDS pairs of the LFAST interface configured as LVDS).

Workaround

As long as the GPIO pad pins are operated between ground (VSS_HV_IO) and the Input/Output supply (VDD_HV_IO) then no leakage current between the differential pins occurs. If the GPIO pad is configured as an input buffer then the input voltage cannot be above the supply, below ground, and no current injection is allowed. If the GPIO pad is configured as an output care should be taken to prevent undershoot/overshoot/ringing during transient switching of capacitive loads. This can be done by carefully configuring the output drive strength to the capacitive load and ensuring board traces match the characteristic impedance of the output buffer to critically damp the rising and falling edges of the output signal.

ERR007876: PASS: Debug interface state is not preserved through reset on secured devices after a functional reset

Description

The Password Access and Security Module (PASS) module is a security module that uses an optional password mechanism to protect unauthorized access to the debug Interface, which allows the enabling of Nexus clients. After a successful password challenge is met, the debug tool has control of the debug interface. However the state of the interface, a successfully entered password challenge, is not preserved during a functional reset.

Workaround

After a functional reset, the password challenge must be successfully entered again to re-enable the access to the debug interface.

ERR007904: PASS: Programming Group Lock bit (PGL) can be de-asserted by multiple masters writing the correct password sections to the CINn registers.**Description**

The eight Challenge Input Registers (CINn) in the Password and Device Security Module (PASS) where the 256-bit unlock lock password (8 x 32-bit registers) is provided, can be written by multiple masters. If the written password is correct even though it has been provided from different masters, the password Group Lock (PASS PGL) in the Password Group n Lock 3 Status register (PASS_LOCK3_PGn) is de-asserted and UnLockMaster (MSTR) is set to 0xF.

Therefore, internal registers would not be writable by any of the master other than master whose ID is 0xF if the Master Only (MO) bit is set PASS_LOCK3_PGn.

If a Master wants to update internal registers, it needs to unlock the PASS by writing into all the 8 Password registers.

Workaround

Set the master only bit inside the PASS (LOCK3_PGn.MSTR) to block other master accesses to the unlocked registers. If the written password has been provided from different masters, a single master should perform the unlock operation again by writing into all the 8 password registers.

ERR007905: PIT: Accessing the PIT by peripheral interface may fail immediately after enabling the PIT peripheral clock**Description**

If a write to the Periodic Interrupt Timer (PIT) module enable bit (PIT_MCR[MDIS]) occurs within two bus clock cycles of enabling the PIT clock gate in the MC_CGM (Clock Generation Module) register, the write will be ignored and the PIT will not be enabled.

Workaround

After enabling the PIT clock in the MC_CGM, insert a read of the PIT_MCR register before writing to the PIT_MCR register. This guarantees a minimum delay of two bus clocks to guarantee the write is not ignored.

ERR007929: SSCM: FLASH ECC errors are reported after the SSCM execution**Description**

During the reset phase, the System Status and Configuration Module (SSCM) reads device configuration information from FLASH memory, which generates expected Error Correction Coding (ECC) errors in the FLASH memory. These expected ECC errors are intended to be masked and not logged in the FLASH Module Configuration Register ECC Error Bit (FLASH_MCR[EER]). However, the SSCM incorrectly allows the FLASH_MCR[EER] bit to be set when the part comes out of reset, rather than cleared. This can potentially mask any legitimate FLASH ECC errors that could occur later.

Workaround

Immediately after the Boot Assist Flash (BAF) passes control to the user application code, software should clear the false ECC Log event by setting the FLASH_MCR[ERR] bit to 0b1.

ERR007947: XOSC: Incorrect external oscillator status flag after CMU event clear**Description**

If an external oscillator (XOSC) is enabled and it becomes unstable (or the crystal fails), the Oscillator Lost Reference status flag in the Clock Monitor Unit Interrupt Status register (CMU0.CMU_ISR[OLRI]) will be set. In addition, the Crystal Oscillator Status flag in the Mode Entry module Global Status Register (MC_ME_GS.S_XOSC) will be cleared (1 = stable clock, 0 = no valid clock). However, if the CMU_ISR[OLRI] is cleared while the oscillator is still in a failing condition, the MC_ME_GS.S_XOSC will incorrectly be set, indicating a valid crystal oscillator.

Workaround

Monitor the XOSC external oscillator status using the MC_ME_GS.S_XOSC before the CMU0.CMU_ISR.OLRI flag is set. After the CMU0.CMU_ISR.OLRI flag has been set, the MC_ME_GS.S_XOSC flag is valid only after a functional reset. Alternately, the response to the OLRI flag after loss of XOSC clock, can be set in the FCCU to cause a functional reset to clear the MC_ME_GS.S_XOSC flag.

ERR007948: TDM: Erase protection not enabled by reset**Description**

When writing a record to the Tamper Detection Module (TDM) diary to allow erase of a flash block, if functional reset occurs during the erase operation, further erase of the flash block may be allowed until the next destructive reset.

Workaround

Prior to programming a flash block protected by a TDM diary, verify that the tamper region is locked by reading the TDR Status Register (TDM_TDRSR). If the TDRSRx bit of the region indicates the TDR is unlocked, the TDR should be locked (prior to programming) by performing a destructive reset. Other alternatives are to check the TDM_TDRSR after reset, and issue destructive reset if the TDR is unlocked. Or if the TDM_TDRSR indicates the TDR is unlocked, issue another erase operation.

ERR007991: FLASH: Rapid Program or Erase Suspend fail status**Description**

If a flash suspend operation occurs during a 5us window during a verify operation being executed by the internal flash program and erase state machine, and the suspend rate continues at a consistent 20us rate after that, it is possible that the flash will not exit the program or erase operation. A single suspend during a single program or erase event will not cause this issue to occur.

Per the flash specification, a flash program or erase operation should not be suspended more than once every 20 us, therefore, if this requirement is met, no issue will be seen. IF the suspend rate is faster than 20 us continuously, a failure to program/erase could occur.

Workaround

When doing repeated suspends during program or erase ensure that suspend period is greater than 20us.

ERR008004: FLASH: Array Integrity with Breakpoints enabled may skip addresses for certain RWSC and APC combinations

Description

For certain combinations of the Flash Read Wait State Control (RWSC) and Address Pipeline Control (APC) settings in the Platform Flash Configuration Register (PFLASH_PCFR1) the Flash's array integrity (AI) check when run with breakpoints enabled may skip addresses resulting in an incorrect Multiple Input Signature Register (MISR) value or in the case of back to back ECC event errors (EER) or Single Bit Correction (SBC) events, a skipped breakpoint. This occurs for the following combinations:

RWSC=1 and APC=1

RWSC=3 and APC=2

RWSC=5 and APC=3

If breakpoints are enabled and an EER or SBC cause a breakpoint to occur the address after the breakpoint will be skipped, and the resulting MISR will not match expectations. Likewise, if there are back to back errors (EER or SBC) during AI with the above RWSC/APC combinations the 2nd error (and breakpoint) will be missed.

Margin Read (which by specification is a self timed event and is independent of wait states selected) is not affected by this erratum. This erratum only applies to Array Integrity.

Workaround

One workaround is to follow the recommended RWSC and APC combinations for given frequencies. If this is done, Array Integrity with Breakpoints feature works as expected. Valid RWSC/APC combinations listed in the specification are:

Table:

Flash Operating Frequency	RWSC	APC
30 MHz	0	0
100 MHz	2	1
133 MHz	3	1
167 MHz	4	1
200 MHz	5	2

A second workaround is if the above RWSC and APC combinations (listed in the description) are desired to be checked, do so without enabling breakpoints. In this case, the first EER or SBC event will be logged, and the MISR will correctly reflect the result of all reads being executed.

ERR008036: e200z425: Back to back XBAR transfers are not pipelined

Description

Back to back e200z425* (with no data cache) load requests are not pipelined through the Cross Bar (XBAR) bus if the first access has a wait state.

Workaround

Expect that the core performance could be slightly reduced from ideal when accessing data back to back through the Crossbar bus. Back to back loads that are performed in sequential instructions (with no instructions

between the accesses). Critical, time-sensitive variables that are frequently accessed sequentially should be stored in local Data memory (DMEM).

ERR008039: SDADC: digital filter and FIFO not disabled when MCR[EN] is cleared

Description

When the Enable bit (EN) of the Sigma-Delta Analog to Digital Converter (SDADC) Module Configuration Register (MCR) is cleared (MCR[EN]=0), the digital part of the SDADC continues operating and does not go to low power mode if the module is disabled while a valid conversion is already in process and the application software continues to initiate conversions. As a consequence, the digital block of the SDADC still produces new conversion results in the Channel Data Register (CDR) and dummy data are transferred to the result First-In, First-Out (FIFO) buffers. In addition, interrupt and/or Direct Memory Access (DMA) events are still generated.

Note: the analog part does enter the power-down mode, reducing the consumption on the ADC high voltage supply domain (VDD_HV_ADV).

Workaround

Do not initiate a conversion prior to enabling the SDADC (MCR[EN]=1). In addition, once the SDADC has been enabled (MCR[EN]=1), if the SDADC needs to be disabled (MCR[EN]=0), prior to clearing the EN bit, either turn off the clock to the SDADC module in the Clock Generation Module (CGM) or Select the External Modulator Mode (EMSEL) by setting the MCR[EMSEL] bit along with the clearing the MCR[EN].

ERR008042: FCCU: EOUT signals are active, even when error out signaling is disabled

Description

Every time the Fault Collection and Control Unit (FCCU) moves into fault state caused by an input fault for which the error out reaction is disabled (FCCU_EOUT_SIG_ENn[EOUTENx]=0), the Error Out 1 and 2 (EOUT[0] and EOUT[1]) will become active for a duration of 250 us plus the value programmed into the FCCU Delta Time register (FCCU_DELTA_T[DELTA_T]). EOUT is not affected if the FCCU moves into the alarm state that generates an interrupt (IRQ), if the Fault is cleared before the alarm timeout.

This erratum does not affect the outputs of other pins (for example, for communication modules like CAN/Flexray). Only the EOUT signal is impacted.

Workaround

There are three possible workarounds:

- 1) Enable EOUT signaling for all enabled error sources.
- 2) In case external device (which evaluates EOUT) can communicate with the MCU, the following procedure could be used:
 - a) Program any duration of EOUT as per application needs (FCCU_DELTA_T[DELTA_T])
 - b) For faults requiring error out reaction, the software shall validate EOUT via separate communication channel (like I2C) while EOUT is asserted.
 - c) External device shall implement a timeout mechanism to monitor EOUT validation by separate channel.
 - d) Following scenarios shall be considered as valid EOUT reactions:
 - d1) Validation is performed while EOUT is asserted

- d2) Timeout occurs but no validation and EOUT is still asserted.
- 3) In case external device (which evaluates EOUT) cannot communicate with the MCU, following procedure could be used:
 - a) Program the error out duration to a duration x (FCCU_DELTA_T[DELTA_T]).
 - b) For faults requiring error out reaction, clear the fault after the pin has continued to be asserted for a longer duration (for example 2*duration x). This will artificially create a long pulse on EOUT.
 - c) For faults which do not require error out reaction, clear the fault within duration x. This will artificially create a short pulse on EOUT.
 - d) External device should ignore short pulse of duration x while recognizing longer pulses as valid reaction.
 - e) While clearing the fault, the associated software shall check the pending faults.

ERR008082: SENT: A message overflow can lead to a loss of frames combined with NUM_EDGES_ERR being set

Description

In the case of a Single Edge Nibble Transfer (SENT) receiver (Rx) message overflow (CHn_STATUS[FMSG_OFLW] = 1) and if the following registers are continuously being read without clearing the FMSG_RDY[F_RDYn] bit, there is a possibility that one message will be lost. Additionally, if the pause pulse feature is enabled, the module assert up to two NUM_EDGES_ERR in the status register (CHn_STATUS). In this case up to two frames can be lost.

Note that some debuggers perform a continuous read of memory which can cause this issue to occur.

Table:

Register	Register Name
CHn_FMSG_DATA	Channel Fast Message Data Read Register
CHn_FMSG_CRC	Channel Cyclic Redundancy Check Register
CHn_FMSG_TS	Channel Fast Message Time-stamp Register

Workaround

- 1. Software should ensure that SENT message overflow does not occur.

If interrupts are used (when the Enable FDMA (FDMA_EN) bit of Fast Message DMA Control Register (SRX_FDMA_CTRL) is set to 0) to read the SENT messages, the interrupt for data reception should be enabled by setting the Enable for Fast Message Ready Interrupt (FRDY_IE[n]) bit of Fast Message Ready Interrupt Control Register (SRX_FRDY_IE) for every channel n and the interrupt priority should be such that the software is able to read the message before the next message arrives.

When using Direct Memory Accesses (eDMA) to access the SENT (when the Enable FDMA (FDMA_EN) bit of Fast Message DMA Control Register (SRX_FDMA_CTRL) is set to 1), the DMA request from the SENT module should be serviced before the next message arrives.

The minimum duration between the reception of two consecutive messages in one channel is 92 times the utick length (time).

- 2. Ensure that the following registers are not read continuously either in the software code or as a result of a debugger being connected. The following registers should be read once per message and the FMSG_RDY[F_RDYn] bit should be cleared after the reads.

Table:

Register	Register Name
CHn_FMSG_DATA	Channel Fast Message Data Read Register
CHn_FMSG_CRC	Channel Cyclic Redundancy Check Register
CHn_FMSG_TS	Channel Fast Message Time-stamp Register

ERR008225: SDADC: FIFO Flush Reset command requires clearing the Data FIFO Full Flag

Description

When the Sigma-Delta Analog-to-Digital Converter (SDADC) FIFO is flushed by writing '1' to the FIFO Control Register FIFO Flush Reset bit (SDADC_FCR[FRST]), the FIFO is correctly flushed, but the Status Flag Register Data FIFO Full Flag (SDADC_SFR[DFFF]) may be incorrectly asserted, indicating the FIFO is full when it is empty..

Workaround

Clear SDADC_SFR[DFFF] by writing a '1' to this field after performing a FIFO Flush Reset command or after the FIFO is disabled.

ERR008229: FCCU: Enabling the programmable glitch filter on EIN may cause a destructive reset

Description

The Fault Collection and Control Unit (FCCU) external error input (EIN) can be filtered by the FCCU on-chip programmable glitch filter. However, the EIN is routed directly to the FCCU Output Supervision Unit (FOSU) without passing through the glitch filter. Additionally, when the glitch filter is programmed using the FCCU Control Register (FCCU_CTRL) FILTER_WIDTH field, the effective duration may vary depending on time at which the EIN signal arrives, which can cause a missed or false EIN signal. As a result, it is possible for the FOSU to recognize an event on EIN that is ignored by the FCCU resulting in a destructive reset when the FOSU timeout period expires.

Workaround

Bypass the FCCU on-chip glitch filter by writing a 1 to the FCCU Control Register FILTER_BYPASS field (FCCU_CTRL[FILTER_BYPASS]) and use an external glitch filter to ensure that only valid external error events are recognized by the FCCU. The impact on safety can be avoided by using a feedback based signaling on Error In (EIN), wherein the EIN signal is kept asserted until the MCU acknowledges the event to the source.

ERR008252: eTPU: ETPU Angle Counter (EAC) Tooth Program Register (TPR) register write may fail

Description

When the TPR is written with the Insert Physical Tooth (IPH) bit set to 1, and a physical tooth arrives at near the same time, the buffering of a second write to the TPR may fail, even if the required wait for one microcycle after the IPH write is observed.

Workaround

Wait at least two microcycles between consecutive writes to the TPR register, if the first write sets the IPH bit.

ERR008310: XBIC: Crossbar Integrity Checker may miss recording information from an initial fault event in the case of back-to-back faults

Description

When the Crossbar Integrity Checker (XBIC) detects back-to-back faults on a system bus path through the crossbar switch (AXBS), the fault information captured in the XBIC Error Status Register (XBIC_ESR) and the XBIC Error Address Register (XBIC_EAR) does not correspond to the initial fault event, but rather the subsequent fault event. While the fault event is properly detected, diagnostic status information in the XBIC_ESR and XBIC_EAR registers describing the initial fault event is lost. This defect can only occur in the event of a series of bus transactions targeting the same crossbar slave target, where the series of bus transactions are not separated by idle or stall cycles.

Workaround

Expect that the XBIC_EAR and XBIC_ESR registers may not contain the initial fault information, but will contain the latest fault information.

ERR008341: FlexCAN: Entering Freeze Mode or Low Power Mode from Normal Mode can cause the FlexCAN module to stop operating.

Description

In the Flexible Controller Area Network (FlexCAN) module, if the Freeze Enable bit (FRZ) in the Module Configuration Register (MCR) is asserted and the Freeze Mode is requested by asserting the Halt bit (HALT) in MCR, in some cases, the Freeze Mode Acknowledge bit (FRZACK) in the MCR may never be asserted.

In addition, the Low-Power Mode Acknowledge bit (LPMACK) in the MCR may never be asserted in some cases when the Low-Power Mode is requested.

Under the two scenarios described above, the loss of ACK assertion (FRZACK, LPMACK) causes a lock condition. A soft reset action is required in order to remove the lock condition.

The change from Normal Mode to Low-Power Mode cannot be done directly. Instead, first change mode from Normal to Freeze Mode, and then from Freeze to Low-Power Mode.

Workaround

To avoid the lock condition, the following procedures must be used:

A) Procedure to enter in Freeze Mode:

1. Set both the Freeze Enable bit (FRZ) and the Halt bit (HALT) in the Module Control Register (MCR).
2. Check if the Module Disable bit (MDIS) in MCR register is set. If yes, clear the MDIS bit.
3. Poll the MCR register until the Freeze Mode Acknowledge bit (FRZACK) in MCR is set or the timeout is reached (see NOTE below).
4. If the Freeze Mode Acknowledge bit (FRZACK) is set, no further action is required. Skip steps 5 to 8.
5. If the timeout is reached because the Freeze Mode Acknowledge bit (FRZACK) is still cleared, then set the Soft Reset bit (SOFTRST) in MCR.

6. Poll the MCR register until the Soft Reset bit (SOFRST) bit is cleared.

7. Reconfigure the Module Control Register (MCR)

8. Reconfigure all the Interrupt Mask Registers (IMASKn).

After Step 8, the module will be in Freeze Mode.

NOTE: The minimum timeout duration must be equivalent to:

a) 730 CAN bits if the CAN FD Operation Enable bit (FDEN) in MCR is set (CAN bits calculated at arbitration bit rate),

b) 180 CAN bits if the FDEN bit is cleared.

B) Procedure to enter in Low-Power Mode:

1. Enter in Freeze Mode (execute the procedure A).

2. Request the Low-Power Mode.

3. Poll the MCR register until the Low-Power Mode Acknowledge (LPMACK) bit in MCR is set.

ERR008343: DCI: EVTO[1:0] outputs remain stuck low if asserted while the system clock source is the IRC

Description

While the system clock source is the Internal Resistor Capacitor oscillator (IRC), if the Event Output pins (EVTO[1:0]) are asserted by the Debug and Calibration Interface (DCI), they will never negate. This applies to all functions on EVTO[1:0] except the timer functions controlled by the EVTO Output selection (EOS0/EOS1) fields of the Generic Timer Module debug interface (GTMDI) Development Control (DC) register. This includes when the EVTO pins are being used by the Development Trigger Semaphore (DTS) module.

Workaround

For proper operation of EVTO[1:0] outputs, program clocks to select a system clock source other than the IRC before enabling and using EVTO[1:0].

ERR008539: MEMU: Software Reset bit field is not protected by the Register Protection module

Description

The Memory Error Management Unit Control Register Software Reset bit (MEMU_CTRL[SWR]) is not protected by the Register Protection (REG_PROT) module. If the application software inadvertently sets the MEMU_CTRL[SWR] bit, all error flag bits from the MEMU Error Flag Register (MEMU_ERR_FLAG) will be cleared. This issue affects the application if the software polls the MEMU_ERR_FLAG register on every Fault Tolerant Time Interval (FTTI) cycle to monitor for potential ECC errors during memory accesses. See the Safety Overview section of the Functional Safety chapter in the Reference Manual.

Workaround

There are two workarounds possible for this errata:

1) Configure the Fault Collection and Control Unit (FCCU) to generate an interrupt when an Error Correction Coding (ECC) error event from the MEMU is detected. The MEMU Non-Critical Fault (NCF) channels for

memory ECC errors in the FCCU are channels 22 and 23 (System Memory), 25 and 26 (Peripheral Memories), and 28 and 29 (Flash Memory).

2) Software must poll the VLD (valid entry) bit field in the following MEMU reporting registers, as these registers are not cleared by MEMU_CTRL[SWR]:

MEMU_SYS_RAM_CERR_STS0;
MEMU_SYS_RAM_CERR_STS1;
MEMU_SYS_RAM_CERR_STS2;
MEMU_SYS_RAM_CERR_STS3;
MEMU_SYS_RAM_CERR_STS4;
MEMU_SYS_RAM_CERR_STS5;
MEMU_SYS_RAM_CERR_STS6;
MEMU_SYS_RAM_CERR_STS7;
MEMU_SYS_RAM_CERR_STS8;
MEMU_SYS_RAM_CERR_STS9;
MEMU_SYS_RAM_UNCERR_STS;
MEMU_SYS_RAM_OFLW0;
MEMU_PERIPH_RAM_CERR_STS0;
MEMU_PERIPH_RAM_CERR_STS1;
MEMU_PERIPH_RAM_UNCERR_STS;
MEMU_PERIPH_RAM_OFLW0;
MEMU_FLASH_CERR_STS0;
MEMU_FLASH_CERR_STS1;
MEMU_FLASH_CERR_STS2;
MEMU_FLASH_CERR_STS3;
MEMU_FLASH_CERR_STS4;
MEMU_FLASH_CERR_STS5;
MEMU_FLASH_CERR_STS6;
MEMU_FLASH_CERR_STS7;
MEMU_FLASH_CERR_STS8;
MEMU_FLASH_CERR_STS10;
MEMU_FLASH_CERR_STS11;
MEMU_FLASH_CERR_STS12;
MEMU_FLASH_CERR_STS13;
MEMU_FLASH_CERR_STS14;
MEMU_FLASH_CERR_STS15;
MEMU_FLASH_CERR_STS16;

MEMU_FLASH_CERR_STS17;
MEMU_FLASH_CERR_STS18;
MEMU_FLASH_CERR_STS19;
MEMU_FLASH_UNCERR_STS;
MEMU_FLASH_OFLW0.

ERR008547: e200z425: Additional cycles required for Load/Store accesses to guarded/precise space

Description

If an access by the Load/Store unit is to a space that is guarded/precise then it will be subject to additional cycles for completion because there is no pipeline bypass for the Bus Interface Unit. These spaces and accesses are characterized by any one of the following conditions:

- The Memory Protection Unit (MPU) Guarded bit is set for the address space
- The access is a store with the Store Buffer disabled
- The access is a Decorated Load or Store
- The access is a Bypass Store
- The access is an Atomic Load or Store

On this device, the peripheral address space, by default, is set to be guarded/precise space.

Each scenario below will cause a 2 cycle increase:

- Idle to guarded/precise load
- Idle to guarded/precise store
- Store to guarded/precise load
- Store to guarded/precise store

The following scenarios may or may not add extra cycles depending on wait states and back to back requests:

- Load to guarded/precise store
- Load to guarded/precise load

Workaround

Expect additional cycles when guarded/precise accesses occur.

ERR008555: PMC: Over and under temperature flags may be set during reset

Description

The Temperature Sensor over or under temperature flags in Temperature Event Status register (PMC_ESR_TD) may improperly be set during a destructive or functional reset. By default, after the initial power on reset, the over/under temperature reset feature is disabled. However, if software enables the Temperature Sensor over/under temperature detection to cause a destructive/functional in the Temperature Reset Event Enable register (PMC_REE_TD) and Temperature Reset Event Selection register (PMC_RES_TD), these flags cannot be

cleared and the device will remain in reset if a destructive or functional reset occurs. Only a power on reset can clear this condition.

Workaround

One of the following must be done:

1. Do not enable the over/under temperature reset feature.
2. Program the Temperature Reset Event Enable Device Configuration Format (DCF) client (DCF_PMC_REE_TD) in the User Test Non-Volatile Flash (UTEST) DCF area starting at 0x00400300 to clear the temperature sensor reset enable. Since this is a triple voted DCF client, two sets DCF records must be set consecutively in the UTEST NVM area. The values should be:
 - a) The DCF_PMC_REE_TD DCF client should be programmed with the data 0x00000040, 0x0000003F (inverted) & 0x00000020 (right rotated 1 bit).
 - b) The DCF_PMC_REE_TD DCF client should be programmed with the data 0x00000000, 0x0000007F (inverted) & 0x00000000 (right rotated 1 bit).

The above DCF records ensure that the Temperature Sensor Flags are always masked to the Reset Generation Module (RGM) during the boot sequence and allow the MCU to properly exit reset.

Additionally, to verify that the temperature is within the operating specifications, software can monitor the Temperature via the Analog to Digital Converter (ADC) Temperature Sensor channel to identify if the flags have been spuriously set. This allows software to clear the status flags before re-enabling the over/under temperature reset feature.

ERR008631: SDADC: low threshold watchdog cannot be used with signed data

Description

Each Sigma Delta Analog to Digital Converter (SDADC) provides a watchdog (WDG) to monitor the converted data range. This watchdog should trigger when a converted value is either higher than the value configured in the WDG Threshold Register Upper Threshold Value bit-field (SDADC_WTHHLR[THRH]), or lower than the value configured in the Lower Threshold Value bitfield (SDADC_WTHHLR[THRL]). Instead, the low WDG threshold acts as a high WDG threshold, triggering when a converted value is greater than the value configured in SDADC_WTHHLR[THRL].

Workaround

There are two workarounds available:

- 1) Do not use the WDG function by clearing the SDADC Module Control Register Watchdog Enable Bit (SDADC_MCR[WDGEN]).
- 2) Configure the WDG low threshold SDADC_WTHHLR[THRL] to the value 0x7FFF. This guarantees that a low threshold trigger will not be generated. The WDG high threshold (SDADC_WTHHLR[THRH]) can be used without restriction.

ERR008730: XBIC: XBIC may store incorrect fault information when a fault occurs

Description

The Crossbar Integrity Checker (XBIC) may incorrectly identify a fault's diagnostic information in the case when the slave response signals encounter an unexpected fault when crossing the crossbar switch (XBAR) during the

data phase. While the fault event is detected, the diagnostic status information stored in the XBIC's Error Status Register (XBIC_ESR) and Error Address Register (XBIC_EAR) does not reflect the proper master and slave involved in the fault. Instead, the preceding master or slave ID may be recorded.

Workaround

Expect that when a fault is reported in the XBIC_EAR and XBIC_ESR registers the actual fault information may be from the preceding transition.

ERR008759: FlexCAN: FD frame format not compliant to the new ISO/CD 11898-1: 2014-12-11

Description

This version of the device implements a Flexible Controller Area Network (FlexCAN) module version that implements a Flexible Data (CAN-FD) frame format according to ISO/WD 11898-1: 2013-12-13. However, it is not compliant with the new ISO/CD 11898-1: 2014-12-11 format. The frame format was updated during the ISO standardization process.

The limitations are the following:

- the FD frame format is incompatible, the Cyclic Redundancy Check [CRC] does not include the added stuff bit count field
- the FD CRC computation is incompatible, a different seed value is used.

As a consequence this device is not suitable for use in CAN-FD networks that use the new FD frame format according to ISO/CD 11898-1: 2014-12-11.

FlexCAN3 with CAN FD feature enabled is affected by this defect.

Workaround

Use CAN-FD mode in networks that only includes devices that conform to the ISO/WD 11898-1: 2013-12-13 frame format.

The Classic CAN mode is unaffected and can be used without restrictions.

ERR008933: LINFlexD: Inconsistent sync field may cause an incorrect baud rate and the Sync Field Error Flag may not be set

Description

When the LINFlexD module is configured as follows:

1. LIN (Local Interconnect Network) slave mode is enabled by clearing the Master Mode Enable bit in the LIN Control Register 1 (LINCR1[MME] = 0b0)
2. Auto synchronization is enabled by setting LIN Auto Synchronization Enable (LINCR1[LASE] = 0b1)

The LINFlexD module may automatically synchronize to an incorrect baud rate without setting the Sync Field Error Flag in the LIN Error Status register (LINESR[SFEF]) in case Sync Field value is not equal to 0x55, as per the Local Interconnect Network (LIN) specification.

The auto synchronization is only required when the baud-rate in the slave node can not be programmed directly in software and the slave node must synchronize to the master node baud rate.

Workaround

There are 2 possible workarounds.

Workaround 1:

When the LIN time-out counter is configured in LIN Mode by clearing the MODE bit of the LIN Time-Out Control Status register (LINTCSR[MODE]= 0x0):

1. Set the LIN state Interrupt enable bit in the LIN Interrupt Enable register (LINIER[LSIE] = 0b1)
2. When the Data Reception Completed Flag is asserted in the LIN Status Register (LINSR[DRF] = 0b1) read the LIN State field (LINSR[LINS])
3. If LINSR[LINS]= 0b0101, read the Counter Value field of the LIN Time-Out Control Status register (LINTCSR[CNT]), otherwise repeat step 2
4. If LINTCSR[CNT] is greater than 0xA, discard the frame.

When the LIN Time-out counter is configured in Output Compare Mode by setting the LINTCSR[MODE] bit:

1. Set the LIN State Interrupt Enable bit in the LIN Interrupt Enable register (LINIER[LSIE])
2. When the Data Reception Completed flag bit is asserted in the LIN Status Register (LINSR[DRF] = 0b1), read the LINSR[LINS] field
3. If LINSR[LINS]= 0b0101, store LINTCSR[CNT] value in a variable (ValueA), otherwise repeat step 2
4. Clear LINSR[DRF] flag by writing LINSR[LINS] field with 0xF
5. Wait for LINSR[DRF] to become asserted again and read LINSR[LINS] field
6. If LINSR[LINS] = 0b0101, store LINTCSR[CNT] value in a variable (ValueB), else repeat step 4
7. If ValueB - ValueA is greater than 0xA, discard the frame

Workaround 2:

Do not use the auto synchronization feature (disable with LINCR1[LASE] = 0b0) in LIN slave mode.

ERR008935: JTAGM: write accesses to registers must be 32-bit wide

Description

The JTAG Master module (JTAGM) supports only 32-bit write accesses to its registers. A byte write access will be converted into a 32-bit write with the other bytes values at 0x0.

Workaround

Perform only 32-bit write accesses on JTAGM registers. Do not use byte writes.

ERR008970: LINFlexD: Spurious bit error in extended frame mode may cause an incorrect Idle State

Description

The LINFlexD module may set a spurious Bit Error Flag (BEF) in the LIN Error Status Register (LINESR), when the LINFlexD module is configured as follows:

- Data Size greater than eight data bytes (extended frames) by configuring the Data Field Length (DFL) bitfield in the Buffer Identifier Register (BIDR) with a value greater than seven (eight data bytes)

- Bit error is able to reset the LIN state machine by setting Idle on Bit Error (IOBE) bit in the LIN Control Register 2 (LINCR2)

As consequence, the state machine may go to the Idle State when the LINFlexD module tries the transmission of the next eight bytes, after the first ones have been successfully transmitted and Data Buffer Empty Flag (DBEF) was set in the LIN Status Register (LINSR).

Workaround

Do not use the extended frame mode by configuring Data Field Length (DFL) bit-field with a value less than eight in the Buffer Identifier Register (BIDR) ($BIDR[DFL] < 8$)

ERR009090: eTPU: Incorrect eTPU angle counter function under certain conditions

Description

The eTPU Angle Counter (EAC) can function incorrectly in some scenarios when all of the following conditions apply:

- EAC Tooth Program Register (TPR), Angle Ticks Number in the Current Tooth field (TICKS) = 0 [TPR.TICKS = 0]

and

- Tick Rate Register (TRR) and the eTPU Engine Time Base Configuration Register prescaler field [eTPU_TBR_TBCR_ENGn.TCRnP] satisfy the following condition:

$(TRR - 1) * (TCRnP + 1) < 3$, where TRR is the non-zero 15-bit integer part (the 15 most significant bits).

When the above conditions are met, three possible scenarios can cause the EAC to function incorrectly:

Scenario 1:

1. The EAC is in High Rate Mode, TRR = 1, and TPR Missing Tooth Counter field = 0 [TPR.MISSCNT = 0]
2. On an EAC transition from High Rate Mode to Normal mode, a positive value is written to TPR.MISSCNT
3. The first microcycle in Normal Mode coincides with a tick timing and either
 - a. A tooth does not arrive

or

- b. A tooth arrives

Expected EAC behavior:

- a. Nothing happens

or

- b. The EAC transitions back to High Rate Mode

Actual (incorrect) EAC behavior:

- a. The EAC transitions to Halt Mode, even though TPR.MISSCNT > 0

or

- b. The EAC stays in Normal Mode, even though a tooth arrived before expected and TPR.MISSCNT > 0. The values of TPR.MISSCNT and TPR.LAST are reset, even though the EAC does not transition to High Rate Mode.

Scenario 2:

$TCRnP = 0$, $TRR = 1$ (integer part) and a new value is written to `TPR.MISSCNT` when the EAC transitions from High Rate Mode to Normal Mode. In this scenario, `TPR.MISSCNT` decrements on every microcycle, but the time the EAC takes to transition to Halt Mode is determined by the previous

`TPR.MISSCNT` value, so that one of the following unique situations is observed:

- a. `TPR.MISSCNT` reaches zero, but the EAC transitions to Halt Mode only after a number of microcycles equal to the `TPR.MISSCNT` value before the write.
- b. EAC transitions to Halt Mode with `TPR.MISSCNT > 0` while, decrementing `MISSCNT` one more time. If `TPR.MISSCNT > 1` during the mode transition, the EAC will stay in Halt mode with a non-zero value of `TPR.MISSCNT`.

Scenario 3:

1. The EAC transitions to Normal mode from High Rate or Halt Mode
2. The EAC enters Normal mode with `TPR.LAST = 1`
3. A tooth is received on the second or third microcycle after the EAC transitions to Normal mode. The tooth may be either a physical tooth or a dummy physical tooth generated by setting the Insert Physical Tooth (IPH) field of the TPR register (`TPR.IPH = 1`).

Observed result:

The EAC resets the values of `TPR.LAST`, `TPR.IPH` and the eTPU Engine Time Base2 (`TCR2`) register, but the EAC goes to Halt mode.

If a new `TPR.TICKS` value is written with the EAC in Normal mode, the value is effective after a new tooth is received in Halt mode, with `TCR2` counting from 0.

Workaround

Limit the angle tick period to a minimum value that satisfies the condition $(TRR - 1) * (TCRnP + 1) > 2$, where TRR is the non-zero 15-bit integer part (the 15 most significant bits).

ERR009250: PASS: JTAG password not working during reset

Description

The Debug Interface Access cannot be enabled by supplying the JTAG password during reset.

Workaround

To enable the Debug Interface Access, supply the JTAG password after reset.

ERR009493: STCU: FCCU NCF 6 does not automatically generate a destructive reset, when `DCF_UTEST_Miscellaneous.STCU_CFB` bit field is set (1)

Description

When a critical fault (CF) occurs during Self-Test Control Unit (STCU) offline self test, the Fault Collection and Control Unit (FCCU) Non Critical Fault (NCF) 6 should be set and if the `DCF_UTEST_Miscellaneous.STCU_CFB` bit field is set (1), an automatic destructive reset reaction is expected, however, regardless of `DCF_UTEST_Miscellaneous.STCU_CFB` bit field status, no destructive reset is asserted.

Workaround

The application software must read the FCCU NCF 6 status and STCU status to check whether a CF was latched and initiate a destructive reset.

ERR009496: PMC: FCCU NCF[4] fault may be triggered when DCF_PMC_REE_CTRL or DCF_PMC_RES_CTRL are programmed

Description

The Power Management Controller (PMC) Reset Enable Control (PMC_REE) register and PMC Reset Type (Destructive/Functional) Selection (PMC_RES) register can be programmed by two methods.

(1) By programming the registers directly by software.

(2) Via the Device Client Format (DCF) clients for PMC_REE and PMC_RES (DCF_PMC_REE_CTRL and DCF_PMC_RES_CTRL) by programming the User Test (UTEST) area.

The PMC_RES register controls whether the voltage detect signal event causes a destructive or functional reset depending on whether the desired flag bit is enabled or disabled in PMC_REE register. There are both low voltage and high voltage trigger events that can be enabled.

However, due to unused DCF clients that have the same Address and Chip select as the DCF_PMC_REE_CTRL and DCF_PMC_RES_CTRL DCF clients, a fault may be flagged to the Fault Collection and Control Unit (FCCU) Non-critical Fault 4 (NCF[4]) if either of these DCF clients is used.

The unused DCF clients are the Miscellaneous User Test Spare 0 that will be selected when the DCF_PMC_REE_CTRL is accessed and the Miscellaneous User Test Spare 1 DCF (DCF_UTEST_MISC_SPARE1) that will be selected if the DCF_PMC_RES_CTRL is accessed. DCF_PMC_REE_CTRL and DCF_PMC_RES_CTRL only implement 17 valid bits, but the DCF_UTEST_MISC_SPARE0 and DCF_UTEST_MISC_SPARE1 have 32 valid bits. Since these PMC DCF clients are safe clients, they require triple voted values. Due to the length difference of valid bits, it is not possible to write values for the triple voted mirror locations that satisfy the requirements of both DCF clients.

Workaround

Program the PMC_REE or PMC_RES registers directly by software if required and do not program the DCF_PMC_REE_CTRL or DCF_PMC_RES_CTRL DCF clients in UTEST area.

ERR009581: FCCU: FOSU may assert destructive reset when a hardware recoverable fault of width less than one safe clock period occurs

Description

The Fault Collection and Control Unit Output Supervision Unit (FOSU) may issue a destructive reset if all of the following conditions are present:

- An input fault is programmed as hardware recoverable in a FCCU Non-Critical Fault Configuration Register (FCCU_NCF_CFGn)
- The only reaction programmed for this fault is FCCU Error Output signaling (FCCU_EOUT_SIG_ENn)
- The source of the fault signal is asserted for less than one safe clock period. The safe clock for this device is the internal RC oscillator (IRC).

Workaround

Always configure faults as software recoverable in the FCCU_NCF_CFGn. Set the Non-critical Fault Configuration bit to a '1', this is the default condition for implemented faults after reset.

ERR009631: MEMU: System RAM ECC errors on accesses by some masters report to MEMU Peripheral RAM table

Description

If an Error Correction Code (ECC) error is detected by an access through the Crossbar (XBAR) bus Concentrator(s) from either of the eDMA controller(s) on XBAR Client 0 Concentrator or through the Ethernet or the Serial Inter-Processor Interface (SIPI) masters on XBAR Client 1 Concentrator, the ECC error is reported to the Memory Error Management Unit (MEMU) Peripheral RAM reporting table instead of the System RAM reporting table. ECC errors detected by other system bus masters are reported to the MEMU System RAM table. As a result, System RAM locations may appear in both the System RAM table and the Peripheral RAM table.

Workaround

Expect system RAM ECC errors encountered by masters on the Concentrator(s) to be reported to the MEMU peripheral RAM table, in addition to the MEMU System RAM table if accessed by other bus masters(cores).

ERR009656: DSPI: Frame transfer does not restart in case of SPI parity error in master mode

Description

In the Deserial Serial Peripheral Interface (DSPI) module, in the scenario when:

1. Master/slave mode select bit (MSTR) of Module Configuration register (MCR) is set (MCR[MSTR]=0b1) to configure the module in master mode
2. SPI communication is selected via DSPI Configuration field (DCONF) in MCR (MCR[DCONF] = 0b00)
3. Parity reception check on received frame is enabled by setting the Parity Enable or Mask tASC delay (PE_MASC) bit of DSPI PUSH FIFO Register In Master Mode (PUSHR), i.e. PUSHR[PE]=0b1.
4. Parity Error Stop bit (PES) of MCR is set (MCR[PES]=0b1) which stops SPI frame transfer in case of parity error
5. Parity error is detected on received frame.

Then the next frame transfer is stopped, the SPI Parity Error Flag bit (SPEF) of the DSPI Status Register (DSPI_SR) is set (SR[SPEF] =0b1) and the corresponding SPI parity error interrupt is asserted. Even after the interrupt is serviced and SR[SPEF] is reset, the frame transfer does not restart.

Workaround

Do not use SPI frame transfer stop in case of parity error detection for SPI transmission in master mode. For this, keep the Parity Error Stop bit of Module Configuration Register de-asserted (MCR[PES] = 0b0).

ERR009658: SPI: Inconsistent loading of shift register data into the receive FIFO following an overflow event

Description

In the Serial Peripheral Interface (SPI) module, when both the receive FIFO and shift register are full (Receive FIFO Overflow Flag bit in Status Register is set (SR[RFOF] = 0b1)) and then the Clear Rx FIFO bit in Module Configuration Register (MCR[CLR_RXF]) is asserted to clear the receive FIFO, shift register data is sometimes loaded into the receive FIFO after the clear operation completes.

Workaround

1. Avoid a receive FIFO overflow condition (SR[RFOF] should never be 0b1). To do this, monitor the RX FIFO Counter field of the Status Register (SR[RXCTR]) which indicates the number of entries in receive FIFO and clear before the counter equals the FIFO depth.
2. Alternatively, after every receive FIFO clear operation (MCR[CLR_RXF] = 0b1) following a receive FIFO overflow (SR[RFOF] = 0b1) scenario, perform a single read from receive FIFO and discard the read data.

ERR009664: DSPI: Frame transfer does not restart in case of DSI parity error in master mode

Description

In the Serial Peripheral Interface module, in the scenario when:

1. Master/slave mode select bit of module configuration register is set (MCR[MSTR]=0b1) to configure the module in master mode
2. Deserial Serial Interface (DSI) communication is selected via DSPI Configuration field (DCONF) in MCR (MCR[DCONF] = 0b01)
3. Parity reception check on received DSI frame is enabled by setting Parity Enable bit (PE) of DSI configuration register 0 (DSICR0[PE]=0b1)
4. Parity Error Stop (PES) bit of DSI configuration register0 is set (DSICR0[PES]=0b1) which stops DSI frame transfer in case of parity error
5. Parity error is detected on received frame

Then the next frame transfer is stopped, DSI parity error flag bit of status register is set (SR[DPEF] =0b1) and the corresponding DSI parity error interrupt is asserted. Even after the interrupt is serviced and SR [DPEF] is reset, the frame transfer does not restart.

Workaround

DSI frame transfer stop in case of parity error detection should be disabled. For this, keep the parity error stop bit of DSI configuration register0 de-asserted (DSICR0 [PES]=0b0).

ERR009783: DSPI: Frame transfer does not restart after DSI frame matches preprogrammed value

Description

In the Deserial Serial Peripheral Interface module, in the scenario when:

1. Master/slave mode select bit of module configuration register is set (MCR[MSTR]=0b1) to configure the module in master mode
2. Deserial Serial Interface (DSI) communication is selected via DSPI Configuration field (DCONF) in the Module Configuration Register (MCR [DCONF] = 0b01)
3. Preprogrammed value for data match with received DSI frame is configured using DSI De-serialized Data Polarity Interrupt Register (DPIR) and DSI De-serialized Data Interrupt Mask Register (DIMR)
4. Data Match Stop (DMS) bit of DSI configuration register0 is set (DSICR0 [DMS] =0b1) which stops DSI frame transfer in case of a data match with a preprogrammed value
5. DSI frame is received with bits matching preprogrammed value.

Under these conditions, the next frame transfer is stopped, DSI Data Received with Active Bits bit of status register is set (SR [DDIF] =0b1) and the corresponding DDIF interrupt is asserted. Even after the interrupt is serviced and SR [DDIF] is reset, the frame transfer does not restart.

Workaround

DSI frame transfer stop in case of DSI data match condition should be disabled. For this, keep the data match stop bit of DSI configuration register 0 de-asserted (DSICR0 [DMS]=0b0).

ERR009809: eTPU: MDU flags(Overflow/Carry) may be set incorrectly

Description

The MAC Carry (MC) & MAC Overflow (MV) flags can be incorrectly set on a MAC instruction if it is the first MDU operation in a thread and the last MDU operation in previous thread was aborted/terminated (thread ended before the operation finished).

Workaround

There are 2 workarounds:

- (1) Do not abort/terminate a MDU operation
- or
- (2) Do not use a MAC instruction as the first MDU operation in a thread

ERR009978: eMIOS: Unexpected channel flag assertion during GPIO to MCB mode transition

Description

When changing an Enhanced Modular IO Subsystem (eMIOS) channel mode from General Purpose Input/Output (GPIO) to Modulus Counter Buffered (MCB) mode, the channel flag in the eMIOS Channel Status register (eMIOS_Sn[FLAG]) may incorrectly be asserted. This will cause an unexpected interrupt or DMA request if enabled for that channel.

Workaround

In order to change the channel mode from GPIO to MCB without causing an unexpected interrupt or DMA request, perform the following steps:

- (1) Clear the FLAG enable bit in the eMIOS Control register (eMIOS_Cn[FEN] = 0).

- (2) Change the channel mode (eMIOS_Cn[MODE]) to the desired MCB mode.
- (3) Clear the channel FLAG bit by writing '1' to the eMIOS Channel Status register FLAG field (eMIOS_Sn[FLAG] = 1).
- (4) Set the FLAG enable bit (eMIOS_Cn[FEN] = 1) to re-enable the channel interrupt or DMA request reaction.

ERR010032: FEC: MDC and MDIO signals are not on the FEC power supply segment

Description

The Fast Ethernet Controller (FEC) Management Data Clock (MDC) and Management Data Input Output (MDIO) pins are not included in the isolated FEC I/O supply segment (VDD_HV_IO_FEC). They are powered by the main I/O supply segment (VDD_HV_IO_MAIN). Therefore if VDD_HV_IO_MAIN is used for 5V I/O, then the MDC/MDIO pins will be over-driven for a 3.3V physical interface (PHY). Since the MCU pad output levels scale with supply voltage, the maximum output low voltage (VOL) for MDC/MDIO may violate the maximum input low voltage (VIL) for a 3.3V PHY. When MDIO is driven from a 3.3V PHY, the minimum output high voltage (VOH) may not meet the minimum input high voltage (VIH) of the MCU.

Workaround

In order to interface 5V MDC/MDIO signals to a 3.3V PHY, level shifters or series resistance should be used on the PCB. In the case of series resistance, Transistor-transistor Logic (TTL) input levels should be used with the MDIO input.

Depending on the application, a 3.3V PHY may be able to tolerate the over-voltage for limited time over the lifespan if connected directly to the 5V MCU pins. The PHY electrical specification should be consulted for absolute maximum ratings.

ERR010088: STCU2: Unexpected STCU self-test timeout can occur when a short sequence for external reset is triggered during execution of online self-test

Description

While an online self-test is in progress there is a finite window during the self-test execution during which if an external reset is asserted (RESET_B pulled low) and this reset is configured as short sequence for external reset by setting the Short Sequence for External Reset bit in the Reset Generation Module Functional Event Short Sequence Register (RGM_FESS[SS_EXR] = 1b1), or if another functional reset source is triggered during this window, the time after which the part waits for self-test to complete is longer than expected. This time-out value is governed by the watchdog time-out value set in the Watchdog End of Count Timer field in the STCU2 Watchdog Register Granularity register (STCU2_WDG[WDGEOC]). Further, the self-test does not issue a hardware abort (STCU2 Error Register On-line Hardware Abort Flag (STCU2_ERR_STAT [ABORTHW]) will not be set to 1b1) but signals a time-out (STCU2_ERR_STAT [WDTOSW] = 1b1). If the online self-test is being run with PLL enabled then an unexpected PLL unlock event is also observed (STCU2_ERR_STAT[LOCKESW] = 1b1)

Workaround

To avoid the longer than expected duration for self-test completion, allow the online self-test to complete without applying external reset when the external reset is configured as a short sequence for external reset. The other functional resets must also not be triggered during the online self-test execution.

ERR010327: ADC: Incorrect channel under measure is indicated after sampling phase of conversion until conversion completes**Description**

The Main Status Register Channel under measure address field (ADC_MSR[CHADDR]) indicates which ADC channel is currently performing a conversion. This field indicates the correct channel during the sampling phase of conversion, but will display an incorrect value in the subsequent phases until conversion is complete.

Workaround

User must only consider ADC_MSR[CHADDR] to be valid when the ADC is in the sample phase of conversion. The Main Status Register Status of the ADC field shows when the ADC is in the sample phase (ADC_MSR[ADCSTATUS] = 0b100).

ERR010340: NZxC3: ICNT and HIST fields of a Nexus message are not properly reset following a device reset**Description**

Following reset, if instruction trace is enabled in the Nexus e200zx core Class 3 trace client (NZxC3), the e200zx core transmits a Program Trace - Synchronization Message (PT-SM). The PT-SM includes the full execution address and the number of instructions executed since the last Nexus message (ICNT) information. However, if Branch History trace is enabled, the ICNT and the Branch History (HIST) fields are not properly cleared when this message is transmitted. This may cause unexpected trace reconstruction results until the next Nexus Program Trace Synchronization Message (Program Trace - Direct Branch Message with Sync, Program Trace - Indirect Branch Message with Sync, or Program Trace - Indirect Branch History Message with Sync).

In Branch History mode, the first indirect branch following the reset (and the initial PT-SM) will contain the branch history prior to the reset plus the branch history after reset. However, there is no way to determine which branches occurred prior to reset and which followed reset.

Workaround

If not using branch history trace mode, to recreate the proper trace, the tool should take into account that the ICNT field is not cleared by the first PT-SM. The previous ICNT will be added to new ICNT value in the subsequent Nexus message. This may require extra processing by the tool.

If using branch history mode, then an accurate reconstruction of the executed code just before and just after reset may not be possible. Trace reconstruction can be recovered after the next indirect branch message.

On devices that bypass the Boot Assist Flash (BAF), Boot Assist Module (BAM), or BootROM after reset, perform an indirect branch instruction shortly after reset to reset the ICNT (and HIST if Branch History mode is enabled). Also, A full program trace synchronization message will be generated after 256 direct branches even if there is no indirect branches. This will allow the tool to recover the trace reconstruction from that point onward.

On devices that always execute boot from boot ROM firmware, the BAF or BAM, an indirect branch will occur during the boot ROM/BAF/BAM execution and the tool trace will be re-synchronized prior to the execution of user code.

ERR010436: ZipWire: SIPI can have only one initiator with one outstanding write frame at time

Description

The Serial Inter-processor Interface (SIPI) module of the Zipwire interface only supports one initiator and one outstanding write frame at a time.

If a new write is initiated (by setting `SIPI_CCRn[WRT] = 0b1`, where `n` is the respective channel number for the transmission), or a new streaming write is initiated (by setting `SIPI_CCRn[ST] = 0b1`) with acknowledgement of a previous frame pending, then the initiator node may get a timeout error (indicated by `SIPI_ERR[TOEn]=0b1`). The previous write frame last byte may also be corrupted at the target node.

This also means that the target node cannot initiate a write transfer while the initiator node is in the process of a write transfer.

Workaround

The initiator should maintain only one outstanding write/streaming write frame to the target node at any one time.

The user must ensure that before initiating a new write request or initiating a new streaming write that it has received an acknowledgement for the previous write transaction (indicated by `SIPI_CSRn[ACKR] = 0b1`). The write acknowledgement interrupt can be enabled by setting `SIPI_CIRn[WAIE]=0b1`.

Implement a protocol that ensures both sides of the link cannot initiate a transfer at the same time. For example, a token-passing protocol could be implemented using the SIPI trigger command feature. Send a trigger command to pass the token to the other end of the link. Upon receipt of the trigger command, either initiate a write transfer if one is pending, or pass the token back by sending a trigger command. If a write transfer is initiated, wait until ACK is received and then send a trigger command to pass the token back. In this manner, if each side agrees only to initiate a transfer when it obtains the token, there will be no simultaneous transfers that can cause the problem described.

ERR010489: SIUL2: Open-drain or open-source configured outputs may briefly drive high or low during transitions

Description

The System Integration Unit Lite 2 (SIUL2) Output Drive Control in the Multiplexed Signal Configuration registers (`SIUL2_MSCR[ODC]`) specifies the type of output drive control for the associated pins. When configured as open-drain, the high drive for the output buffer is disabled and when configured as open-source the low drive for the output buffer is disabled. However, during the transition from the driven to non-driven state, the output may momentarily drive the opposite value. In other words, the open-drain output may momentarily drive high and the open-source output may momentarily drive low. The duration of the contention is 0-10 nanoseconds.

Workaround

Open-drain or open source pins need either internal or external weak pull devices to maintain the default pin state. Strong external drivers connected to the pin need to assure a non-overlap time with the pin driver to prevent contention.

ERR010491: eDMA: When master ID replication is enabled, the stored ID and privilege level will change if read by another master**Description**

When master ID replication feature of a DMA channel is enabled via the Channel n Master ID Register (DMA_DCHMIDn) by setting the Enable Master ID replication (EMI) bit (DMA_DCHMIDn[EMI]=1), the DMA_DCHMIDn[PAL] and DMA_DCHMIDn[MID] fields should reflect the privileged access level (PAL) and master ID (MID) respectively of the master that wrote the Transfer Control Descriptor (TCD) Control and Status register (DMA_TCDn_WORD_7) least significant byte (DMA_TCDn_WORD_7[DONE,ACTIVE, MAJOR_E_LINK, E_SG, DREQ, INT_HALF, INT_MAJOR, START] byte). However, if a different master reads the DMA_TCDn_WORD_7 least significant byte, the MID and PAL of DMA_DCHMIDn will incorrectly change to this read access master's MID and PAL.

Workaround

Only allow the intended master ID replication core to access the DMA_TCDn_WORD_7 least significant byte (including accessing the full TCD word).

ERR010505: MC_CGM: The device can become stuck in reset after 'destructive' or external long 'functional' reset**Description**

The microcontroller may not exit reset after either a 'destructive' reset or an external long 'functional' reset if the reset occurs while configuring the system clock divider and switching to the Phase Lock Loop (PLL). Only a Power On Reset (POR) can clear the reset condition. Assertion of the external Power On Reset (PORST) pin will not clear a stuck condition.

Workaround

On reset exit and before setting up the system clocks for the application (i.e., while the system clock is sourced by the IRCOSC, and all the system clock dividers are configured to divide by 1), software must do the following:

- 1) Determine the reset cause by reading the Functional Event Status (MC_RGM_FES) register and clear the reset flags
- 2) Depending on the application requirements, if the reset cause was a short external reset due to a RESET_B assertion (MC_RGM_FES[F_EXR] = 1 and MC_RGM_FESS[SS_EXR] = 1) execute one of the following
 - a. Initiate a software long 'functional' reset – this will not execute a self-test but will trigger a device reconfiguration
 - b. Initiate a software 'destructive' reset – this will execute a self-test and a device reconfiguration
- 3) If the reset was a long external reset, configure the RESET_B to a short external reset (i.e., reset sequence starts at PHASE3[FUNC]) by setting the Functional Event Short Sequence (MC_RGM_FESS) register's Short Sequence for External Reset (SS_EXR) bit. (By default, on a RESET_B assertion, the MC_RGM executes a long external reset)
 - a. MC_RGM_FESS[SS_EXR] = 1;
- 4) Clear the DCF_SELFTEST_CONFIG_IPS_1 register by writing 0x00000000 to address 0xFFFF47FE0.

ERR010506: MC_CGM: The device can become stuck in reset when a reset occurs during a system clock switch to any PLL

Description

When reset occurs during system clock switch to any Phase Locked Loop (PLL) the device may get stuck in reset.

The device is only recoverable by a power on reset (POR).

Workaround

To properly initialize the system clocks and avoid a stuck in reset condition, perform the following steps.

1. Enable 'functional' reset escalation: escalate the first 'functional' reset to 'destructive' reset (MC_RGM_FRET[FRET] = 1).
2. Configure the Dual PLL Digital Interface (PLLDIG) to desired frequencies as per the application requirements.
3. Configure the Clock Generation Module (MC_CGM):
 - When selecting the desired PLL as the system clock source, set the divider values as follows:
MC_CGM_SC_DC2 = 0x80040000 (divide by 5)
MC_CGM_SC_DC1 = 0x80020000 (divide by 3)
MC_CGM_SC_DC0 = 0x80000000 (divide by 1)
 - Verify that the system clock divider update has completed (MC_CGM_DIV_UPD_STAT[SYS_UPD_STAT] == 0).
4. Change the system clock source to the desired PLL:
 - Select the desired PLL in the target mode's configuration register (MC_ME_ mode MC[SYSCLK] = 2 for PLL0 or 4 for PLL1) = 2 for PLL0 or 4 for PLL1)
 - Initiate a mode change via the Mode Control (MC_ME_CTL) register.
 - Wait until the mode transition has completed.
(*mode* is DRUN, RUN0, RUN1, RUN2, or RUN3,)

NOTE: Do NOT accesses any peripherals running on the Slow Crossbar Clock (SXBAR_CLK) or LIN clock (LINCLK) by any master UNTIL the mode transition has completed.
5. Configure the MC_CGM a second time:
 - Set the system clock dividers a second time as follows:
MC_CGM_SC_DC2 = 0x80030000 (divide by 4)
MC_CGM_SC_DC1 = 0x80010000 (divide by 2)
MC_CGM_SC_DC0 = 0x80000000 (divide by 1) (no change)
 - Verify that the system clock divider update has completed (MC_CGM_DIV_UPD_STAT[SYS_UPD_STAT] == 0).
6. Disable 'functional' reset escalation (MC_RGM_FRET[FRET] = 0)
7. Continue other configurations normally:
 - Configure the auxiliary clocks as needed (MC_CGM_ACn_SC and MC_CGM_ACn_DCm registers)

- Enable/disable peripherals as needed (MC_ME_RUN_PCn, MC_ME_LP_PCn, and MC_ME_PCTLn registers).
- Enable/disable core(s) as needed (MC_ME_CADDRn and MC_ME_CCTLn registers).
- Initiate a mode change via the Mode Control (MC_ME_CTL) register.
- Wait until the mode transition has completed.

Ensure that no auxiliary clock is configured to divide by 2 before applying this workaround.

ERR010507: STCU: The device can become stuck in reset when destructive reset occurs during offline self-test when PLL is selected as BIST clock source

Description

If a 'destructive' reset occurs while offline built-in self-test (BIST) is in progress and the Phase-Locked Loop (PLL) is selected as offline BIST clock source, the device may get stuck in reset.

The device is only recoverable by a power on reset (POR). Assertion of the external Power On Reset (PORST) pin will not clear a stuck condition.

Workaround

To perform an offline self test, configure the STCU to use a PLL frequency of 100MHz.

In addition, configure the system clock dividers in DCF_SELFTEST_CONFIG_IPS_2 DCF client to divide by 1, 1 and 3 (FXBAR 100MHz; SXBAR 100MHz; PBRIDGE 33.3MHz)

DCF_SELFTEST_CONFIG_IPS_2[20:22] = 0

DCF_SELFTEST_CONFIG_IPS_2[23:25] = 0

DCF_SELFTEST_CONFIG_IPS_2[26:28] = 2

ERR010542: DSPI: Transmit, Command, and Receive FIFO fill flags in status register is not cleared when DMA is improperly configured

Description

The Deserial/Serial Peripheral Interface Transmit, Receive, and Command First In/First Out (FIFO) buffers can request additional information to be transferred via the Direct Memory Access (DMA) module when either the Transmit, Receive, or Command FIFO Fill/Drain Flags are set in the DSPI Status Register (SR[TFFF/RFDF/CMDFFF]). However, the Command/Transmit Fill Flag only indicates that at least 1 location in the FIFO is available to be written. It does not indicate that the FIFO is empty. Similarly, Receive FIFO fill flag only indicates at least 1 location of the FIFO is available to be read. It does not indicate that the FIFO is full. If the DMA is configured to transfer more than 1 FIFO location size of data, the FIFO Fill Flags may not be properly cleared indicating that the FIFO is not full even when the FIFO is actually full (for Transmit and Command FIFO) and not empty when the FIFO is actually empty (for Receive FIFO).

Workaround

Properly configure the DMA to fill the Transmit, Receive, and Command FIFOs only one FIFO location, in other words, up to 2 bytes, at a time to each of the FIFOs.

Use the DMA loop to transfer more data if needed.

ERR010550: MC_CGM: Auxiliary clock dividers get stuck if programmed to divide by 2 and a reset occurs during operation

Description

When a reset of any type occurs during operation, any auxiliary clock divider that is programmed to divide by 2 and is not sourced by the IRCOSC may get stuck and cannot subsequently be reprogrammed.

A stuck auxiliary clock divider output can be detected by the corresponding Clock Monitor Unit (CMU).

Workaround

Changing an auxiliary clock source selection value via software resets all its corresponding dividers and recovers them.

Apply the following sequence after each reset for enabled auxiliary clock dividers that are to be configured to divide by 2 for the application.

1. Disable the corresponding auxiliary clock divider by writing to the Aux Clock Divider Configuration (MC_CGM_ACn_DCx[DE] = 0).
2. Change the auxiliary clock source selection to IRCOSC (MC_CGM_ACn_SC[SELCTL] = 0b0000).
3. Select the desired clock source as the auxiliary clock source (e.g. for PLL0: MC_CGM_ACn_SC[SELCTL] = 0b0010).
4. Configure and enable the corresponding auxiliary clock divider by writing to the Aux Clock Divider Configuration (MC_CGM_ACn_DCx[DIV] = 1 and MC_CGM_ACn_DCx[DE] = 1).

ERR010552: PASS: JTAG password match bypasses flash read protection set by PASS.LOCK3[RLx] bits

Description

On a censored device, setting the region lock bits in the Pass Lock Register 3 (PASS.LOCK3[RLx]) of the Password and Device Security Module (PASS) should protect the contents of flash memory blocks from being read when a debug tool is attached and the block is enabled for any flash region that has the region lock set. Debug enable may be achieved either through clearing the PASS.LOCK3[DBL] bit or providing a matching JTAG password.

However, providing a matching JTAG password bypasses the region lock control of the PASS.LOCK3[RLx] bits and allows all flash regions to be read, regardless of the PASS.LOCK3[RLx] bit settings.

Workaround

It is not possible to maintain the flash read protection on locked regions if the JTAG password is used to enable the debug interface.

In order to maintain the read protection on locked regions of the flash, only enable the debug interface by clearing the Debug Interface Lock bit (PASS.LOCK3[DBL]) bit. The PASS.LOCK3[DBL] bit can be cleared by providing the correct password sequence to a password challenge/response, either via JTAG Communication module (JDC), or other external interface, such as CAN using software executing on the MCU.

An invalid JTAG password can be used in UTEST flash to disable this feature. Otherwise, programming a random value for the JTAG password match, which is not communicated to users, can greatly reduce the chances of enabling the debug interface and unlocking flash read access.

ERR010900: FCCU: False indication of a fault state for a single safe clock period can be generated on the error output pin

Description

The error out pin from the Fault Collection and Control Unit (FCCU) may pulse to a logic low (0b0) when the following conditions are fulfilled:

- software changes the error out protocol from a toggling protocol to a not-toggling protocol, and programs the FCCU_CFG.FCCU_SET_AFTER_RESET bit to 0b1
- software switches the Fault Collection and Control Unit (FCCU) state machine from CONFIG to NORMAL state

The duration of the glitch is equal to a single clock period of the Internal RC oscillator and there is a 50% of probability of the pulse occurring.

Workaround

Split the configuration of the FCCU in 2 phases.

During the first phase, software should do the following:

- 1) move the FCCU to the CONFIG state
- 2) configure the FCCU including the error out protocol, but without setting the FCCU_CFG.FCCU_SET_AFTER_RESET flag to 0b1 (leave as 0b0)
- 3) exits to the NORMAL state

During the second phase, software should do the following:

- 4) move the FCCU to the CONFIG state
- 5) set the FCCU_CFG.FCCU_SET_AFTER_RESET flag to 0b1
- 6) exit to the NORMAL state

Note: The default (after reset) error out protocol is the Dual Rail. Since this is a toggling protocol, the software must execute the above steps each time the user wants to switch to a non-toggling error out protocol.

ERR010963: Flash: Memory accesses may be corrupted when flash is operating between 33MHz and 75MHz

Description

Error Correction Code (ECC) errors may be generated in the flash due to corrupted data when all of the following conditions are met:

- The flash operating frequency is greater than 33MHz and less than or equal to 75MHz
- Read Wait State Control (PFLASH_PFCR1[RWSC]) = 2 and Address Pipeline Control (PFLASH_PFCR1[APC]) = 1
- Pipelined reads which are executed between the UTEST flash block and any other flash block. Pipelined reads are overlapping reads, where before the previous read is completed a new read is requested.

Device has UTEST memory space and remaining flash area is the main array memory space. This issue condition occurs if pipelined reads are executed between UTEST and the main array space. If pipelined reads

are executed between UTEST and UTEST memory space or between main array and main array memory space, this issue condition will not be seen.

Workaround

When the flash clock frequency is greater than 33MHz and less than or equal to 75MHz configure PFLASH_PFCR1[RWSC] = 2 and PFLASH_PFCR1[APC] = 0. The configuration for all other flash clock frequencies is specified in the MCU datasheet.

ERR010998: BAF: Uncorrectable ECC error at flash location 0xFAC000 prevents device from booting

Description

Boot Assist Flash (BAF) firmware locates a valid boot header by searching 9 flash locations in a specific, sequential order. If a valid boot header is not present in locations 1–4 and an uncorrectable ECC error is present at the 5th location (0xFAC000), the device will be reset and will not be able to boot. Valid boot headers at locations 6–9 will be ignored. If an uncorrectable ECC error is not present at 0xFAC000, any of the boot header locations can be used and the BAF will search through the locations sequentially until a valid boot header is found.

Workaround

1. Ensure that a valid boot header is placed at one of the first 4 boot header locations: before location 5 (0xFAC000).
2. If the valid boot header must be placed after 0xFAC000, do not program the 32 byte page beginning at 0xFAC000. Leave this flash area in the factory state (blank/unprogrammed).
3. If the 32 byte page starting at 0xFAC000 must be programmed, confirm that there are no existing ECC errors after programming and mark location 0xFAC000 as OTP. This will avoid uncorrectable ECC errors at this location during future erase or programming activities.

ERR011021: NAR: Trace to memory buffer pointers corrupted after break-point

Description

When using the trace to memory feature of the Nexus Aurora Router (NAR), some address pointers are not reset properly following a break-point. Therefore, following the break-point, the full trace memory cannot be used to hold trace information. The amount of memory not available depends on the pointer state after the break-point.

Workaround

To use full trace memory debugger following a break-point, perform the additional steps below before enabling trace after any break-point:

1. Perform a soft-reset of the NAR by setting the NAR Soft Reset bit in the NAR Control register (NCR[NSR]=1)
2. Re-configure all the NAR registers (that were cleared by this soft-reset) along with trace memory address register
3. Resume MCU execution from the break-point with trace enabled in the desired trace mode.

ERR011030: PMC: Self Test can repeat when clearing the result flag**Description**

During a normal Power Management Controller (PMC) Self Test of all of the Low-Voltage Detect / High-Voltage Detect (LVD/HVD) events, initiated by writing 2'b01 to the Self Test Mode field of the Voltage Detect User Mode Register (PMC_SELF_TEST_UM_VD_REG[ST_MODE]), the self test completes and clears the ST_MODE field automatically. However, during a single LVD/HVD test, initiated by writing a non-zero value into the Voltage Detect Self Test Control field (PMC_SELF_TEST_UM_VD_REG[VD_ST_CTRL]), the ST_MODE bits do not clear automatically when the test completes. If the self test result flag (PMC_SELF_TEST_UM_VD_REG[ST_RESULT]) is cleared without first clearing the ST_MODE field, the self test will run again.

Workaround

When testing individual LVD/HVDs via the PMC Self Test, clear the ST_MODE field manually via software after the test completes and then clear the ST_RESULT flag.

ERR011235: EMIOS: Any Unified Channel running in OPWMB or OPWMCB mode may function improperly if the source counter bus is generated by Unified channel in MC mode**Description**

The Unified channel (UC) configured in Center Aligned Output Pulse Width Modulation Buffered (OPWMCB) or Output Pulse Width Modulation Buffered (OPWMB) modes is not working properly when it is sourced from the UC configured in Modulus Counter (MC) mode by setting the channel control register MODE bitfield to 0x10 or 0x11 and any of its pre-scalers (internal or global) divider ratio is higher than 1.

Workaround

When a counter bus is generated by the UC set in the MC mode with any pre-scaler (internal or global) divider ratio higher than 1, don't use this counter bus for the UC set in OPWMCB or OPWMB mode.

ERR011256: FCCU: Redundancy control checker (RCC) reports false error in FCCU_SCFS register**Description**

The Fault collection and control unit (FCCU) has two self-checking sub-modules which compare FCCU internal signals. This feature can be enabled by setting the FCCU configuration register Redundancy Control Checker (RCC) bits (FCCU_CFG[RCCE0] and FCCU_CFG[RCCE1]) bits. The State Change Freeze Status register (FCCU_SCFS) contains the status of RCC checkers.

If the error output pin (EOUT) is configured in Bi-Stable mode and the user application software enables the RCC0 and RCC1 cross check signals with the default configuration, the FCCU_SCFS register reports an error.

Workaround

If the RCC self-checking feature is enabled via software, bit 20 of the FCCU_CFG register (FCCU_CFG[20]) must be set.

FCCU_CFG[20] is a configuration mode select (FCCU_CFG[CM]). When CM= 1'b1, during the CONFIG state, the EOUT pins functions the same as in the NORMAL state. Setting CM does not cause any other change in EOUT.

ERR011293: EMIOS: For any UC operating in OPWFMB mode the Channel Count register should not be written with a value greater than Channel B Data register value

Description

For any Unified Channel (UC) running in Output Pulse-Width and Frequency Modulation Buffered (OPWFMB) mode, Channel Control Register MODE bitfield = 7'h1011000 or 7'h1011010, the internal counter runs from 0x1 to Channel B Data register value.

The internal counter can be overwritten by software using the Chanel Count register during 'freeze' operation.

If a counter wrap occurs due to overwriting of the counter with a value greater than its expiry value (B Data Register value); than the output signal behavior cannot be guaranteed.

Workaround

For any UC operating in OPWFMB mode the Channel Count register should not be written with a value greater than Channel B Data register value.

ERR011294: EMIOS: OPWFMB and MCB mode counter rollover resets the counter to 0x0 instead of 0x1 as mentioned in the specification

Description

When the enhanced Modular Input/Output System (eMIOS) is used in Output Pulse-Width and Frequency Modulation Buffered (OPWFMB) or Modulus Counter Buffered (MCB) modes, when the counter rolls over, the counter returns to 0x0 instead of 0x1 as specified in the reference manual.

Workaround

In order to avoid the counter wrap condition:

1. Make sure internal counter value is within the 0x1 to (B1 register) value range when the OPWFMB mode is entered.
2. Overwrite of Channel Count register by forcing 'freeze' in OPWFMB mode should not be outside the range of 0x1 to (B register) value.

ERR011295: EMIOS: In OPWFMB mode, A1/B1 registers do not get reloaded with A2/B2 register values if counter value returns 0x1 after counter wrap condition

Description

In Output Pulse-Width and Frequency Modulation Buffered (OPWFMB) mode, A1/B1 registers do not get reloaded with A2/B2 register values if counter value returns 0x1 after counter wrap condition.

In order to avoid the counter wrap condition make sure internal counter value is within the 0x1 to B1 register value range when the OPWFMB mode is entered. Also overwriting of Channel Count register by forcing 'freeze' in OPWFMB mode should not take internal counter outside 0x1 to B register value.

Workaround

In order to avoid the counter wrap condition:

1. Make sure internal counter value is within the 0x1 to (B1 register) value range when the OPWFMB mode is entered.
2. Overwrite of Channel Count register by forcing 'freeze' in OPWFMB mode should not be outside the range of 0x1 to (B register) value.

ERR050090: DSPI/SPI: Incorrect data may be transmitted in slave mode

Description

If the Serial Peripheral Interface (SPI or the Deserial/Serial Peripheral Interface) is operating in slave mode, incorrect or stale data may be transmitted in next transaction without underflow interrupt generation if the set up time of the Peripheral Chip Select (PCS) to the SPI Serial Clock (SCLK) is short and the transmit FIFO may become empty after one transaction.

This can occur if the PCS to SCK is less than:

$$4 \times \text{IPG_CLOCK_PERIOD} + 4 \times \text{DSPI_CLOCK_PERIOD} + 0.5 \times \text{SCK_CLOCK_PERIOD}$$

Where:

IPG_CLOCK is the internal bus clock ("system" clock)

DSPI_CLOCK is the protocol clock.

SCK_CLOCK is the Line-Side Serial Communication Clock.

Workaround

When operating in slave mode, software must ensure that the time interval between PCS assertion to start of SCK Clock is greater than $4 \times \text{IPG_CLOCK_PERIOD} + 4 \times \text{DSPI_CLOCK_PERIOD} + 0.5 \times \text{SCK_CLOCK_PERIOD}$.

To meet this requirement, the Master SPI can either lengthen the PCS to SCK assertion time or decrease the frequency of the communication interface, or both.

ERR050130: PIT: Temporary incorrect value reported in LMTR64H register in lftimer mode

Description

When the Programmable interrupt timer (PIT) module is used in lftimer mode, timer 0 and timer 1 are chained and the timer load start value (LDVAL0[TSV] and LDVAL1[TSV]) are set according to the application need for both timers. When timer 0 current time value (CVAL0[TVL]) reaches 0x0 and subsequently reloads to LDVAL0[TSV], then timer 1 CVAL1[TVL] should decrement by 0x1.

However this decrement does not occur until one cycle later, therefore a read of the PIT upper lifetime timer register (LTMR64H) is followed by a read of the PIT lower lifetime timer register (LTMR64L) at the instant when timer 0 has reloaded to LDVAL0[TSV] and timer 1 is yet to be decremented in next cycle then an incorrect timer value in LTMR64H[LTH] is expected.

Workaround

In lifetimer mode if the read value of LTMR64L[LTL] is equal to LDVAL0[TSV] then read both LTMR64H and LTMR64L registers one additional time to obtain the correct lifetime value.

ERR050159: CMU: Monitoring signal for sudden loss of clock from CMU does not signal the Fault Collection and Control Unit

Description

The Clock Monitor Unit (CMU) detects when the frequency of a monitored clock drops below a programmed threshold and asserts the Frequency Less than Low Threshold (FLL) signal if this occurs. The FLL signal is routed to the Fault Collection and Control Unit (FCCU) providing a mechanism to react to the clock fault but due to the monitoring implementation the FLL signal will not be triggered when the monitored clock suddenly stops.

Workaround

Each of the CMU monitored clocks has been analysed for the system level failure effect upon loss of the monitored clock and the safety mechanisms present to detect this. From this analysis it is concluded that loss of all the monitored clocks can be detected by other existing safety mechanisms in the system.

Further, since the CMU monitored clocks are derived from one of the system clock sources (XOSC_CLK, PLL0_PHI_CLK, PLL1_PHI_CLK) if the loss of the monitored clock is caused by the loss of the source clock then this will be detected and reported to FCCU by existing source clock loss detection mechanisms.

ERR050246: FlexCAN: Receive Message Buffers may have its Code Field corrupted if the Receive FIFO function is used

Description

If the Code Field of a Receive Message Buffer is corrupted it may deactivate the Message Buffer, so it is unable to receive new messages. It may also turn a Receive Message Buffer into any type of Message Buffer as defined in the Message buffer structure section in the device documentation.

The Code Field of the FlexCAN Receive Message Buffers (MB) may get corrupted if the following sequence occurs.

- 1- A message is received and transferred to an MB (i.e. MBx)
- 2- MBx is locked by software for more than 20 CAN bit times (time determines the probability of erratum to manifest).
- 3- SMB0 (Serial Message Buffer 0) receives a message (i.e. message1) intended for MBx, but destination is locked by the software (as depicted in point 2 above) and therefore NOT transferred to MBx.
- 4- A subsequent incoming message (i.e. message2) is being loaded into SMB1 (as SMB0 is full) and is evaluated by the FlexCAN hardware as being for the FIFO.
- 5- During the message2, the MBx is unlocked. Then, the content of SMB0 is transferred to MBx and the CODE field is updated with an incorrect value.

The problem does not occur in cases when only Rx FIFO or only a dedicated MB is used (i.e. either RX MB or Rx FIFO is used). The problem also does not occur when the Enhanced Rx FIFO and dedicated MB are used in the same application. The problem only occurs if the FlexCAN is programmed to receive in the Legacy FIFO and dedicated MB at the same application.

Workaround

This defect only applies if the Receive FIFO (Legacy Rx FIFO) is used. This feature is enabled by RFEN bit in the Module Control Register (MCR). If the Rx FIFO is not used, the Receive Message Buffer Code Field is not corrupted.

If available on the device, use the enhanced Rx FIFO feature instead of the Legacy Rx FIFO. The Enhanced Rx FIFO is enabled by the ERFEN bit in the Enhanced Rx FIFO Control Register (ERFCR).

The defect does not occur if the Receive Message Buffer lock time is less than or equal to the time equivalent to 20 x CAN bit time.

The recommended way for the CPU to service (read) the frame received in a mailbox is by the following procedure:

1. Read the Control and Status word of that mailbox.
2. Check if the BUSY bit is deasserted, indicating that the mailbox is not locked. Repeat step 1) while it is asserted.
3. Read the contents of the mailbox.
4. Clear the proper flag in the IFLAG register.
5. Read the Free Running Timer register (TIMER) to unlock the mailbox

In order to guarantee that this procedure occurs in less than 20 CAN bit times, the MB receive handling process in software (step 1 to step 5 above) should be performed as a 'critical code section' (interrupts disabled before execution) and should ensure that the MB receive handling occurs in a deterministic number of cycles.

ERR050575: eMIOS: Any Unified Channel running in OPWMCB mode may function improperly if the lead or trail dead time insertion features is used and its timebase is generated by Unified channel in MCB mode

Description

The Unified channel (UC) configured in Center Aligned Output Pulse Width Modulation Buffered (OPWMCB) mode is not working properly when:

1. It's timebase is sourced from the UC configured in Modulus Counter Buffered (MCB) mode.
2. The lead or trail dead time insertion features is used.
3. Its channel prescaler is different than timebase channel prescaler.

Workaround

Channel configured in OPWMCB mode with lead or trail dead time insertion features enabled must have channel prescaler equal to the timebase channel prescaler configured in MCB mode.

ERR052226: SWT: Toggling watchdog enable may cause unexpected timeout in some boundary conditions

Description

The Software Watchdog Timer (SWT) may timeout unexpectedly when loading a new timeout value. This can occur when the SWT is paused (CR[WEN]=0b0) to update the TO[WTO], while the counter is less than 0x14

(CO[CNT] = 0x14). When SWT is re-enabled (CR[WEN]=0b1), the SWT resumes the cycle count, but the counter is not updated (CO[CNT]) with the new timeout value before the cycle counter reaches zero.

Workaround

Before setting a new timeout value (TO[WTO]) the SWT must be updated with the watchdog keys ((SR[WSC]= 0xA602) and then (SR[WSC] = 0xB480)) to restart the counter value and have the timeout change being made within the appropriate time window, preventing the counter from reaching zero.

ERR052559: INTC: Register updated on bus error

Description

The Interrupt Controller (INTC) defines register field PSR.SWTN as protected. Only the master core should be allowed to write. Other writes should generate a bus error. Such writes should be dropped, but due to this issue, they are not.

Workaround

Only write PSR.SWTN from master core

Legal information

Definitions

Draft — A draft status on a document indicates that the content is still under internal review and subject to formal approval, which may result in modifications or additions. NXP Semiconductors does not give any representations or warranties as to the accuracy or completeness of information included in a draft version of a document and shall have no liability for the consequences of use of such information.

Disclaimers

Limited warranty and liability — Information in this document is believed to be accurate and reliable. However, NXP Semiconductors does not give any representations or warranties, expressed or implied, as to the accuracy or completeness of such information and shall have no liability for the consequences of use of such information. NXP Semiconductors takes no responsibility for the content in this document if provided by an information source outside of NXP Semiconductors.

In no event shall NXP Semiconductors be liable for any indirect, incidental, punitive, special or consequential damages (including - without limitation - lost profits, lost savings, business interruption, costs related to the removal or replacement of any products or rework charges) whether or not such damages are based on tort (including negligence), warranty, breach of contract or any other legal theory.

Notwithstanding any damages that customer might incur for any reason whatsoever, NXP Semiconductors' aggregate and cumulative liability towards customer for the products described herein shall be limited in accordance with the Terms and conditions of commercial sale of NXP Semiconductors.

Right to make changes — NXP Semiconductors reserves the right to make changes to information published in this document, including without limitation specifications and product descriptions, at any time and without notice. This document supersedes and replaces all information supplied prior to the publication hereof.

Applications — Applications that are described herein for any of these products are for illustrative purposes only. NXP Semiconductors makes no representation or warranty that such applications will be suitable for the specified use without further testing or modification.

Customers are responsible for the design and operation of their applications and products using NXP Semiconductors products, and NXP Semiconductors accepts no liability for any assistance with applications or customer product design. It is customer's sole responsibility to determine whether the NXP Semiconductors product is suitable and fit for the customer's applications and products planned, as well as for the planned application and use of customer's third party customer(s). Customers should provide appropriate design and operating safeguards to minimize the risks associated with their applications and products.

NXP Semiconductors does not accept any liability related to any default, damage, costs or problem which is based on any weakness or default in the customer's applications or products, or the application or use by customer's third party customer(s). Customer is responsible for doing all necessary testing for the customer's applications and products using NXP Semiconductors products in order to avoid a default of the applications and the products or of the application or use by customer's third party customer(s). NXP does not accept any liability in this respect.

Limiting values — Stress above one or more limiting values (as defined in the Absolute Maximum Ratings System of IEC 60134) will cause permanent damage to the device. Limiting values are stress ratings only and (proper) operation of the device at these or any other conditions above those given in the Recommended operating conditions section (if present) or the Characteristics sections of this document is not warranted. Constant or repeated exposure to limiting values will permanently and irreversibly affect the quality and reliability of the device.

Terms and conditions of commercial sale — NXP Semiconductors products are sold subject to the general terms and conditions of commercial sale, as published at <https://www.nxp.com/profile/terms>, unless otherwise agreed in a valid written individual agreement. In case an individual agreement is concluded only the terms and conditions of the respective agreement shall apply. NXP Semiconductors hereby expressly objects to applying the customer's general terms and conditions with regard to the purchase of NXP Semiconductors products by customer.

No offer to sell or license — Nothing in this document may be interpreted or construed as an offer to sell products that is open for acceptance or the grant, conveyance or implication of any license under any copyrights, patents or other industrial or intellectual property rights.

Quick reference data — The Quick reference data is an extract of the product data given in the Limiting values and Characteristics sections of this document, and as such is not complete, exhaustive or legally binding.

Export control — This document as well as the item(s) described herein may be subject to export control regulations. Export might require a prior authorization from competent authorities.

HTML publications — An HTML version, if available, of this document is provided as a courtesy. Definitive information is contained in the applicable document in PDF format. If there is a discrepancy between the HTML document and the PDF document, the PDF document has priority.

Translations — A non-English (translated) version of a document, including the legal information in that document, is for reference only. The English version shall prevail in case of any discrepancy between the translated and English versions.

Security — Customer understands that all NXP products may be subject to unidentified vulnerabilities or may support established security standards or specifications with known limitations. Customer is responsible for the design and operation of its applications and products throughout their lifecycles to reduce the effect of these vulnerabilities on customer's applications and products. Customer's responsibility also extends to other open and/or proprietary technologies supported by NXP products for use in customer's applications. NXP accepts no liability for any vulnerability. Customer should regularly check security updates from NXP and follow up appropriately. Customer shall select products with security features that best meet rules, regulations, and standards of the intended application and make the ultimate design decisions regarding its products and is solely responsible for compliance with all legal, regulatory, and security related requirements concerning its products, regardless of any information or support that may be provided by NXP.

NXP has a Product Security Incident Response Team (PSIRT) (reachable at PSIRT@nxp.com) that manages the investigation, reporting, and solution release to security vulnerabilities of NXP products.

Suitability for use in automotive applications (functional safety) — This NXP product has been qualified for use in automotive applications. It has been developed in accordance with ISO 26262, and has been ASIL classified accordingly. If this product is used by customer in the development of, or for incorporation into, products or services (a) used in safety critical applications or (b) in which failure could lead to death, personal injury, or severe physical or environmental damage (such products and services hereinafter referred to as "Critical Applications"), then customer makes the ultimate design decisions regarding its products and is solely responsible for compliance with all legal, regulatory, safety, and security related requirements concerning its products, regardless of any information or support that may be provided by NXP. As such, customer assumes all risk related to use of any products in Critical Applications and NXP and its suppliers shall not be liable for any such use by customer. Accordingly, customer will indemnify and hold NXP harmless from any claims, liabilities, damages and associated costs and expenses (including attorneys' fees) that NXP may incur related to customer's incorporation of any product in a Critical Application.

NXP B.V. — NXP B.V. is not an operating company and it does not distribute or sell products.

Trademarks

NXP — wordmark and logo are trademarks of NXP B.V.

Notice: All referenced brands, product names, service names, and trademarks are the property of their respective owners.

Contents

1	Mask Set Errata for Mask 1N83M	1
1.1	Revision History	1
1.2	Errata and Information Summary	3
2	Known Errata	7
	Legal information	53

Please be aware that important notices concerning this document and the product(s) described herein, have been included in section 'Legal information'.

© June 2025 NXP B.V.

All rights reserved.

For more information, please visit: <https://www.nxp.com>

[Document feedback](#)

Date of release: 6 June 2025

Document identifier: MPC5746R_1N83M