
Mask Set Errata for Mask 1M80N

This report applies to mask 1M80N for these products:

- MC9S08QL8
- MC9S08QL4

The mask set is identified by a 5-character code consisting of a version number, a letter, two numerical digits, and a letter, for example 0J27F.

Device markings indicate the week of manufacture and the mask set used. The date is coded as four numerical digits where the first two digits indicate the year and the last two digits indicate the work week. For instance, the date code "0301" indicates the first week of the year 2003.

Some MCU samples and devices are marked with an SC, PC, or XC prefix. An SC prefix denotes special/custom device. A PC prefix indicates a prototype device which has undergone basic testing only. An XC prefix denotes that the device is tested but is not fully characterized or qualified over the full range of normal manufacturing process variations. After full characterization and qualification, devices will be marked with the MC or SC prefix.

SE156-ADC-COCO: COCO bit may not get cleared when ADCSC1 is written to

Errata type: Silicon

Affects: ADC

Description: If an ADC conversion is near completion when the ADC Status and Control 1 Register (ADCSC1) is written to (i.e., to change channels), it is possible for the conversion to complete, setting the COCO bit, before the write instruction is fully executed. In this scenario, the write may not clear the COCO bit, and the data in the ADC Result register (ADCR) will be that of the recently completed conversion.

If interrupts are enabled, then the interrupt vector will be taken immediately following the write to the ADCSC1 register.



Workaround: It is recommended when writing to the ADCSC1 to change channels or stop continuous conversion, that you write to the register twice. The first time should be to turn the ADC off and disable interrupts, and the second should be to select the mode/channel and re-enable the interrupts.

SE157-ADC-INCORRECT-DATA: Boundary case may result in incorrect data being read in 10- and 12-bit modes

Errata type: Silicon

Affects: ADC

Description: In normal 10-bit or 12-bit operation of the ADC, the coherency mechanism will freeze the conversion data such that when the high byte of data is read, the low byte of data is frozen, ensuring that the high and low bytes represent result data from the same conversion.

In the errata case, there is a single-cycle (bus clock) window per conversion cycle when a high byte may be read on the same cycle that subsequent a conversion is completing. Although extremely rare due to the precise timing required, in this case, it is possible that the data transfer occurs, and the low byte read may be from the most recently completed conversion.

In systems where the ADC is running off the bus clock, and the data is read immediately upon completion of the conversion, the errata will not occur. Also, in single conversion mode, if the data is read prior to starting a new conversion, then the errata will not occur.

The errata does not impact 8-bit operation.

Introducing significant delay between the conversion completion and reading the data, while a following conversion is executing/pending, could increase the probability for the errata to occur. Nested interrupts, significant differences between the bus clock and the ADC clock, and not handling the result register reads consecutively, can increase the delay and therefore the probability of the errata occurring.

Workaround: Using the device in 8-bit mode will eliminate the possibility of the errata occurring.

Using the ADC in single conversion mode, and reading the data register prior to initiating a subsequent conversion will eliminate the possibility of the errata occurring.

Minimizing the delay between conversion complete and processing the data can minimize the risk of the errata occurring. Disabling interrupts on higher priority modules and avoiding nested interrupts can reduce possible contentions that may delay the time from completing a conversion and handling the data. Additionally, increasing the bus frequency when running the ADC off the asynchronous clock, may reduce the delay from conversion complete to handling of the data.

How to Reach Us:**Home Page:**nxp.com**Web Support:**nxp.com/support

Information in this document is provided solely to enable system and software implementers to use NXP products. There are no express or implied copyright licenses granted hereunder to design or fabricate any integrated circuits based on the information in this document. NXP reserves the right to make changes without further notice to any products herein.

NXP makes no warranty, representation, or guarantee regarding the suitability of its products for any particular purpose, nor does NXP assume any liability arising out of the application or use of any product or circuit, and specifically disclaims any and all liability, including without limitation consequential or incidental damages. "Typical" parameters that may be provided in NXP data sheets and/or specifications can and do vary in different applications, and actual performance may vary over time. All operating parameters, including "typicals," must be validated for each customer application by customer's technical experts. NXP does not convey any license under its patent rights nor the rights of others. NXP sells products pursuant to standard terms and conditions of sale, which can be found at the following address: nxp.com/SalesTermsandConditions.

While NXP has implemented advanced security features, all products may be subject to unidentified vulnerabilities. Customers are responsible for the design and operation of their applications and products to reduce the effect of these vulnerabilities on customer's applications and products, and NXP accepts no liability for any vulnerability that is discovered. Customers should implement appropriate design and operating safeguards to minimize the risks associated with their applications and products.

NXP, the NXP logo, NXP SECURE CONNECTIONS FOR A SMARTER WORLD, COOLFLUX, EMBRACE, GREENCHIP, HITAG, I2C BUS, ICODE, JCOP, LIFE VIBES, MIFARE, MIFARE CLASSIC, MIFARE DESFire, MIFARE PLUS, MIFARE FLEX, MANTIS, MIFARE ULTRALIGHT, MIFARE4MOBILE, MIGLO, NTAG, ROADLINK, SMARTLX, SMARTMX, STARPLUG, TOPFET, TRENCHMOS, UCODE, Freescale, the Freescale logo, AltiVec, C-5, CodeTEST, CodeWarrior, ColdFire, ColdFire+, C-Ware, the Energy Efficient Solutions logo, Kinetis, Layerscape, MagniV, mobileGT, PEG, PowerQUICC, Processor Expert, QorIQ, QorIQ Qonverge, Ready Play, SafeAssure, the SafeAssure logo, StarCore, Symphony, VortiQa, Vybrid, Airfast, BeeKit, BeeStack, CoreNet, Flexis, MXC, Platform in a Package, QUICC Engine, SMARTMOS, Tower, TurboLink, and UMEMS are trademarks of NXP B.V. All other product or service names are the property of their respective owners. Arm, AMBA, Artisan, Cortex, Jazelle, Keil, SecurCore, Thumb, TrustZone, and μ Vision are registered trademarks of Arm Limited (or its subsidiaries) in the EU and/or elsewhere. Arm7, Arm9, Arm11, big.LITTLE, CoreLink, CoreSight, DesignStart, Mali, Mbed, NEON, POP, Sensinode, Socrates, ULINK and Versatile are trademarks of Arm Limited (or its subsidiaries) in the EU and/or elsewhere. All rights reserved. Oracle and Java are registered trademarks of Oracle and/or its affiliates. The Power Architecture and Power.org word marks and the Power and Power.org logos and related marks are trademarks and service marks licensed by Power.org.

© 2018 NXP B.V.

