

MC68VZ328

Addendum to MC68VZ328 Integrated Processor User's Manual (DragonBall™ VZ)

This addendum supplements, and should be used in conjunction with, the *MC68VZ328 Integrated Processor User's Manual*, rev. 0 (order number MC68VZ328UM/D). Section 1, "User's Manual Errata," corrects information in the user's manual, and Section 2, "Additional Information," provides supplemental information.

1 User's Manual Errata

Table 1 identifies and corrects errata that appear in more than one location in the user's manual. Subsequent subsections identify and correct errata in specific chapters.

Error Locations	Error	Corrections
Figure 2-1 (page 2-2) Table 2-1 (page 2-3) Section 2.8 (page 2-7)	The mnemonic that is used for the LCD Frame Marker signal—LFLM—is incorrect.	The mnemonic for the LCD Frame Marker signal is LFRM. Replace all occurrences of LFLM with LFRM.
Section 8.2 (page 8-3) Section 8.2.1 (page 8-3) Section 8.2.1.1 (page 8-3) Figure 8-2 (page 8-4)		
Table 10-14 (page 10-13)		
Figure 19-13 (page 19-17) Figure 19-14 (page 19-18) Table 19-15 (page 19-18)		

MOTOROLA

digitaldna

Table 1. Errata in Multiple Locations

Specifications and information herein are subject to change without notice.

© Motorola, Inc., 2001. All rights reserved.



Error Locations	Error	Corrections
Section 8.2.1 (page 8-3) Table 8-12 (page 8-17)	The mnemonic that is used for the LCD Frame Marker signal—FLM—is incorrect.	The mnemonic for the LCD Frame Marker signal is LFRM. Replace all occurrences of FLM with LFRM.
Section 8.2.5 (page 8-9) Section 8.2.5.1 (page 8-9) Table 8-19 (page 8-21)	The mnemonic that is used for the LCD Frame Marker signal—FRM—is incorrect.	The mnemonic for the LCD Frame Marker signal is LFRM. Replace all occurrences of FRM with LFRM.
Section 8.2.1.1 (page 8-3) LPOLCF register (page 8-16) Table 8-16 (page 8-16)	The mnemonic that is used for the frame marker polarity bit— FLMPOL—is incorrect.	The mnemonic for the frame marker polarity bit is FRMPOL. Replace all occurrences of FLMPOL with FRMPOL.
Section 8.2 (page 8-2) Section 8.2.1 (page 8-3) Section 8.2.5 (page 8-9) Section 8.2.5.1 (page 8-9) Table 8-12 (page 8-17) Table 8-19 (page 8-21)	The mnemonic that is used for the LCD Line Pulse signal—LP—is incorrect.	The mnemonic for the LCD Line Pulse signal is LLP. Replace all occurrences of LP with LLP.
Table 3-1 (page 3-5) Table 3-2 (page 3-13) Section 14.4.2 (page14-12)	The UBAUD1 reset value—0x003F— is incorrect.	The reset value is 0x0002. (See Section 1.2 and Section 1.8 of this document)
Table 3-1 (page 3-6) Table 3-2 (page 3-13) Section 14.4.9 (page14-22)	The UBAUD2 reset value—0x003F— is incorrect.	The reset value is 0x0002. (See Section 1.2 and Section 1.8 of this document)

Table 1.	Errata in Multiple Locations	(Continued)
----------	------------------------------	-------------

1.1 Corrections to Chapter 1, "Introduction"

Table 2 corrects errors in Chapter 1 of the MC68VZ328 Integrated Processor User's Manual.

Table 2.	Corrections	to Chapter 1
----------	-------------	--------------

Error Location	Error	Correction
Chapter 1, "Introduction" (page 1-1)	The third sentence of the second paragraph reads as follows: "Additionally, the new DragonBall VZ integrates the logic needed to support color LCD panels on-chip."	Delete this sentence.
Section 1.1, "Features of the MC68VZ328" (page 1-3)	Under the bullet for "Real-time clock/sampling timer," the first sub- bullet states: "Separate power sup- ply for the RTC."	Delete this sub-bullet.



Error Location	Error	Correction
Section 1.1, "Features of the MC68VZ328" (page 1-3)	Under the bullet for "LCD control- ler," the first sub-bullet identifies support for "color STN" panels.	 The sub-bullet should read as follows: LCD controller Software-programmable screen size to support single (nonsplit) monochrome panel (up to 640 × 512 pixels)

Table 2. Corrections to Chapter 1 (Continued)

1.2 Corrections to Chapter 3, "Memory Map"

There are various corrections that apply to both Table 3-1 and Table 3-2. The same set of corrections applies to each table, but the information is presented twice because the tables are arranged differently.

1.2.1 Corrections to Table 3.1, "Programmer's Memory Map (Sorted by Address)"

In Table 3-1, the following changes apply:

- At the address 0xFFFFF10A (page 3-2):
 - Change the Name to CSCTRL1.
 - Change the Description to "Chip-select control register 1."
 - Change the Page Number to 6-17.
- Create new table rows for the addresses 0xFFFFF10C and 0xFFFFF150 (page 3-2). See the corrected version of Table 3-1 for complete information.
- At the address 0xFFFFF902, change the Reset Value to 0x0002 (page 14-12).
- At the address 0xFFFF912, change the Reset Value to 0x0002 (page 14-12).
- In the row for the LRRA register, which is listed at the address 0xFFFFFA29, make these corrections (page 3-6):
 - Change the Address to 0xFFFFA28.
 - Change the Width to 16.
 - Change the Reset Value to 0x00FF.
- At the address 0xFFFFFB0C, change the Width to 16 (page 3-7).
- At the address 0xFFFFB12, change the Width to 16 (page 3-7).

The following partial reproduction of Table 3-1 incorporates these corrections. New and corrected information appears in red and is underlined.

Address	Name	Width	Description	Reset Value	Page Number
0xFFFFF10A	CSCTRL1	16	Chip-select control register 1	0x0000	6-1 <u>7</u>



Address	Name	Width	Description	Reset Value	Page Number
0xFFFFF10C	CSCTRL2	<u>16</u>	Chip-select control register 2	<u>0x1000</u>	<u>6-18</u>
0xFFFFF150	CSCTRL3	<u>16</u>	Chip-select control register 3	<u>0x9C00</u>	<u>6-20</u>
0xFFFFF902	UBAUD1	16	UART unit 1 baud control register	<u>0x0002</u>	14-12
0xFFFFF912	UBAUD2	16	UART unit 2 baud control register	<u>0x0002</u>	14-12
0xFFFFFA2 <u>8</u>	LRRA	<u>16</u>	LCD refresh rate adjustment register	0x <u>00</u> FF	8-18
0xFFFFFB0C	RTCCTL	<u>16</u>	RTC control register	0x0080	11-10
0xFFFFFB12	STPWCH	<u>16</u>	Stopwatch minutes register	0x003F	11-14

1.2.2 Corrections to Table 3.2, "Programmer's Memory Map (Sorted by Register Name)"

In Table 3-2, the following changes apply.

- In the row for the chip-select control register, whose name is listed as CSCR, make these corrections (page 3-8):
 - Change the Name to CSCTRL1.
 - Change the Description to "chip-select control register 1."
 - Change the Page Number to 6-17.
- Add new rows for registers with the names CSCTRL2 and CSCTRL3 (page 3-8). See the corrected version of Table 3-2 for complete information.
- In the row for the LRRA register (page 3-9):
 - Change the Address to 0xFFFFFA28.
 - Change the Width to 16.
 - Change the Reset Value to 0x00FF.
- In the row for the RTCCTL register, change the Width to 16 (page 3-12).
- In the row for the STPWCH register, change the Width to 16 (page 3-12).
- In the row for the UBAUD1, change the Reset Value to 0x0002 (page 14-12).
- In the row for the UBAUD2, change the Reset Value to 0x0002 (page 14-12).



The following version of portions of Table 3-2 incorporates these corrections. New and corrected information appears in red and is underlined.

Name	Address	Width	Description	Reset Value	Page Number
CSCTRL1	0xFFFFF10A	16	Chip-select control register 1	0x0000	6-1 <u>7</u>
CSCTRL2	0xFFFFF10C	<u>16</u>	Chip-select control register 2	<u>0x1000</u>	<u>6-18</u>
CSCTRL3	0xFFFFF150	<u>16</u>	Chip-select control register 3	<u>0x9C00</u>	<u>6-20</u>
LRRA	0xFFFFFA2 <u>8</u>	<u>16</u>	LCD refresh rate adjustment register	0x <u>00</u> FF	8-18
RTCCTL	0xFFFFFB0C	<u>16</u>	RTC control register	0x0080	11-10
STPWCH	0xFFFFFB12	<u>16</u>	Stopwatch minutes register	0x003F	11-14
UBAUD1	0xFFFFF902	16	UART unit 1 baud control register	<u>0x0002</u>	14-12
UBAUD2	0xFFFFF912	16	UART unit 2 baud control register	<u>0x0002</u>	14-12

1.3 Corrections to Chapter 6, "Chip-Select Logic"

In Section 6.1 (page 6-1), in the fourth paragraph, the third sentence refers to "CDL." Change CDL to CSL (for "chip-select logic").

1.4 Corrections to Chapter 7, "DRAM Controller"

In Table 7-9, "SDRAM Bank Address Programming Examples" (page 7-17), the unit for the memory values in the Application column is incorrect. In the second row through the fifth row, change all instances of "Mbyte" to "Mbit."

The following version of Table 7-9 incorporates these corrections. Corrected information appears in red and is underlined.

Application	BNKADDH	BNKADDL	Remarks
Make all SDRAM appear as one single bank	11	11	None
Two banks of SDRAM—for example, 16 Mbit	00	11	Choose PA20 as bank selection address



Application	BNKADDH	BNKADDL	Remarks
Four banks of SDRAM—for example, 64 <u>Mbit</u>	01	10	Choose PA22 and PA21 as bank selection address
Four banks of SDRAM—for example, 128 <u>Mbit</u>	01	10	Choose PA22 and PA23 as bank selection address
Four banks of SDRAM—for example, 256 Mbit	10	10	Choose PA24 and PA23 as bank selection address

1.5 Corrections to Chapter 8, "LCD Controller"

Table 3 identifies corrections to Chapter 8 of the MC68VZ328 Integrated Processor User's Manual.

Error Location	Error	Correction
Section 8.1, "LCD Controller Features" (page 8-1)	 The third bullet refers to support for color: Support for single (nonsplit) monochrome screen and color STN LCD panels through preprocessing of image data with software 	 Delete the reference to color panels and all subsequent text in this bullet. The third bullet should read: Support for single (nonsplit) monochrome screen
Section 8.2.1, "Connecting the LCD Controller to an LCD Panel" (page 8-3)	No description of the CONTRAST signal is provided.	 Add a bullet describing the CONTRAST signal as follows: CONTRAST—The LCD CONTRAST output signal may be used to control the contrast of an LCD panel. The CONTRAST signal provides a pulse-width-modulated signal whose pulse width and clock source are adjustable in software. See Section 8.3.18, "PWM Contrast Control Register," for more information.

Table 3. Corrections to Chapter 8

1.6 Corrections to Chapter 12, "General-Purpose Timers"

Table 4 contains a correction to Chapter 12 of the MC68VZ328 Integrated Processor User's Manual.



Error Location	Error Location Error Correction								
Table 12-2 (page 12-7)	In the row for bit 4, the IRQEN (interrupt request enable) bit, the Setting column presents the bit as a 2-bit field.	Change the listed setting options from 2-bit values to 1-bit values, as follows:							
		0 = Disable the compare interrupt (default).1 = Enable the compare interrupt.							

Table 4. Correction to Chapter 12

1.7 Corrections to Chapter 13, "Serial Peripheral Interface 1 and 2"

This section contains corrections to Chapter 13 of the MC68VZ328 Integrated Processor User's Manual.

1.7.1 Corrections to Section 13.3.1, "SPI 1 Receive Data Register"

The SPI 1 receive data register is presented as an 8-bit register, which is incorrect. It is a 16-bit register. On page 13-4, replace the SPIRXD register display with the following one:

SPIRXD SPI 1 Receive Da						Data	Data Register					0x(FF)FFF700				
	BIT 15	14	13	12	11	10	9	8	7	6	5	4	3	2	1	BIT 0
								DAT	ΓA							
TYPE	r	r	r	r	r	r	r	r	r	r	r	r	r	r	r	r
RESET	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
RESEI								0x00	000							

In addition, in the Name column of Table 13-1, replace the identifier "Bits 7–0" with "Bits 15–0."

1.7.2 Corrections to Section 13.3.2, "SPI 1 Transmit Data Register"

The SPI 1 transmit data register is presented as an 8-bit register with a reset value of 0x00, which is incorrect. It is a 16-bit register with a reset value of 0x0000.

On page 13-5, replace the SPITXD register display with the following one:

SPITXD SPI 1 Trar					Transmit Data Register							0x(FF)FFF702				
	BIT 15	14	13	12	11	10	9	8	7	6	5	4	3	2	1	BIT 0
								DA	ΓA							
TYPE	W	W	w	W	w	w	w	w	w	w	w	w	W	w	W	w
RESET	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
RESET								0x00	000							

In addition, in the Name column of Table 13-2, replace the identifier "Bits 7–0" with "Bits 15–0."



1.8 Corrections to Chapter 14, "Universal Asynchronous Receiver/Transmitter 1 and 2"

This section contains corrections to Chapter 14 of the MC68VZ328 Integrated Processor User's Manual. Table 5 presents a correction to Section 14.1, "Introduction to the UARTs."

Errata Location	Error	Corrections
Section 14.1, "Introduction to the UARTs" (page 14-2)	In the second bulleted list of features, which is introduced by the statement "The UART 2 module is an enhanced version of the UART 1," an additional feature is miss- ing.	 Add the following bullet to the end of the list: The non-integer prescaler value can be programmed to be 1, which provides the maximum nonstandard baud rate of 2.07 MHz with the 16x sample clock.

Table 5.	Correction	to Section	14.1
----------	------------	------------	------

1.8.1 Corrections to Table 14.1, "Non-Integer Prescaler Values"

Table 14-1's final row, for the select field value of 111, erroneously omits information (page 14-8). Corrections to this row are as follows:


- The Minimum Divisor value is 1 (UART 2 only).
- The Maximum Divisor value is 1 (UART 2 only).

The following table excerpt displays the corrected information, which appears in red and is underlined.

Select (Binary)	Minimum Divisor	Maximum Divisor	Step Size				
111	<u>1 (UART 2 only)</u>	<u>1 (UART 2 only)</u>	_				

1.8.2 Corrections to Section 14.4.2, "UART 1 Baud Control Register"


In the Reset row of the register display the correct reset value is 0x0002. A corrected version of the register display follows, with the new information in red and underlined.

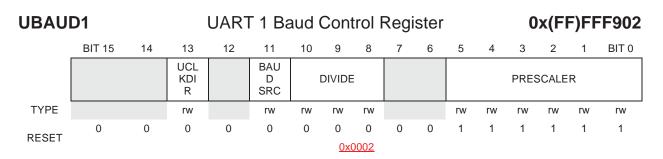




1.8.3 Corrections to Section 14.4.4, "UART 1 Transmitter Register"

In the Type row of the register display bits 10 and 9 are read-only. A corrected version of the register display follows, with the new information in red and underlined.

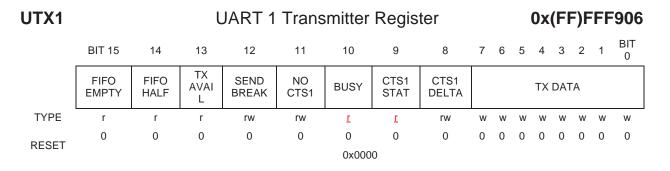

1.8.4 Corrections to Section 14.4.9, "UART 2 Baud Control Register"

In the Reset row of the register display the correct reset value is 0x0002. A corrected version of the register display follows, with the new information in red and underlined.

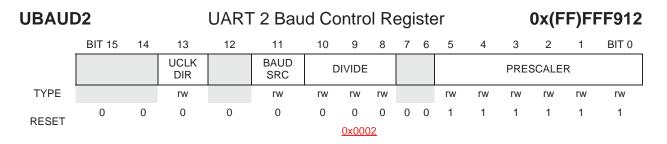

1.8.5 Corrections to Section 14.4.11, "UART 2 Transmitter Register"

In the Type row of the register display bits 10 and 9 are read-only. A corrected version of the register display follows, with the new information in red and underlined.


UTX2	UART 2 Transmitter Register											0)x(FF)	FF	F916
	BIT 15	14	13	12	11	10	9	8	7	6	5	4	3	2	1	BIT 0
	FIFO EMPTY	FIFO HALF	TX AVAIL	SEND BREAK	NO CTS2	B U S Y	CTS2 STAT	CTS2 DELTA				ТХ	(DA	TA		
TYPE	r	r	r	rw	rw	<u>r</u>	<u>1</u>	rw	W	w	w	w	w	w	w	W
RESET	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
NEOL1						0x0	0000									



1.8.6 Corrections to Section 14.4.12, "UART 2 Miscellaneous Register"

Bit 8 of this register is incorrectly represented as being reserved (page 14-26). It is the RTS2 TRIG bit. This correction affects the display of the UMISC2 register and Table 14-14.

In the display of the UMISC2 register, ignore the grey fill for bit 8. In the cell for the bit name abbreviation, insert RTS2 TRIG. In the TYPE row, insert rw. A corrected version of the register display follows, with the new information in red and underlined.

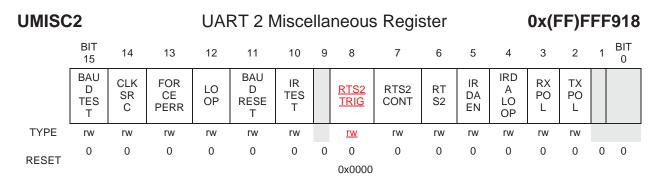

In Table 14-14, make the following changes:

- In the seventh row,
 - In the Name column, change the identification of the reserved bits from "Bits 9–8" to "Bit 9."
 - In the Setting column, change the text to "This bit is reserved and should be set to 0."
- Just after the seventh row, insert a new row that contains information for the RTS2 TRIG bit.
- In the eighth row for bit 7, in the Setting column, change the text to " $0 = \overline{\text{RTS2}}$ pin is controlled by the RTS2 bit. $1 = \overline{\text{RTS2}}$ pin is controlled by the receiver FIFO and RTS2 TRIG bit."

The following table excerpt displays the new and corrected information, which appears in red and is underlined.

Reserved <u>Bit 9</u>	Reserved	This bit is reserved and should be set to 0.
RTS2 TRIG Bit 8	RTS2 Trigger Source Select —This bit selects the control of the RTS2 pin when the RTS2 CONT bit (bit 7) is 1.	0 = RTS2 pin is asserted when the number of filled slots is equal to RxFIFO level marker. 1 = RTS2 pin is asserted when only one slot is available in the receiver FIFO.
RTS2 CONT Bit 7	RTS2 Control —This bit selects the function of the RTS2 pin.	0 = RTS2 pin is controlled by the RTS2 bit. 1 = RTS2 pin is controlled by the receiver FIFO <u>and RTS2 TRIG</u> <u>bit.</u>



1.8.7 Corrections to Table 14-15, "UART 2 Non-Integer Prescaler Register Description"

For the select field (bits 10–8), Table 14-15 incorrectly presents the Setting for the option 111 as "Disable the non-integer prescaler" (page 14-28). The correct Setting for this option is "Divide value is 1."

The following table excerpt displays the correct information, which appears in red and is underlined.

Name	Description	Setting
SELECT Bits 10–8	Tap Selection —This field selects a tap from the non-integer divider.	000 = Divide range is 2 to 3 127/128 in 1/128 steps. $001 = Divide range is 4 to 7 63/64 in 1/64 steps.$ $010 = Divide range is 8 to 15 31/32 in 1/32 steps.$ $011 = Divide range is 16 to 31 15/16 in 1/16 steps.$ $100 = Divide range is 32 to 63 7/8 in 1/8 steps.$ $101 = Divide range is 64 to 127 3/4 in 1/4 steps.$ $110 = Divide range is 128 to 255 1/2 in 1/2 steps.$ $111 = Divide value is 1.$

1.9 Corrections to Chapter 20, "Mechanical Data and Ordering Information"

Table 6 corrects information in Figure 20-1.

Table 6.	Correction to Figure 20-1
----------	----------------------------------

Error Location	Error	Correction
Figure 20-1, "MC68VZ328 TQFP Pin Assignments—Top View" (page 20-2)	Pin 73 is labeled as V_{SS} .	Pin 73 should be labeled as NC.

2 Additional Information

This section provides information that is not included in the MC68VZ328 Integrated Processor User's Manual or that supplements information in the manual.

2.1 System Power-up Time and HIZ Pin Design Consideration

The MC68VZ328 enters 68K test mode if the $\overline{\text{HIZ}}$ pin is toggled once when the reset signal is still asserted. In this mode, many MC68VZ328 signals become 68K core signals, and the default reset states of the I/O pins are overridden. Some pins could oscillate due to the 68K core running with the 32 kHz clock provided through the normal oscillator circuit input. To switch the MC68VZ328 back to normal mode, apply a normal reset with the $\overline{\text{HIZ}}$ pin staying high after the power up. Due to this consideration, take special care in designing the $\overline{\text{HIZ}}$ pin connection.



Another situation can produce the same result. If the system power-up sequence has a long intermediate voltage level below 1.8 V, the $\overline{\text{HIZ}}$ pin may have undetermined and toggling states when its voltage level is increased slowly with the power source due to internal pull-up resistors. This situation may wrongly instruct the MC68VZ328 to enter 68K test mode. The I/O pins will then become 68K core signals and oscillate. Unexpected noise may be generated before a valid reset is re-asserted after the system is fully powered up.

2.2 VCO Operation Frequency Range Consideration

The PLL design allows the VCO operation frequency range of 50 MHz to 80 MHz. For best PLL performance, the recommended range of operation is at 60 MHz to 70 MHz. Therefore, setting the nominal/default frequency at 66 MHz already covers the allowable drift introduced by process variation. Any change to PC or QC values in PLLFSR for other VCO frequencies is not recommended and may cause PLL stability issues or jitter.

2.3 Summaries of Differences Between Masks

The following subsections identify differences between various pairs of masks of the MC68VZ328.

2.3.1 Differences Between Masks 0K85C and 2K85C

Table 7 summarizes the differences between these two masks of the MC68VZ328.

Feature	Mask 0K85C	Mask 2K85C
Reset value of ID register (0xFFFFF004)	0x5601	0x5600
ICEM control bits	The ICEM control bits have a short circuit problem (see the <i>MC68VZ328</i> <i>Chip Errata</i> document). The SWEN bit in the ICE module control register (0xFFFFFD0C) is bit 5.	The problem is fixed. The SWEN bit in the ICE module control register (0xFFFFD0C) is bit 6.
DTACK pin output function		The DTACK pin output function is fixed. The DTACK can be programmed to out- put by setting bit 0 of the Port G direc- tion register (0xFFFF430) to 1.
Schmitt trigger hythesis of the RESET pin		The hythesis is enhanced.

Table 7. Differences Between MC68VZ328 Masks 0K85C and 2K85C¹

1. With regard to variations between masks, some information in the *MC68VZ328 Integrated Processor User's Manual*, rev. 0, is specific only to mask 2K85C.



2.3.2 Differences Between Masks 2K85C and 3K85C

Table 8 summarizes the differences between these two masks of the MC68VZ328.

Feature	Mask 2K85C	Mask 3K85C
Reset value of ID reg- ister (0xFFFF004)	0x5600	0x5601
SPI 1	There are problems with reading SPI 1 RXFIFO and writing to SPI 1 TXFIFO during data exchanges (see the <i>MC68VZ328</i> <i>Chip Errata</i> document).	These problems are fixed.
EMUCS function on PG4/EMUCS pin		The EMUCS function on the PG4/EMUCS pin is replaced by CSC0. The PB2/CSC0/RAS0 pin remains unchanged. It provides one more opening for CSC0. The CSC0 can function on the PG4/EMUCS pin even when the DRAM bit in chip-select register D is set. The memory map and function of CSC0 are still con- trolled by the registers related to chip-select C.

Table 8. Differences Between MC68VZ328 Masks 2K85C and 3K85C ¹	Table 8.	Differences Betweer	n MC68VZ328 Masks	2K85C and 3K85C ¹
---	----------	----------------------------	-------------------	------------------------------

1. With regard to variations between masks, some information in the MC68VZ328 Integrated Processor User's Manual, rev. 0, is specific only to mask 2K85C.

2.3.3 Differences Between Masks 3K85C and 4K85C

Table 9 summarizes the differences between these two masks of the MC68VZ328.

Table 9. Differences Between MC68VZ328 Masks 3K85C and 4K85C¹

Feature	Mask 3K85C	Mask 4K85C
Wafer fabrication process		The wafer fabrication process has been changed to standardize the trench etch thickness in MOS 13. No product function is affected.

1. With regard to variations between masks, some information in the MC68VZ328 Integrated Processor User's Manual, rev. 0, is specific only to mask 2K85C.

2.3.4 Differences Between Masks 4K85C and 5K85C

Table 10 on page 14 summarizes the differences between these two masks of the MC68VZ328.



Feature	Mask 4K85C	Mask 5K85C
Reset value of ID reg- ister (0xFFFF004)	0x5601	0x5700
SPI 1	SPI 1 transmits a wrong bit if a write occurs to SP1 TXFIFO during data exchanges (see the <i>MC68VZ328 Chip Errata</i> document).	This problem is fixed.
P/D function on PG3/ HIZ/P/D pin		The P/ \overline{D} function on the PG3/ \overline{HIZ} /P/ \overline{D} pin is replaced by $\overline{CSB1}$. ²

1. With regard to variations between masks, some information in the *MC68VZ328 Integrated Processor User's Manual*, rev. 0, is specific only to mask 2K85C.

2. To enable the CSB1 function, the Port G direction register's bit 3 should be set to 1, and the Port G select register's bit 3 should be set to 0.

2.4 External Pin Pull-down Consideration

When connecting an external pull-down resistor, users are cautioned to use a resistor with a maximum value of 15 kohm. This value ensures that a logic low level appears to the internal detection circuit.

Motorola reserves the right to make changes without further notice to any products herein. Motorola makes no warranty, representation or guarantee regarding the suitability of its products for any particular purpose, nor does Motorola assume any liability arising out of the application or use of any product or circuit, and specifically disclaims any and all liability, including without limitation consequential or incidental damages. "Typical" parameters which may be provided in Motorola data sheets and/or specifications can and do vary in different applications and actual performance may vary over time. All operating parameters, including "Typicals" must be validated for each customer application by customer's technical experts. Motorola does not convey any license under its patent rights nor the rights of others. Motorola products are not designed, intended, or authorized for use as components in systems intended for surgical implant into the body, or other applications intended to support life, or for any other application in which the failure of the Motorola product could create a situation where personal injury or death may occur. Should Buyer purchase or use Motorola products for any such unintended or unauthorized application, Buyer shall indemnify and hold Motorola and its officers, employees, subsidiaries, affiliates, and distributors harmless against all claims, costs, damages, and expenses, and reasonable attorney fees arising out of, directly or indirectly, any claim of personal injury or death associated with such unintended or unauthorized use, even if such claim alleges that Motorola was negligent regarding the design or manufacture of the part. Motorola, Inc. is an Equal Opportunity/Affirmative Action Employer. Motorola, the stylized (A) and all other trademarks indicated as such herein are registered trademarks of Motorola, Inc. ® Registered U.S. Pat. and Tm. Office. All other tradenames, trademarks, and registered trademarks are the property of their respective owners.

How to reach us:

USA/EUROPE/Locations Not Listed: Motorola Literature Distribution; P.O. Box 5405, Denver, Colorado, 80217. 1–303–675–2140 or 1–800–441–2447

JAPAN: Motorola Japan Ltd.; SPS, Technical Information Center, 3–20–1, Minami–Azabu, Minato–ku, Tokyo 106–8573 Japan. 81–3–3440–3569

ASIA/PACIFIC: Motorola Semiconductors H.K. Ltd., Silicon Harbour Centre, 2 Dai King Street, Tai Po Industrial Estate, Tai Po, N.T., Hong Kong. 852–26668334

Technical Information Center: 1–800–521–6274

HOME PAGE: http://www.motorola.com/semiconductors/

