

UG10257

MCUXpresso SDK Field-Oriented Control of 3-Phase PMSM and BLDC Motors (TWR-56F8200)

Rev. 1.0 — 3 July 2025

User guide

Document information

Information	Content
Keywords	TWR-56F8200 , PMSM, FOC, MCAT, MID, Motor control, Sensorless control, Speed control, Servo control, Position control
Abstract	This user guide describes the implementation of the motor-control software for 3-phase Permanent Magnet Synchronous Motors.



1 Introduction

SDK motor control example user guide describes the implementation of the motor-control software for 3-phase Permanent Magnet Synchronous Motors (PMSM) using following NXP platforms:

- TWR-56F8200

The document is divided into several parts. Hardware setup, processor features, and peripheral settings are described at the beginning of the document. The next part contains the PMSM project description and motor control peripheral initialization. The last part describes user interface and additional example features.

Available motor control examples types with supported motors, and possible control methods are listed in [Table 1](#).

Table 1. Available example type, supported motors and control methods

Example type	Supported motor	Possible control methods in SDK example				
		Scalar and Voltage	Current FOC (Torque)	Sensorless Speed FOC	Sensored Speed FOC	Sensored Position FOC
pmsm_snsless	Linux 45ZWN24-40	✓	✓	✓	N/A	N/A
	Teknic M-2311P	✓	✓	✓	N/A	N/A

SDK motor control example description:

- **pmsm_snsless** - pmsm example uses fraction arithmetic, the example contains sensorless Field Oriented Control (FOC). Default motor configuration is tuned for the Teknic M-2311P motor.

The SDK motor control example contains several additional features:

- **FreeMASTER** pmsm_frac.pmpx project provides a simple and user-friendly way for algorithm tuning, software control, debugging, and diagnostics.
- **MCAT** - Motor Control Application Tuning page based on the FreeMASTER runtime debugging tool.
- **MID** - Motor parameter identification.

The control software and the PMSM control theory, in general, are described in *Sensorless PMSM Field-Oriented Control (FOC)* (document [DRM148](#)).

2 Hardware setup

The following chapter describes the used hardware and the setup needed for proper example working

2.1 Linux motor

The Linux 45ZWN24-40 motor is a low-voltage 3-phase permanent-magnet motor with hall sensor used in PMSM applications. The motor parameters are listed bellow.

Table 2. Linux 45ZWN24-40 motor parameters

Characteristic	Symbol	Value	Units
Rated voltage	Vt	24	V
Rated speed	-	4000	RPM
Rated torque	T	0.0924	Nm
Rated power	P	40	W
Continuous current	Ics	2.34	A
Number of pole-pairs	pp	2	-

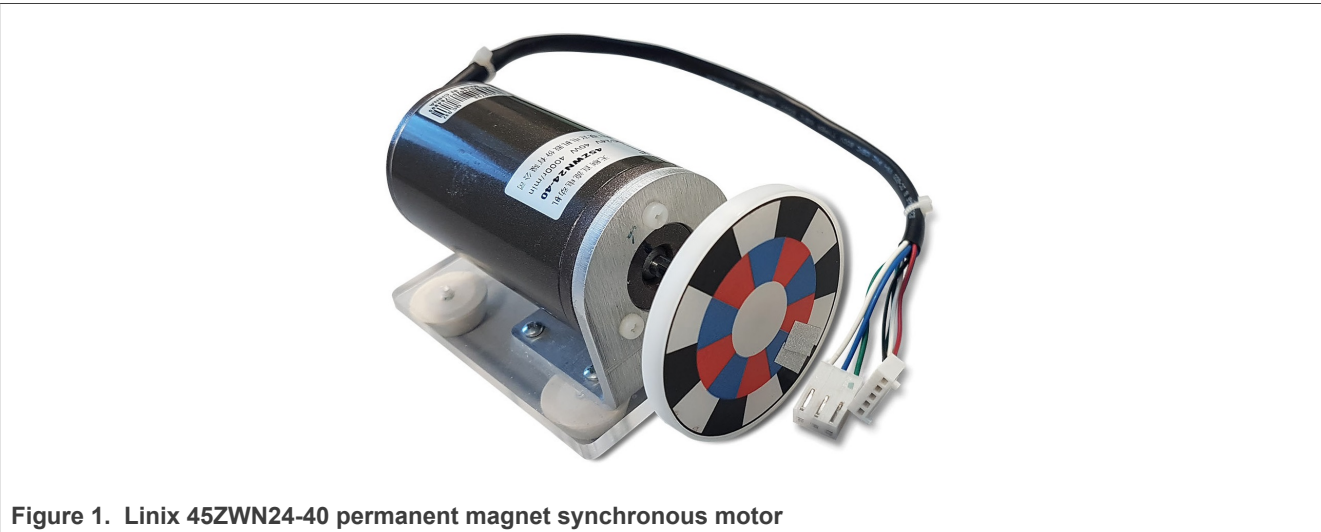


Figure 1. Linux 45ZWN24-40 permanent magnet synchronous motor


The motor has two types of connectors (cables). The first cable has three wires and is designated to power the motor. The second cable has five wires and is designated for the hall sensors' signal sensing. For the PMSM sensorless application, only the power input wires are needed.


2.2 TWR-MC-LV3PH

This evaluation board, in a Tower form factor, effectively turns a Tower development board into a complete motor control reference design, compatible with existing Tower DSC development boards. This board provides all necessary feedback signals for driving PMSM and BLDC motors.

The TWR-MC-LV3PH has power supply input voltage 12-24VDC, extended up to 50VDC with reverse polarity protection circuitry. Auxiliary power supply 5 and 3.3 VDC is created to provide power supply for Tower MCU boards. Output current is up to 5 amps RMS. The inverter itself is realized with 3-phase bridge inverter (6-MOSFET's) and 3-phase MOSFET gate driver. Analog quantities such as 3-phase motor currents, 3-phase motor back-EMF voltage, DC bus voltage and DC bus current are sensed on this board. There is an interface for speed/position sensors (Encoder Hall) and connector for braking resistor. There are also user LED,

power-on LED and 6 PWM LED diodes for diagnostics. The block diagram of complete Tower motor control development kit is in [Figure 2](#)

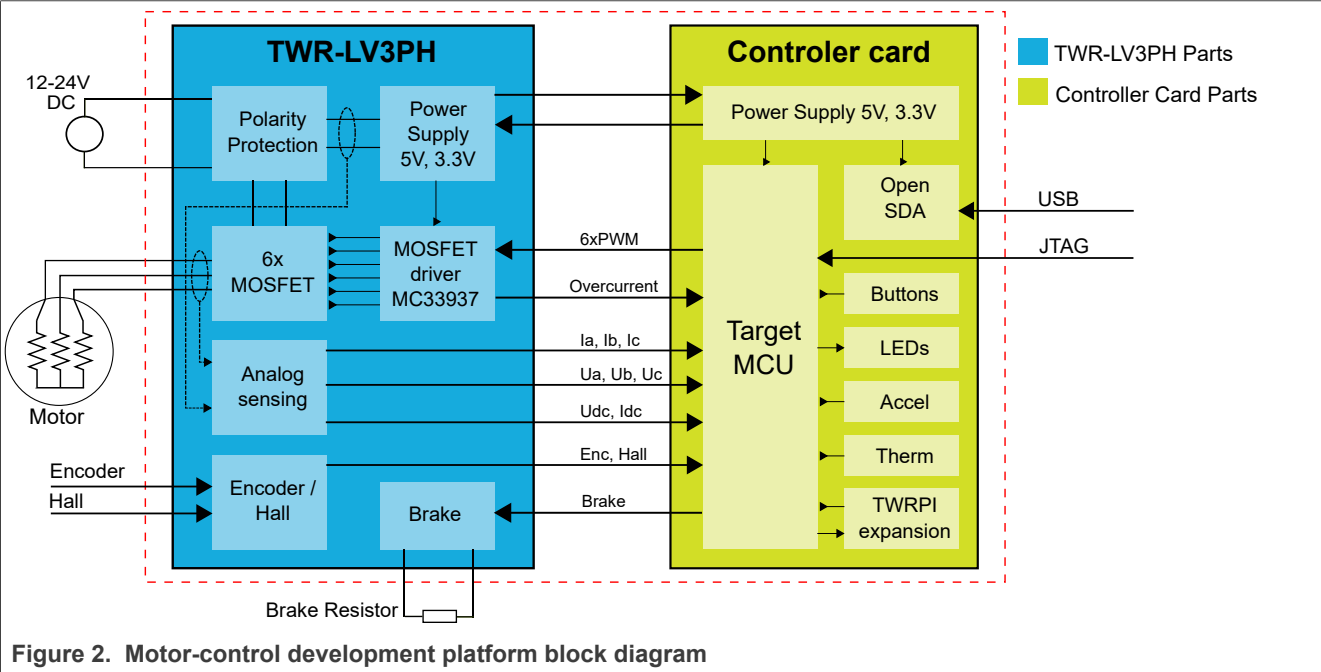

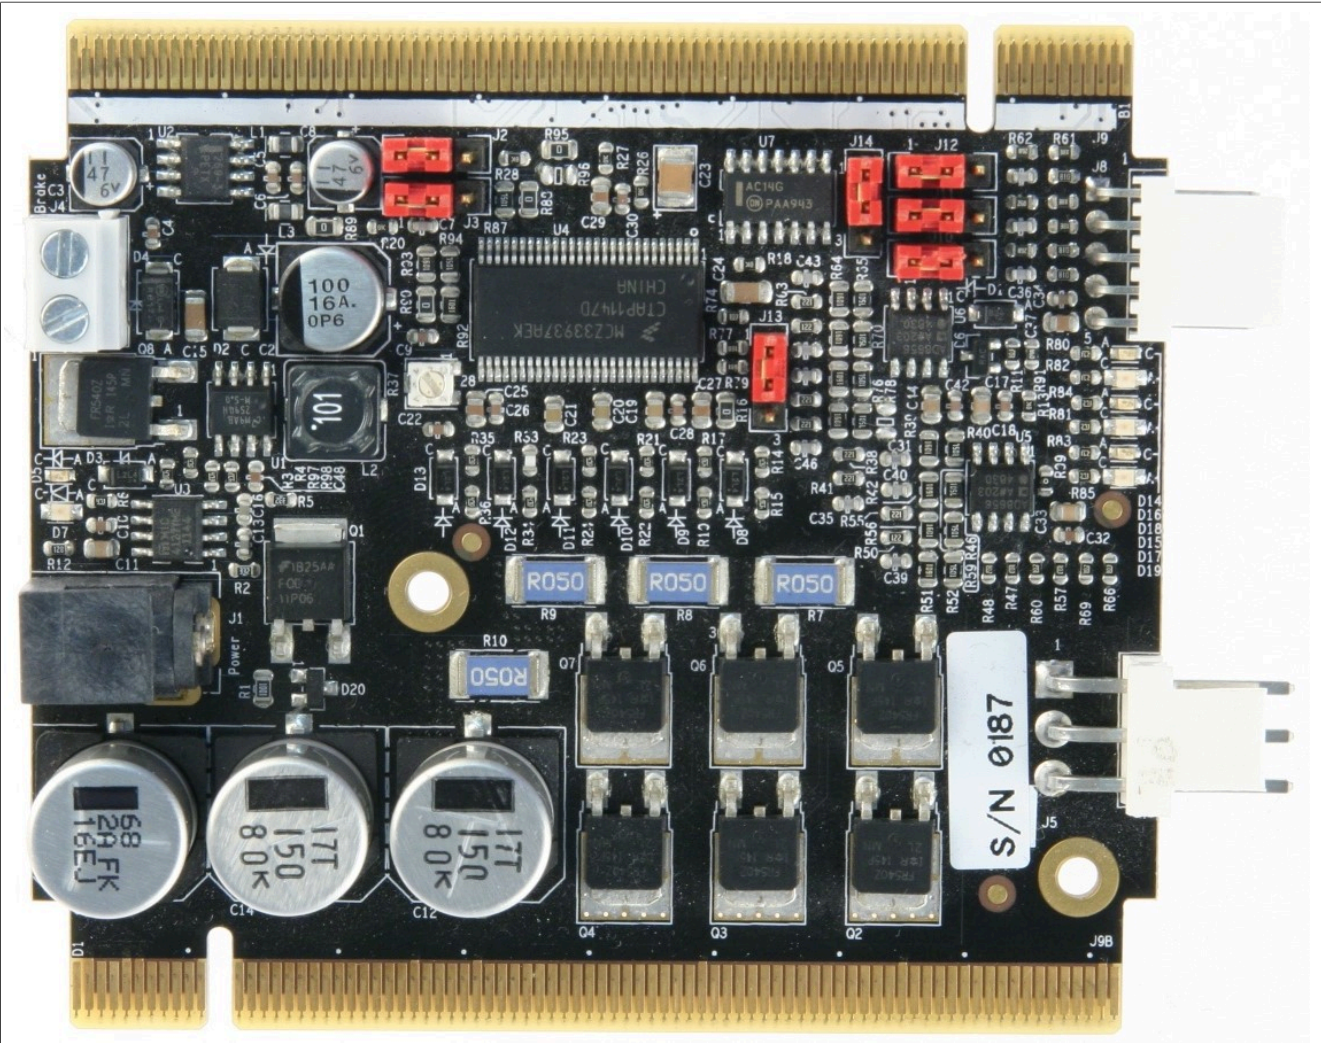

2.3 TWR-56F8200

The TWR-MC56F8200 development board is an ideal platform for evaluation and development with the MC56F82xxx MCU based on the 56800EX DSP architecture. The board includes the high-performance on-board debug probe. Configure the jumper settings according to [Table 4](#) for the motor-control application to work properly.

Table 4. TWR-56F8200 jumper settings

Jumper	Setting	Jumper	Setting	Jumper	Setting
J1	open	J9	3-4	J20	close
J2	open	J11	2-3	J21	1-2, 3-4, 5-6, 7-8
J4	2-3	J15	close	J23	open
J5	2-3	J16	1-2, 3-4		
J7	2-3	J17	open		
J8	3-4	J19	open		

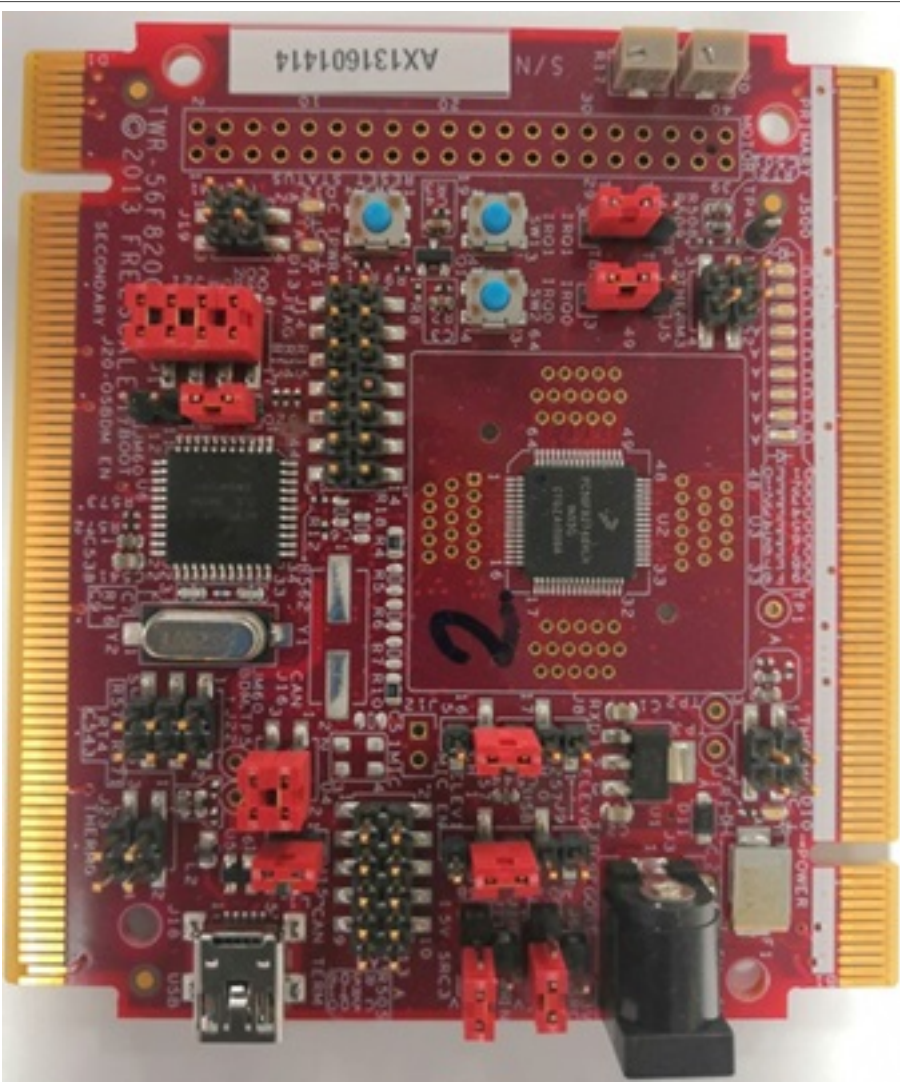


Figure 4. TWR-56F8200 with jumper settings

2.3.1 Hardware assembling

1. Plug the TWR-MC-LV3PH power stage to the TWR-56F8200 board.
2. Connect the 3-phase motor wires to the screw terminals (J5) on the TWR-MC-LV3PH power stage.
3. Plug the USB cable from the USB host to the USB connector (J18) on the TWR-MC56F8200 board.
4. Compile the project and program the TWR-56F8200 board prior to plugging 24V DC to TWR-MC-LV3PH.
Plugging 24V DC to a non-programmed board could cause a shoot through top and bottom transistors.
5. Plug the 24-V DC power supply to the DC power connector on the TWR-MC-LV3PH power stage (J1).


3 Processors features and peripheral settings

This chapter describes the peripheral settings and application timing.

3.1 MC56F82xxx


The MC56F82xxx DSP MCU family offers outstanding power consumption at runtime with exceptional performance, precision, and control. This high-efficiency family is based on the high-performance 56800EX DSP core with a frequency of up to 100 MHz. This family extends the DSC products' cost performance to the best.

The MC56F82xxx family offers extremely cost-effective solution for power conversion and motor control applications.

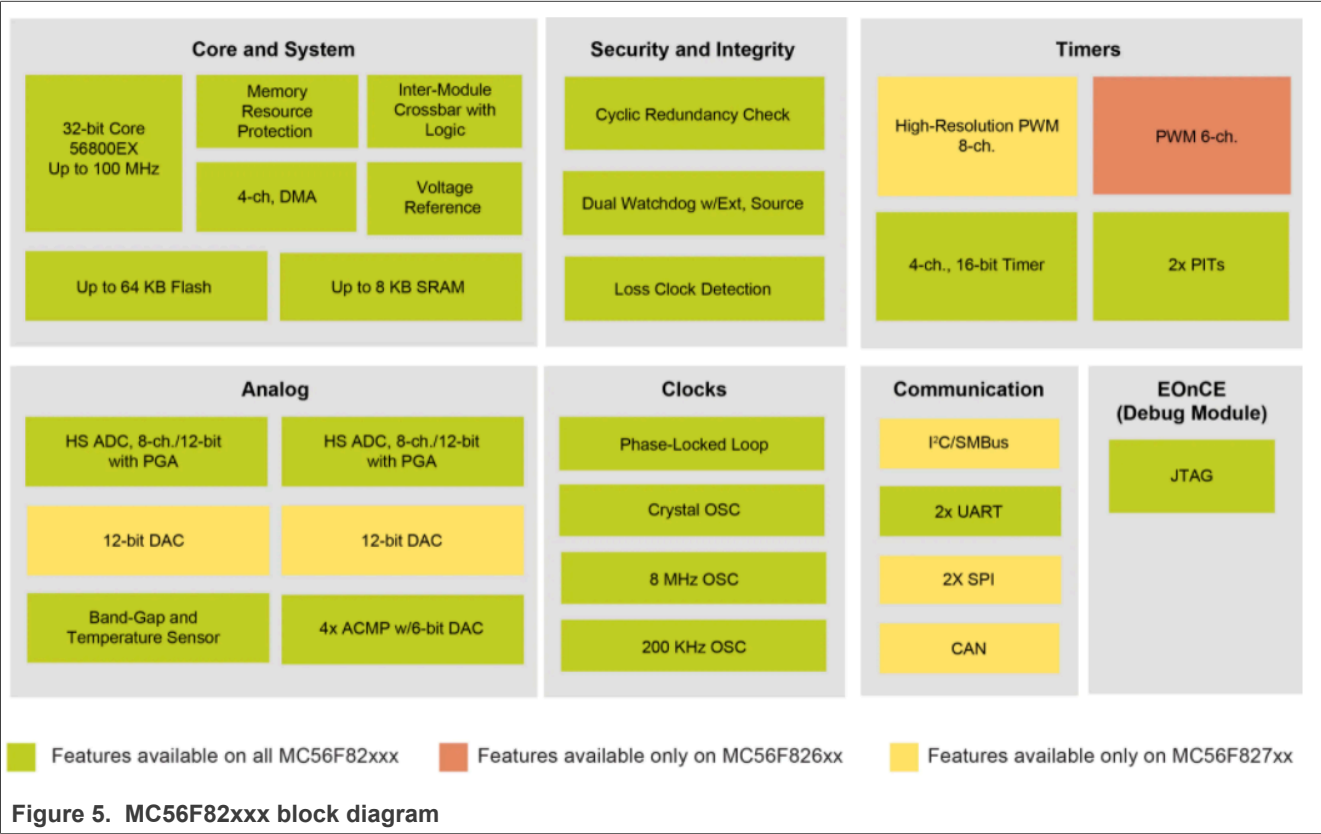

3.1.1 MC56F82748 hardware timing and synchronization

Correct and precise timing is crucial for motor-control applications. Therefore, the motor-control-dedicated peripherals take care of the timing and synchronization on the hardware layer. The PWM frequency is equal to the FOC calculation frequency. The timing diagram is shown in [Figure 6](#).

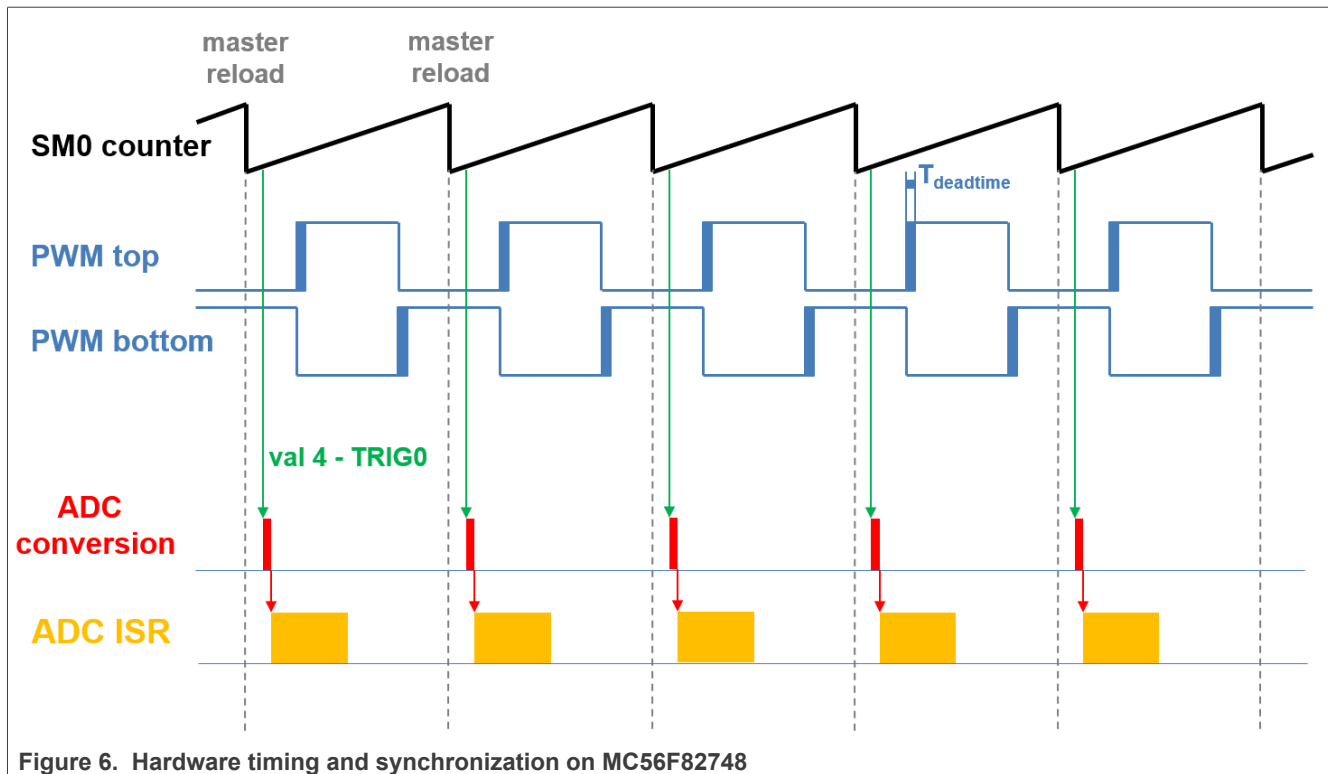

- The top signal shows the eFlexPWM SM0 counter. The dead time is emphasized at the PWM top and PWM bottom signals.
- The eFlexPWM SM0 also generates a trigger for the ADC with a short delay. This delay ensures correct current sampling at duty cycles close to 100 %.
- When the ADC conversion is completed, the ADC ISR (ADC interrupt) is entered. The FOC calculation is done in this interrupt.

3.1.2 MC56F82748 peripheral settings

All peripherals are configured using the MCUXpresso Config Tools. The MCUXpresso Config Tools set pins, clocks, and peripherals by generating corresponding sources (*pin_mux.c.h*, *clock_config.c.h*, *peripherals.c.h*, *Flash_config.h*, *freemaster_cfg.h*, and *startup_clock_mode_config.h*). On MC56F82748, the eFlexPWM is used for 6-channel PWM generation with DC bus over-current protection. The 12-bit cyclic ADC is used for the phase currents and DC-bus voltage measurement. The PIT Timer is used for slow interrupt generation. The peripheral description is well described and depicted in the MCUXpresso Config Tools after opening *mc_pmsm_sdm.mex* or *mc_pmsm_ldm.mex*. For more information about the MCUXpresso Config Tools, see [MCUXpresso Config Tools](#).

3.2 CPU load and memory usage

The following information applies to the application built using one of the following IDE: MCUXpresso IDE, IAR, Keil MDK or CodeWarrior. The memory usage is calculated from the *.map linker file, including FreeMASTER recorder buffer allocated in RAM. In the MCUXpresso IDE, the memory usage can be also seen after project build in the Console window. The table below shows the maximum CPU load of the supported examples. The CPU load is measured using the SYSTICK timer. The CPU load is dependent on the fast-loop (FOC calculation) and slow-loop (speed loop) frequencies. The total CPU load is calculated using the following equations:

$$CPU_{fast} = cycles_{fast} \frac{f_{fast}}{f_{CPU}} 100 \left[\% \right]$$

(1)

$$CPU_{slow} = cycles_{slow} \frac{f_{slow}}{f_{CPU}} 100 \left[\% \right]$$

(2)

$$CPU_{total} = CPU_{fast} + CPU_{slow} \left[\% \right]$$

(3)

Where:

- CPU_{fast} = the CPU load taken by the fast loop
- cycles_{fast} = the number of cycles consumed by the fast loop
- f_{fast} = the frequency of the fast-loop calculation
- f_{CPU} = CPU frequency
- CPU_{slow} = the CPU load taken by the slow loop
- cycles_{slow} = the number of cycles consumed by the slow loop
- f_{slow} = the frequency of the slow-loop calculation
- CPU_{total} = the total CPU load consumed by the motor control

Table 5. Maximum CPU load (fast loop)

	Maximum CPU load
CPU load	48.1 %

Table 6. Memory usage

	flash_ldm_lpm_release	flash_sdm_lpm_release
Flash memory	35 968 B	35 880 B
RAM memory	5 696 B	5 632 B

Note: Both configurations feature FreeMASTER recorder which consumes **1024 B** of RAM and can be eliminated in the final code. The stack that consumes the RAM is **2048 B** and it can be decreased in the final code. Several RTCESL functions are placed in RAM for speed optimization.

Note: Memory usage and maximum CPU load can differ depending on the used IDEs and settings.

4 SDK package project file and IDE workspace structure

All the necessary files are included in one package, which simplifies the distribution and decreases the size of the final package. The directory structure of this package is simple, easy to use, and organized logically. The folder structure used in the IDE differs from the structure of the PMSM package installation, but it uses the same files. The different organization is chosen due to better manipulation of folders and files in workplaces and the possibility of adding or removing files and directories. The `pack_motor_<board_name>` project includes all the available functions and routines. This project serves for development and testing purposes.

4.1 PMSM project structure

The directory tree of a cloned PMSM project is shown below.

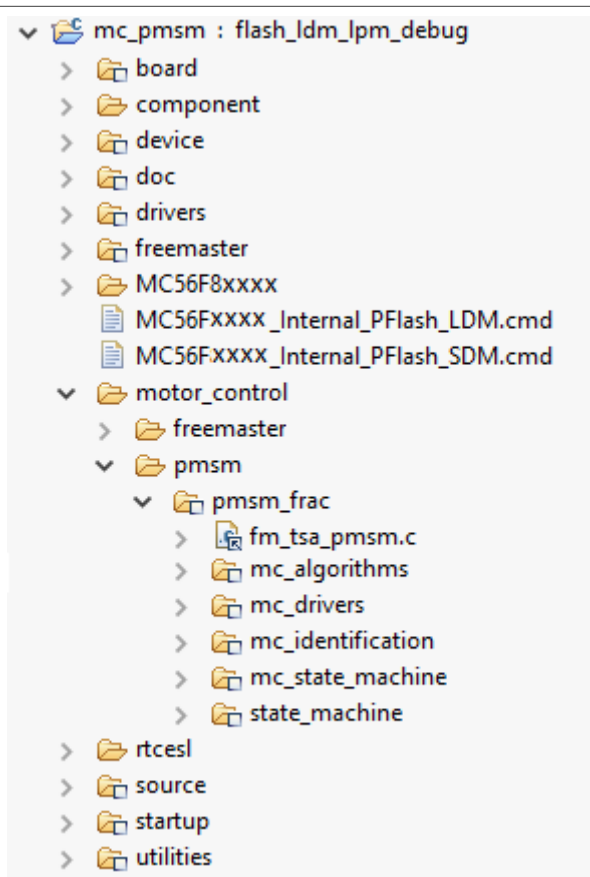


Figure 7. Directory tree

The main project folder contains the following folders and files:

- `.project` and `.cproject`—project files for CodeWarrior IDE.
- `board/board.c` and `.h`—contains the definitions and functions related to the board like LEDs and buttons.
- `board/clock_config.c` and `.h`—contains the MCU clock setup functions. These files are generated by the MCUXpresso Config Tools.
- `board/peripherals.c` and `.h`—contains the MCU peripherals' setup functions. These files are generated by the MCUXpresso Config Tools.
- `board/pin_mux.c` and `.h`—contains the MCU pins' setup functions. These files are generated by the MCUXpresso Config Tools.

- `device`—contains the MCU-related files like registers' definitions.
- `doc`—documentaion folder.
- `drivers`—contains the necessary SDK drivers for MCU peripherals.
- `freemaster`—contains the FreeMASTER embedded part of code.
- `motor_control/pmsm/pmsm_frac`—folder containing common motor control code
 - `mc_algorithms`—contains the main control algorithms used to control the FOC and speed control loop.
 - `mc_drivers`—contains the source and header files used to initialize and run motor-control applications.
 - `mc_identification`—contains the source code for the automated parameter-identification routines of the motor.
 - `mc_state_machine`—contains the software routines that are executed when the application is in a particular state or state transition.
 - `fm_tsa_pmsm.c`—TSA tables with variables used in FreeMASTER.
- `middleware/motor_control/freemaster`—contains the FreeMASTER *.pmpx file and all MCAT-related files.
- `rtcesl`—Real-Time Control Embedded Software Libraries with elementary algorithms used to build the FOC.
- `source/freemaster_cfg.h`—FreeMASTER configuration file containing FreeMASTER communication and features setup. This file is generated by the MCUXpresso Config Tools.
- `source/ml_pmsm_appconfig.h`—contains the definitions of constants for the application control processes, parameters of the motor and controllers, and the constants for other vector control-related algorithms. When you tailor the application for a different motor using the Motor Control Application Tuning (MCAT) tool, this file is re-generated at the end of the tuning process.
- `source/main.c`—basic application initialization (enabling interrupts), subroutines for accessing the MCU peripherals, and interrupt service routines. The FreeMASTER communication is performed in the background infinite loop.
- `source/mc_periph_init.c` and `.h`—contains the motor-control peripheral drivers' initialization functions and macros for changing ADC channels assigned to the phase currents and board voltage. These files are specific for the board and MCU used.

5 Github project structure

More informations for examples released through [NXP MCUXpresso Github](#) are available on link [MCUXpresso SKD Documentation](#).

6 Motor-control peripheral initialization

The motor-control peripherals are initialized by calling the `MCDRV_Init_M1()` function during MCU startup and before the peripherals are used. All initialization functions are in the `mc_periph_init.c` source file and the `mc_periph_init.h` header file. The definitions specified by the user are also in these files. The features provided by the functions are the 3-phase PWM generation and 3-phase current measurement, as well as the DC-bus voltage and auxiliary quantity measurement. The principles of both the 3-phase current measurement and the PWM generation using the Space Vector Modulation (SVM) technique are described in *Sensorless PMSM Field-Oriented Control* (document [DRM148](#)).

The `mc_periph_init.h` header file provides the following macros defined by the user:

- `M1_MCDRV_ADC_PERIPH_INIT`: this macro calls ADC peripheral initialization.
- `M1_MCDRV_PWM_PERIPH_INIT`: this macro calls PWM peripheral initialization.
- `M1_MCDRV_QD_ENC`: this macro calls QD peripheral initialization.
- `M1_PWM_FREQ`: the value of this definition sets the PWM frequency.
- `M1_FOC_FREQ_VS_PWM_FREQ`: enables you to call the fast-loop interrupt at every first, second, third, or n^{th} PWM reload. This is convenient when the PWM frequency must be higher than the maximal fast-loop interrupt.
- `M1_SPEED_LOOP_FREQ`: the value of this definition sets the speed loop frequency (TMR1 interrupt).
- `M1_PWM_DEADTIME`: the value of the PWM dead time in nanoseconds.
- `M1_PWM_PAIR_PH[A..C]`: these macros enable a simple assignment of the physical motor phases to the PWM periphery channels (or submodules). You can change the order of the motor phases this way.
- `M1_ADC[1,2]_PH[A..C]`: these macros assign the ADC channels for the phase current measurement. The general rule is that at least one-phase current must be measurable on both ADC converters, and the two remaining phase currents must be measurable on different ADC converters. The reason for this is that the selection of the phase current pair to measure depends on the current SVM sector. If this rule is broken, a preprocessor error is issued. For more information about the 3-phase current measurement, see *Sensorless PMSM Field-Oriented Control* (document [DRM148](#)).
- `M1_ADC[1,2]_UDCB`: this define is used to select the ADC channel for the measurement of the DC-bus voltage.

In the motor-control software, the following API-serving ADC and PWM peripherals are available:

- The available APIs for the ADC are:
 - `mcdrv_adc_t`: MCDRV ADC structure data type.
 - `void M1_MCDRV_ADC_PERIPH_INIT()`: this function is by default called during the ADC peripheral initialization procedure invoked by the `MCDRV_Init_M1()` function and should not be called again after the peripheral initialization is done.
 - `void M1_MCDRV_CURR_3PH_CHAN_ASSIGN(mcdrv_adc_t*)`: calling this function assigns proper ADC channels for the next 3-phase current measurement based on the SVM sector.
 - `void M1_MCDRV_CURR_3PH_CALIB_INIT(mcdrv_adc_t*)`: this function initializes the phase-current channel-offset measurement.
 - `void M1_MCDRV_CURR_3PH_CALIB(mcdrv_adc_t*)`: this function reads the current information from the unpowered phases of a stand-still motor and filters them using moving average filters. The goal is to obtain the value of the measurement offset. The length of the window for moving the average filters is set to eight samples by default.
 - `void M1_MCDRV_CURR_3PH_CALIB_SET(mcdrv_adc_t*)`: this function asserts the phase-current measurement offset values to the internal registers. Call this function after a sufficient number of `M1_MCDRV_CURR_3PH_CALIB()` calls.

- `void M1_MCDRV_CURR_3PH_VOLT_DCB_GET(mcdrv_adc_t*)`: this function reads and calculates the actual values of the 3-phase currents, DC-bus voltage, and auxiliary quantity.
- The available APIs for the PWM are:
 - `mcdrv_pwm3ph_t`: MCDRV PWM structure data type.
 - `void M1_MCDRV_PWM_PERIPH_INIT`: this function is by default called during the PWM peripheral initialization procedure invoked by the `MCDRV_Init_M1()` function.
 - `void M1_MCDRV_PWM3PH_SET(mcdrv_pwm3ph_t*)`: this function updates the PWM phase duty cycles.
 - `void M1_MCDRV_PWM3PH_EN(mcdrv_pwm3ph_t*)`: this function enables all PWM channels.
 - `void M1_MCDRV_PWM3PH_DIS(mcdrv_pwm3ph_t*)`: this function disables all PWM channels.
 - `bool_t M1_MCDRV_PWM3PH_FLT_GET(mcdrv_pwm3ph_t*)`: this function returns the state of the overcurrent fault flags and automatically clears the flags (if set). This function returns true when an overcurrent event occurs. Otherwise, it returns false.
- The available APIs for the quadrature encoder are:
 - `mcdrv_qd_enc_t`: MCDRV QD structure data type.
 - `void M1_MCDRV_ENC_PERIPH_INIT()`: this function is by default called during the QD peripheral initialization procedure invoked by the `MCDRV_Init_M1()` function.
 - `void M1_MCDRV_ENC_GET(mcdrv_qd_enc_t*)`: this function returns the actual position and speed.
 - `void M1_MCDRV_ENC_SET_DIRECTION(mcdrv_qd_enc_t*)`: this function sets the direction of the quadrature encoder.
 - `void M1_MCDRV_ENC_SET_PULSES(mcdrv_qd_enc_t*)`: this function sets the number of pulses of the quadrature encoder.
 - `void M1_MCDRV_ENC_CLEAR(mcdrv_qd_enc_t*)`: this function clears the internal variables and decoder counter.

Note: Not all macros are available for every motor control example type. The structure data types may vary across the platforms.

7 User interface

The application contains the demo mode to demonstrate motor rotation. You can operate it either using the user button, or using FreeMASTER. The NXP development boards include a user button associated with a port interrupt (generated whenever one of the buttons is pressed). At the beginning of the ISR, a simple logic executes and the interrupt flag clears. When you press the button, the demo mode starts. When you press the same button again, the application stops and transitions back to the STOP state.

The other way to interact with the demo mode is to use the FreeMASTER tool. The FreeMASTER application consists of two parts: the PC application used for variable visualization and the set of software drivers running in the embedded application. The serial interface transfers data between the PC and the embedded application. This interface is provided by the debugger included in the boards.

The application can be controlled using the following two interfaces:

- The user button on the development board (controlling the demo mode):
 - TWR-56F8200 - see `pin_mux.c/.h` which button is configured for this function.
- Remote control using FreeMASTER (Following chapter):
 - Setting a variable in the FreeMASTER Variable Watch. See chapter [Section 8.3](#)

Identify all motor parameters if you are using your own motor (different from the default motors). The automated parameter identification is described in the following sections.

8 Remote control using FreeMASTER

This section provides information about the tools and recommended procedures to control the sensor/sensorless PMSM Field-Oriented Control (FOC) application using FreeMASTER. The application contains the embedded-side driver of the FreeMASTER real-time debug monitor and data visualization tool for communication with the PC. It supports non-intrusive monitoring, as well as the modification of target variables in real time, which is very useful for the algorithm tuning. Besides the target-side driver, the FreeMASTER tool requires the installation of the PC application as well. You can download the latest version of FreeMASTER at www.nxp.com/freemaster. To run the FreeMASTER application including the MCAT tool, double-click the `pmsm_frac.pmpx` file located in the `middleware\motor_control\freemaster` folder. The FreeMASTER application starts and the environment is created automatically, as defined in the `*.pmpx` file.

Note: In MCUXpresso, the FreeMASTER application can run directly from IDE in `motor_control/freemaster` folder.

8.1 Establishing FreeMASTER communication

The remote operation is provided by FreeMASTER via the USB interface. To control a PMSM motor using FreeMASTER, perform the steps below:

1. Download the project from your chosen IDE to the MCU and run it.
2. Open the FreeMASTER project `pmsm_frac.pmpx`. The PMSM project uses the TSA by default, so it is not necessary to select a symbol file for FreeMASTER.
3. To establish the communication, click the communication button (the green "GO" button in the top left-hand corner).

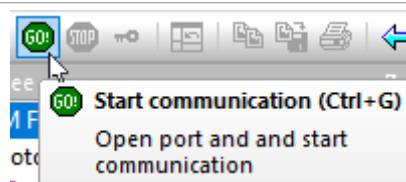


Figure 8. Green "GO" button placed in top left-hand corner

4. If the communication is established successfully, the FreeMASTER communication status in the bottom right-hand corner changes from "Not connected" to "RS-232 UART Communication; COMxx; speed=115200". Otherwise, the FreeMASTER warning pop-up window appears.

RS232 UART Communication; COM5; speed=115200

Figure 9. FreeMASTER—communication is established successfully

5. To reload the MCAT HTML page and check the App ID, press F5.
6. Control the PMSM motor by writing to a control variable in a variable watch.
7. If you rebuild and download the new code to the target, turn the FreeMASTER application off and on.

If the communication is not established successfully, perform the following steps:

1. Go to the **Project > Options > Comm** tab and make sure that the correct COM port is selected and the communication speed is set to 115200 bps.

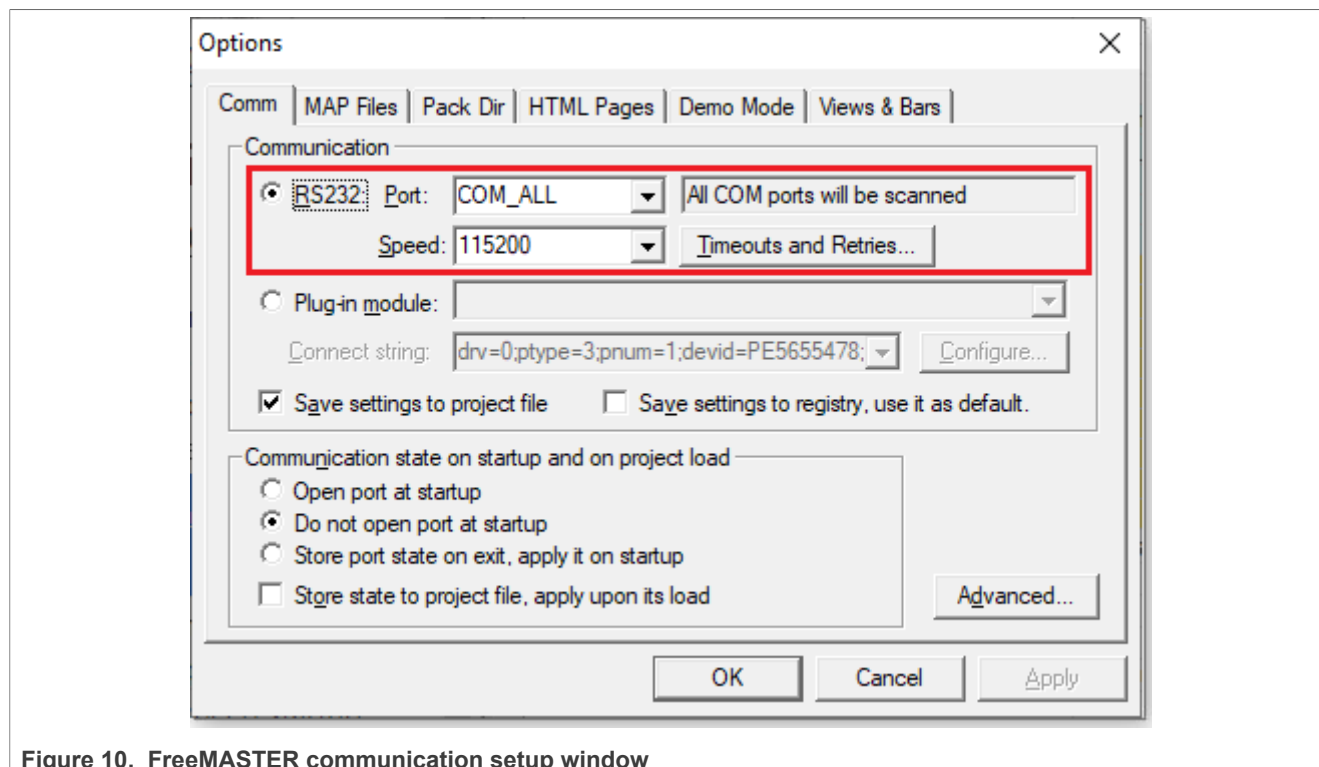


Figure 10. FreeMASTER communication setup window

2. Ensure, that your computer is communicating with the plugged board. Unplug and then plug in the USB cable and reopen the FreeMASTER project.

8.2 Motor Control Application Tuning interface (MCAT)

The PMSM sensor/sensorless FOC application can be easily controlled and tuned using the [Motor Control Application Tuning \(MCAT\) plug-in for PMSM](#). The MCAT for PMSM is a user-friendly page, which runs within the FreeMASTER. The tool consists of the tab menu and workspace as shown in [Figure 11](#). Each tab from the tab menu (4) represents one submodule which enables tuning or controlling different application aspects. Besides the MCAT page for PMSM, several scopes, recorders, and variables in the project tree (5) are predefined in the FreeMASTER project file to further the motor parameter tuning and debugging simplify.

When the FreeMASTER is not connected to the target, the "Board found" line (2) shows "Board ID not found". When the communication with the target MCU is established, the "Board found" line is read from Board ID variable watch and displayed. If the connection is established and the board ID is not shown, press F5 to reload the MCAT HTML page.

There are three action buttons in MCAT (3):

- **Load data** - MCAT input fields (for example, motor parameters) are loaded from `mX_pmsm_appconfig.h` file (JSON formatted comments). Only existing `mX_pmsm_appconfig.h` files can be selected for loading. Loaded `mX_pmsm_appconfig.h` file is displayed in grey field (7).
- **Save data** - MCAT input fields (JSON formatted comments) and output macros are saved to `mX_pmsm_appconfig.h` file. Up to 9 files (`m1-9_pmsm_appconfig.h`) can be selected. A pop-up window with the user motor ID and description appears when a different `mX_pmsm_appconfig.h` file is selected. The motor ID and description are also saved in `mX_pmsm_appconfig.h` as a JSON comment. The embedded code includes `m1_pmsm_appconfig.h` only at single motor control application. Therefore, saving to higher indexed `mX_pmsm_appconfig.h` files has no effect at the compilation stage.
- **Update target** - writes the MCAT calculated tuning parameters to FreeMASTER Variables, which effectively updates the values on target MCU. These tuning parameters are updated in MCU's RAM. To write these

tuning parameters to MCU's flash memory, `m1_pmsm_appconfig.h` must be saved, code recompiled, and downloaded to MCU.

Every time the communication with the board is established or MCAT is refreshed by pressing F5, MCAT looks for the `m1_pmsm_appconfig.h` file. A path to `m1_pmsm_appconfig` is relative to `*.pmpx` file. The path is composed from the fixed defined folders name and from the following FreeMASTER variables: *User Path 1*, *User Path 2*, *Board ID*, *Example ID*. Variables *User Path 1* and *User Path 2* are intended for user's custom path to the `m1_pmsm_appconfig.h`. These variables are defined in example's `main.c` file where user can modify them. There are several possible paths with different priority (higher to lower) and typical use case:

1. *User Path 1*/
2. *User Path 2*/
3. `../boards/Board ID/mc_pmsm/Example ID/`
 - typical use case during SDK example development
4. `../../../../boards/Board ID/demo_apps/mc_pmsm/Example ID/`
 - typical use case in the SDK package
5. `../../../../boards/Board ID/demo_apps/mc_pmsm/Example ID/cm7/`
 - typical use case in the SDK package
6. `../../../../boards/Board ID/demo_apps/mc_pmsm/Example ID/cm33_core0/`
 - typical use case in the SDK package
7. `../..source/`
 - typical use case in the workspace

When the `m1_pmsm_appconfig.h` is found in one of the above defined path, it is loaded into the MCAT. Then, MCAT uses this directory for further operations (Load data, Save data). When `m1_pmsm_appconfig.h` is not found even in one of the path above, the default `m1_pmsm_appconfig.h` is loaded. The default `m1_pmsm_appconfig.h` is located in the `mcats` folder. In case of default file is loaded to the MCAT, newly saved `mX_pmsm_appconfig.h` files will be placed next to the `*.pmpx` file.

Note: Since the path to `mX_pmsm_appconfig.h` is composed from *User Path 1*, *User Path 2*, *Board ID* and *Example ID*, FreeMASTER must be connected to the target, and FreeMASTER variables value read prior using Save/Load buttons.

Note: Only **Update target** button updates values on the target in real time. Load/Save buttons operate with `mX_pmsm_appconfig.h` file only.

Note: MCAT may require Internet connection. If no Internet connection is available, CSS and icons may not be loaded properly.

MCUXpresso SDK Field-Oriented Control of 3-Phase PMSM and BLDC Motors (TWR-56F8200)

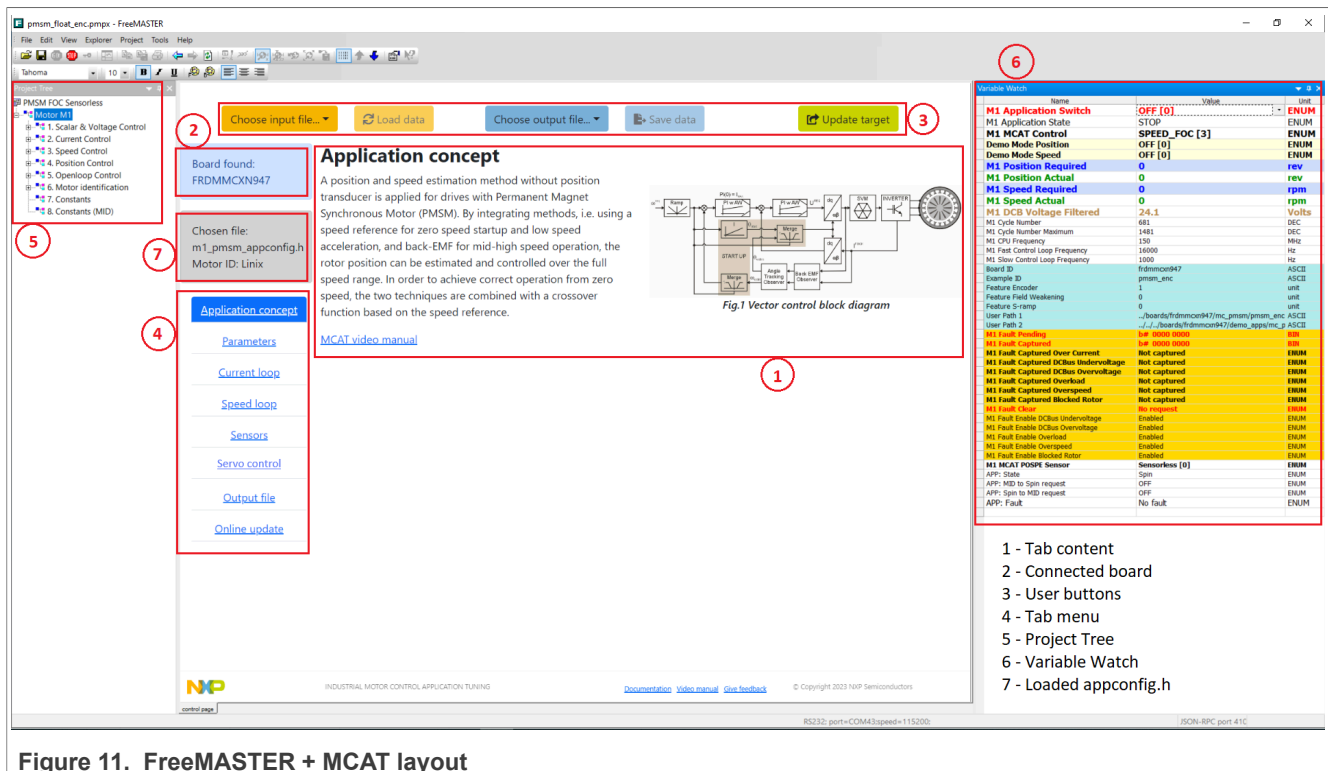


Figure 11. FreeMASTER + MCAT layout

In the default configuration, the following tabs (4) are available:

- **Application concept:** welcome page with the PMSM sensor/sensorless FOC diagram and a short application description.
- **Parameters:** this page enables you to modify the motor parameters, hardware and application scales specification, alignment, and fault limits.
- **Current loop:** current loop PI controller gains and output limits.
- **Speed loop:** this tab contains fields for the specification of the speed controller proportional and integral gains, as well as the output limits and parameters of the speed ramp. .
- **Servo control:** this tab contains fields for the specification of the position controller proportional gain, as well as the output limits.
- **Sensorless:** this page enables you to tune the parameters of the BEMF observer, tracking observer, and open-loop startup.
- **Output file:** this tab shows all the calculated constants that are required by the PMSM sensor/sensorless FOC application. It is also possible to generate the `mX_pmsm_appconfig.h` file, which is then used to preset all application parameters permanently at the project rebuild.
- **Online update :** this tab shows actual values of variables on target and new calculated values, which can be used to update the target variables.

Every subblock in FreeMASTER project tree (5) has defined several variables in variable watch (6).

The following sections provide simple instructions on how to identify the parameters of a connected PMSM motor and how to tune the application appropriately.

8.2.1 MCAT tabs description

This chapter describes MCAT input parameters and equations used to calculate MCAT output (generated) parameters. In the default configuration, the below described tabs are available. Some tabs may be missing

if not supported in the embedded code. There are general constants used at MCAT calculations listed in the following table:

Table 7. Constants used in equations

Constant	Value	Unit
UmaxCoeff	1.73205	-
DiscMethodFactor	2	-
IIRxCoefsScaleType	8	-
SPEED_IIR_filt	100	-

8.2.1.1 Application concept

This tab is a welcome page with the PMSM sensor/sensorless FOC diagram and a short description of the application.

8.2.1.2 Parameters

This tab enables modification of motor parameters, specification of hardware and application scales, alignment, and fault limits. All inputs are described in the following table. MCAT group and MCAT name help to locate the parameter in MCAT layout. Equation name represents the input parameter in equations below.

Table 8. Parameters tab inputs

MCAT group	MCAT name	Equation name	Description	Unit
Motor parameters	PP	parametersPP	Motor number of pole-pairs. Obtain from motor manufacturer or use the pole-pair assistant to determine and then fill manually.	-
	Rs	parametersRs	Stator phase resistance. Obtain from motor manufacturer or use the electrical parameters identification and then fill manually.	[Ω]
	Ld	parametersLd	Stator direct inductance. Obtain from motor manufacturer or use the electrical parameters identification and then fill manually.	[H]
	Lq	parametersLq	Stator quadrature inductance. Obtain from motor manufacturer or use the electrical parameters identification and then fill manually.	[H]
	Ke	parametersKe	Motor electrical constant. Obtain from motor manufacturer or use the Ke identification and then fill manually.	[V.sec/rad]
	J	parametersJ	Drive inertia (motor + plant). Use the mechanical identification and then fill manually.	[kg.m2]
	Iph nom	parametersIphNom	Nominal motor current. Obtain from motor manufacturer.	[A]

Table 8. Parameters tab inputs...continued

MCAT group	MCAT name	Equation name	Description	Unit
	Uph nom	parametersUphNom	Nominal motor voltage. Obtain from motor manufacturer.	[V]
	N nom	parametersNnom	Nominal motor speed. Obtain from motor manufacturer.	[rpm]
Hardware scales	I max	parametersImax	Current sensing HW scale. Keep as-is in case of standard NXP HW or recalculate according to own schematic.	[A]
	U DCB max	parametersUdcbMax	DCBus voltage sensing HW scale. Keep as-is in case of standard NXP HW or recalculate according to own schematic.	[V]
Fault limits	U DCB trip	parametersUdcbTrip	DCBus braking resistor threshold. Braking resistor's transistor is turned on when DCbus voltage exceeds this threshold.	[V]
	U DCB under	parametersUdcbUnder	DCBus under voltage fault threshold	[V]
	U DCB over	parametersUdcbOver	DCBus over voltage fault threshold	[V]
	N over	parametersNover	Over speed fault threshold	[rpm]
	N min	parametersNmin	Minimal closed loop speed. When the required speed ramps down under this threshold, the motor control state machine goes to freewheel state where top and bottom transistors are turned off and motor speeds down freely. Applies only for sensorless operation.	[rpm]
	E block	parametersEblock	Blocked rotor detection. When BEMF voltage drops under <i>E block</i> threshold for more than <i>E block per</i> (fast loop ticks), the blocked rotor fault is detected.	[V]
Application scales	E block per	parametersEblockPer		-
	N max	parametersNmax	Application speed scale. Keep about 10 % margin above <i>N over</i> .	[rpm]
	E max	parametersEmax	FOC BEMF Maximum Limit.	[V]
	kt	parametersKt	Torque Constant.	[Nm/A]
	U DCB IIR F0	parametersUdcbIIRf0	Cut-off frequency of DCBus IIR filter	[Hz]
	Calibration duration	parametersCalibDuration	ADC (phase current offset) calibration duration. Done every time transitioning from STOP to RUN.	[sec]

Table 8. Parameters tab inputs...continued

MCAT group	MCAT name	Equation name	Description	Unit
	Fault duration	parametersFaultDuration	After fault condition disappears, wait defined time to clear pending faults bitfield and transition to STOP state.	[sec]
	Freewheel duration	parametersFreewheelDuration	Free-wheel state duration. Freewheel state is entered when ramped speed drops under <i>N min</i> .	[sec]
	Scalar Uq min	parametersScalarUqMin	Scalar control voltage minimal value.	[V]
	Scalar V/Hz factor ratio	parametersScalarVHzRatio	Scalar V/Hz ratio gain.	[%]
Alignment	Align voltage	parametersAlignVoltage	Motor alignment voltage.	[V]
	Align duration	parametersAlignDuration	Motor alignment duration.	[sec]

Output equations

Applies for saving to `mX_pmsm_appconfig.h`. (Pressing the *Save data* button)

Does NOT apply for updating the corresponding FreeMASTER variable. (Pressing *Update target* button)

- $\text{sensorlessWmax} = (2 * \text{Math.PI} * \text{parametersPp} * \text{parametersNmax} / 60)$
- $\text{scalarVHzFactor} = \text{parametersUphNom} * \text{parametersScalarVHzRatio} / 100 / (\text{parametersNnom} * \text{parametersPp} * 2 * \text{Math.PI} / 60) * \text{sensorlessWmax} / \text{parametersUmax}$
- $\text{scalarVHzFactorShift} = \text{scalarVHzFactor} > 1 ? - \text{Math.ceil}(\text{Math.log}(\text{Math.abs}(1 / \text{scalarVHzFactor}))) / \text{Math.log}(2) - 1$
- $\text{M1_U_MAX}(\text{parametersUmax}) = \text{parametersUdcbMax} / \text{constants.UmaxCoeff}$
- $\text{M1_MOTOR_PP} = \text{parametersPP}$
- $\text{M1_I_PH_NOM} = \text{parametersIphNom} / \text{parametersImax}$
- $\text{M1_I_MAX} = \text{parametersImax}$
- $\text{M1_U_DCB_MAX} = \text{parametersUdcbMax}$
- $\text{M1_U_DCB_TRIP} = \text{parametersUdcbTrip} / \text{parametersUdcbMax}$
- $\text{M1_U_DCB_UNDERVOLTAGE} = \text{parametersUdcbUnder} / \text{parametersUdcbMax}$
- $\text{M1_U_DCB_OVERVOLTAGE} = \text{parametersUdcbOver} / \text{parametersUdcbMax}$
- $\text{M1_FREQ_MAX} = \text{parametersNmax} / 60 * \text{parametersPp}$
- $\text{M1_ALIGN_DURATION} = \text{parametersAlignDuration} / \text{currentLoopSampleTime}$
- $\text{M1_CALIB_DURATION} = \text{parametersCalibDuration} / \text{speedLoopSampleTime}$
- $\text{M1_FAULT_DURATION} = \text{parametersFaultDuration} / \text{speedLoopSampleTime}$
- $\text{M1_FREEWHEEL_DURATION} = \text{parametersFreewheelDuration} / \text{speedLoopSampleTime}$
- $\text{M1_E_MAX} = \text{parametersEmax}$
- $\text{M1_E_BLOCK_TRH} = \text{parametersEblock} / \text{parametersEmax}$
- $\text{M1_E_BLOCK_PER} = \text{parametersEblockPer}$
- $\text{M1_N_MIN} = \text{parametersNmin} / \text{parametersNmax}$
- $\text{M1_N_MAX} = \text{parametersNmax}$
- $\text{M1_N_NOM} = \text{parametersNnom} / \text{parametersNmax}$
- $\text{M1_N_OVERSPEED} = \text{parametersNover} / \text{parametersNmax}$
- $\text{M1_UDCB_IIR_B0} = 4 * ((2 * \text{Math.PI} * \text{parametersUdcbIIRf0} * \text{currentLoopSampleTime}) / (2 + (2 * \text{Math.PI} * \text{parametersUdcbIIRf0} * \text{currentLoopSampleTime}))) / \text{constants.IIRxCoefsScaleType}$

- $M1_UDCB_IIR_B1 = 4 * ((2 * \text{Math.PI} * \text{parametersUdcbIIRf0} * \text{currentLoopSampleTime}) / (2 + (2 * \text{Math.PI} * \text{parametersUdcbIIRf0} * \text{currentLoopSampleTime}))) / \text{constants.IIRxCoefsScaleType}$
- $M1_UDCB_IIR_A1 = 4 * (-(2 * \text{Math.PI} * \text{parametersUdcbIIRf0} * \text{currentLoopSampleTime} - 2) / (2 + (2 * \text{Math.PI} * \text{parametersUdcbIIRf0} * \text{currentLoopSampleTime}))) / \text{constants.IIRxCoefsScaleType}$
- $M1_SCALAR_UQ_MIN = \text{parametersScalarUqMin} / \text{parametersUmax}$
- $M1_ALIGN_VOLTAGE = \text{parametersAlignVoltage} / \text{parametersUmax}$
- $M1_SCALAR_VHZ_FACTOR_GAIN = \text{scalarVHzFactor} * \text{Math.pow}(2, -\text{scalarVHzFactorShift})$
- $M1_SCALAR_VHZ_FACTOR_SHIFT = \text{scalarVHzFactor}$
- $M1_SCALAR_INTEG_GAIN = 2 * \text{Math.PI} * \text{parametersPp} * \text{parametersNmax} / 60 * \text{currentLoopSampleTime} / \text{Math.PI}$
- $M1_SCALAR_RAMP_UP = \text{speedLoopRampUp} / 60 * \text{parametersPp} * 2 * \text{Math.PI} / \text{sensorlessWmax} * \text{currentLoopSampleTime}$
- $M1_SCALAR_RAMP_DOWN = \text{speedLoopRampDown} / 60 * \text{parametersPp} * 2 * \text{Math.PI} / \text{sensorlessWmax} * \text{currentLoopSampleTime}$

8.2.1.3 Current loop

This tab enables current loop PI controller gains and output limits tuning. All inputs are described in the following table. MCAT group and MCAT name help to locate the parameter in MCAT layout. Equation name represents the input parameter in equations below.

Table 9. Current loop tab input

MCAT group	MCAT name	Equation name	Description	Unit
Loop parameters	Sample time	currentLoopSampleTime	Fast control loop period. This disabled value is read from target via FreeMASTER because application timing is set in embedded code by peripherals setting. This value is accessible only if target is not connected and value cannot be obtained from target.	[sec]
	F0	currentLoopF0	Current controller's bandwidth	[Hz]
	ξ	currentLoopKsi	Current controller's attenuation	-
Current PI controller limits	Output limit	currentLoopOutputLimit	Current controllers' output voltage limit = Duty cycle limit. Be careful setting this limit above 95 % because it affects current sensing (Some minimal bottom transistors on time is required).	[%]

Output equations (applies for saving to `mX_pmsm_appconfig.h` and also for updating a corresponding FreeMASTER variable):

- $M1_CLOOP_LIMIT = \text{currentLoopOutputLimit} / 100$
- $M1_D_KP_GAIN = ((2 * \text{currentLoopKsi} * 2 * \text{Math.PI} * \text{currentLoopF0} * \text{parametersLd}) - \text{parametersRs}) * \text{parametersImax} / \text{parametersUmax}$
- $M1_D_KI_GAIN = ((\text{Math.pow}((2 * \text{Math.PI} * \text{currentLoopF0}), 2) * \text{parametersLd}) * \text{currentLoopSampleTime} / \text{constants.DiscMethodFactor}) * \text{parametersImax} / \text{parametersUmax}$
- $M1_Q_KP_GAIN = ((2 * \text{currentLoopKsi} * 2 * \text{Math.PI} * \text{currentLoopF0} * \text{parametersLq}) - \text{parametersRs}) * \text{parametersImax} / \text{parametersUmax}$

MCUXpresso SDK Field-Oriented Control of 3-Phase PMSM and BLDC Motors (TWR-56F8200)

- $M1_Q_KI_GAIN = ((\text{Math.pow}((2 * \text{Math.PI} * \text{currentLoopF0}), 2) * \text{parametersLq}) * \text{currentLoopSampleTime} / \text{constants.DiscMethodFactor}) * \text{parametersI}_{\text{max}} / \text{parametersU}_{\text{max}}$

8.2.1.4 Speed loop

This tab enables speed loop PI controller gains and output limits tuning, required speed ramp parameters, feedback speed filter tuning, and position P controller gain tuning (available at sensed/encoder applications only). MCAT group and MCAT name help to locate the parameter in MCAT layout. Equation name represents the input parameter in equations below.

Table 10. Speed loop tab input

MCAT group	MCAT name	Equation name	Description	Unit
Loop parameters	Sample time	speedLoopSampleTime	Slow control loop period. This disabled value is read from target via FreeMASTER because application timing is set in embedded code by peripherals setting. This value is accessible only if target is not connected and value cannot be obtained from target.	[sec]
	F0	speedLoopF0	Speed controller's bandwidth	[Hz]
	ξ	speedLoopKsi	Speed controller's attenuation	-
Speed ramp	Inc up	speedLoopIncUp	Required speed maximal acceleration	[rpm/sec]
	Inc down	speedLoopIncDown	Required speed maximal acceleration	[rpm/sec]
Actual speed filter	Cut-off freq	speedLoopCutOffFreq	Speed feedback (before entering PI subtraction) filter bandwidth.	[Hz]
Speed PI controller limits	Upper limit	speedLoopUpperLimit	Maximal required Q-axis current (Speed controller's output). Q-axis current limitation equals to motor torque limitation.	[A]
	Lower limit	speedLoopLowerLimit	Minimal required Q-axis current (Speed controller's output). Q-axis current limitation equals to motor torque limitation.	[A]

Output equations (applies for saving to `mX_pmsm_appconfig.h` and also for updating a corresponding FreeMASTER variable):

- $M1_SPEED_PI_PROP_GAIN = 2 * \text{speedLoopKsi} * 2 * \text{Math.PI} * \text{Math.round}(\text{speedLoopF0}) * \text{parametersJ} / \text{parametersKt} * (\text{sensorlessW}_{\text{max}} / \text{parametersI}_{\text{max}})$
- $M1_SPEED_PI_INTEG_GAIN = ((\text{Math.pow}((2 * \text{Math.PI} * \text{speedLoopF0}), 2) * \text{parametersJ}) / \text{parametersKt} * \text{speedLoopSampleTime}) * (\text{sensorlessW}_{\text{max}} / \text{parametersI}_{\text{max}})$
- $M1_SPEED_LOOP_HIGH_LIMIT = \text{speedLoopUpperLimit} / \text{parametersI}_{\text{max}}$
- $M1_SPEED_LOOP_LOW_LIMIT = \text{speedLoopLowerLimit} / \text{parametersI}_{\text{max}}$
- $M1_SPEED_RAMP_UP = (\text{speedLoopIncUp} / 60 * \text{parametersPp} * 2 * \text{Math.PI} / \text{sensorlessW}_{\text{max}} * \text{speedLoopSampleTime})$
- $M1_SPEED_RAMP_DOWN = (\text{speedLoopIncDown} / 60 * \text{parametersPp} * 2 * \text{Math.PI} / \text{sensorlessW}_{\text{max}} * \text{speedLoopSampleTime})$

- $M1_SPEED_IIR_B0 = 4 * ((2 * \text{Math.PI} * \text{speedLoopCutOffFreq} * \text{speedLoopSampleTime}) / (2 + (2 * \text{Math.PI} * \text{speedLoopCutOffFreq} * \text{speedLoopSampleTime}))) / IIRxCoefsScaleType$
- $M1_SPEED_IIR_B1 = 4 * ((2 * \text{Math.PI} * \text{speedLoopCutOffFreq} * \text{speedLoopSampleTime}) / (2 + (2 * \text{Math.PI} * \text{speedLoopCutOffFreq} * \text{speedLoopSampleTime}))) / IIRxCoefsScaleType$
- $M1_SPEED_IIR_A1 = 4 * (-(2 * \text{Math.PI} * \text{speedLoopCutOffFreq} * \text{speedLoopSampleTime} - 2) / (2 + (2 * \text{Math.PI} * \text{speedLoopCutOffFreq} * \text{speedLoopSampleTime}))) / IIRxCoefsScaleType$

8.2.1.5 Sensorless

This tab enables BEMF observer and Tracking observer parameters tuning and open-loop startup tuning. MCAT group and MCAT name help to locate the parameter in MCAT layout. Equation name represents the input parameter in equations below.

Table 11. Sensorless tab input

MCAT group	MCAT name	Equation name	Description	Unit
BEMF observer parameters	F0	sensorlessBemfObsrvF0	BEMF observer bandwidth	[Hz]
	ξ	sensorlessBemfObsrvKsi	BEMF observer attenuation	-
Tracking observer parameters	F0	sensorlessTrackObsrvF0	Tracking observer bandwidth	[Hz]
	ξ	sensorlessTrackObsrvKsi	Tracking observer attenuation	-
TO IRR speed filter	Cut-off freq	sensorlessTrackObsrvIIRSpeedCutOff	Tracking observer IIR speed filter cut-off frequency.	[Hz]
Open loop startup parameters	Startup ramp	sensorlessStartupRamp	Open loop startup ramp	[rpm/sec]
	Startup current	sensorlessStartupCurrent	Open loop startup current	[A]
	Merging Speed	sensorlessMergingSpeed	Merging speed	[rpm]
	Merging Coefficient	sensorlessMergingCoeff	Merging coefficient (100 % = merging is done within one electrical revolution)	[%]

Output equations (applies for saving to `mX_pmsm_appconfig.h` and also for updating a corresponding FreeMASTER variable):

- $\text{sensorlessToKp} = (2 * \text{sensorlessTrackObsrvKsi} * 2 * \text{Math.PI} * \text{sensorlessF0}) * (1 / \text{sensorlessWmax})$
- $\text{sensorlessToKi} = ((\text{Math.pow}(2 * \text{Math.PI} * \text{sensorlessTrackObsrvF0}, 2)) * \text{currentLoopSampleTime}) * (1 / \text{sensorlessWmax})$
- $\text{sensorlessTheta} = \text{currentLoopSampleTime} * \text{sensorlessWmax} / \text{Math.PI}$
- $M1_I_SCALE = (\text{parametersLd} / (\text{parametersLd} + \text{currentLoopSampleTime} * \text{parametersRs}))$
- $M1_U_SCALE = (\text{currentLoopSampleTime} / (\text{parametersLd} + \text{currentLoopSampleTime} * \text{parametersRs})) * (\text{parametersUmax} / \text{parametersImax})$
- $M1_E_SCALE = (\text{currentLoopSampleTime} / (\text{parametersLd} + \text{currentLoopSampleTime} * \text{parametersRs})) * (\text{parametersEmax} / \text{parametersImax})$
- $M1_WI_SCALE = (\text{parametersLq} * \text{currentLoopSampleTime} / (\text{parametersLd} + \text{currentLoopSampleTime} * \text{parametersRs})) * \text{sensorlessWmax}$
- $M1_BEMF_DQ_KP_GAIN = (2 * \text{sensorlessBemfObsrvKsi} * 2 * \text{Math.PI} * \text{sensorlessBemfObsrvF0} * \text{parametersLd} - \text{parametersRs}) * (\text{parametersImax} / \text{parametersEmax})$
- $M1_BEMF_DQ_KI_GAIN = ((\text{parametersLd} * \text{Math.pow}(2 * \text{Math.PI} * \text{sensorlessBemfObsrvF0}, 2)) * \text{currentLoopSampleTime}) * (\text{parametersImax} / \text{parametersEmax})$
- $M1_TO_KP_SHIFT(\text{sensorlessToKpShift}) = \text{Math.ceil}(\text{Math.log}(\text{Math.abs}(\text{sensorlessToKp})) / \text{Math.log}(2))$
- $M1_TO_KP_GAIN = \text{sensorlessToKp} * \text{Math.pow}(2, -\text{sensorlessToKpShift})$

- $M1_TO_KI_SHIFT(sensorlessToKiShift) = \text{Math.ceil}(\text{Math.log}(\text{Math.abs}(sensorlessToKi)) / \text{Math.log}(2))$
- $M1_TO_KI_GAIN = sensorlessToKi * \text{Math.pow}(2, -sensorlessToKiShift)$
- $M1_TO_THETA_SHIFT(sensorlessThetaShift) = \text{Math.ceil}(\text{Math.log}(\text{Math.abs}(sensorlessTheta)) / \text{Math.log}(2))$
- $M1_TO_THETA_GAIN = sensorlessTheta * \text{Math.pow}(2, -sensorlessThetaShift)$
- $M1_OL_START_RAMP_INC = (sensorlessStartupRamp / 60 * parametersPp * 2 * \text{Math.PI} / sensorlessWmax * currentLoopSampleTime)$
- $M1_MERC_SPEED_TRH = sensorlessMergingSpeed / parametersNmax$
- $M1_MERC_COEFF = ((sensorlessMergingCoeff / 100) * sensorlessMergingSpeed * parametersPp * currentLoopSampleTime) / 60$
- $x = 2 * \text{Math.PI} * sensorlessTrackObsrvIIRSpeedCutOff * currentLoopSampleTime$
- $M1_TO_SPEED_IIR_B0 = 4 * (x / (2 + x)) / constants.IIRxCoefsScaleType$
- $M1_TO_SPEED_IIR_B1 = 4 * ((2 * \text{Math.PI} * sensorlessTrackObsrvIIRSpeedCutOff * currentLoopSampleTime) / (2 + (2 * \text{Math.PI} * sensorlessTrackObsrvIIRSpeedCutOff * currentLoopSampleTime)))) / constants.IIRxCoefsScaleType$
- $M1_TO_SPEED_IIR_A1 = 4 * (-(2 * \text{Math.PI} * sensorlessTrackObsrvIIRSpeedCutOff * currentLoopSampleTime - 2) / (2 + (2 * \text{Math.PI} * sensorlessTrackObsrvIIRSpeedCutOff * currentLoopSampleTime)))) / constants.IIRxCoefsScaleType$
- $M1_OL_START_I = sensorlessStartupCurrent / parametersImax$

8.3 Motor Control Modes - How to run motor

In the "Project Tree", you can choose between the scalar and FOC control using the appropriate FreeMASTER tabs. The FreeMASTER variables can control the application, corresponding to the control structure selected in the FreeMASTER project tree. This is useful for application tuning and debugging. The required control structure must be selected in the "M1 MCAT Control" variable. To turn on or off the application, use "M1 Application Switch" variable. Set/clear "M1 Application Switch" variable also enables/disables all PWM channels.

Before motor starts, several conditions have to be completed:

1. Connected power supply to the inverter with the correct voltage value.
2. No pending fault. Check variable "M1 Fault Pending" in "Motor M1" project tree subblock. If there is some value, first remove the cause of the fault, or disable fault checking. (for example in variable "M1 Fault Enable Blocked Rotor")

8.3.1 Scalar control

The scalar control diagram is shown in figure below. It is the simplest type of motor-control techniques. The ratio between the magnitude of the stator voltage and the frequency must be kept at the nominal value. Therefore, the control method is sometimes called Volt per Hertz (or V/Hz). The position estimation BEMF observer and tracking observer algorithms run in the background, even if the estimated position information is not directly used. This is useful for the BEMF observer tuning. For more information, see the *Sensorless PMSM Field-Oriented Control* (document [DRM148](#)).

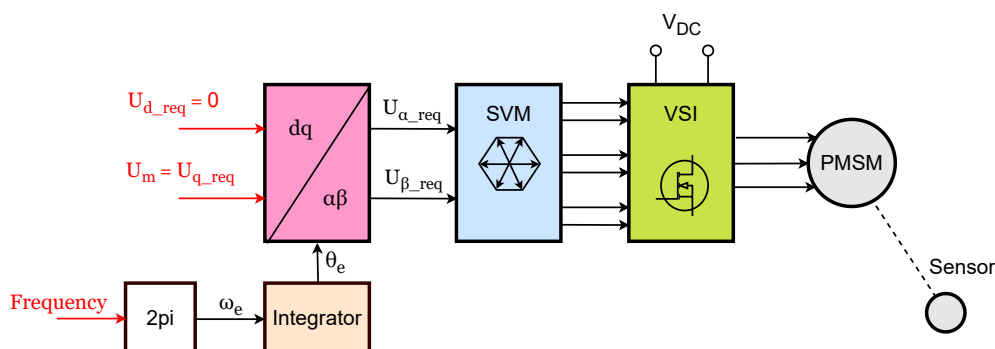


Figure 12. Scalar control mode

For run motor in scalar control, follow these steps:

1. Switch project tree subblock on "Scalar & Voltage Control".
2. Switch variable "M1 MCAT Control" on "SCALAR_CONTROL".
3. In variable "M1 Scalar Freq Required" set required frequency. (i.e. 20Hz)
4. Set variable "M1 Application Switch" to "1". Motor start spinning.
5. Observe motor speed, position, phase currents and other graphs predefined in subblock scopes and recorders.

8.3.2 Open loop control mode

Open loop mode (its diagram is shown in figure below) is similar in function to the Scalar control mode. However, it provides more flexibility in specifying required parameters. This mode allows you to set specific angle and frequency, according to the following equation:

$$\theta_{el} = \theta_{init} + \int_{t_0}^t 2\pi f dt \quad (4)$$

Besides setting voltage in DQ axis, when using this mode you can also enable current controllers and specify required currents in D and Q axis. Therefore, this function can be utilized for current controller parameter tuning. Please, bear in mind that current controllers cannot be enabled/disabled in SPIN state (user must turn the Application Switch OFF before enabling/disabling current controllers).


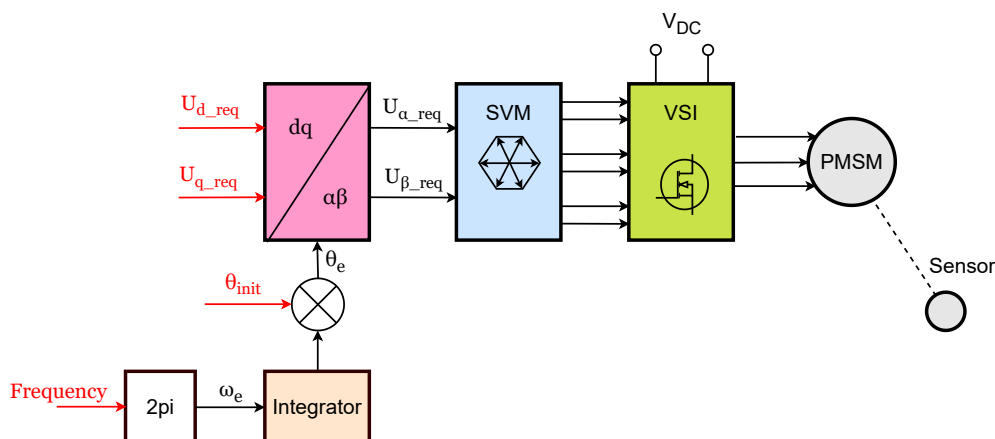


Figure 13. Voltage - Open loop control

For run motor in Voltage - Open loop control, follow these steps:

1. Switch project tree subblock on "Openloop Control".
2. Switch variable "M1 MCAT Control" on "OPEN_LOOP".
3. In variable "M1 Openloop Required Ud" and "M1 Openloop Required Uq" set required values.
4. In variable "M1 Openloop Theta Electrical" set required initial position.
5. In variable "M1 Openloop Required Frequency Electrical" set required frequency.
6. Set variable "M1 Application Switch" to "1". Motor start spinning.
7. Observe motor speed, position, phase currents and other graphs predefined in subblock scopes and recorders.

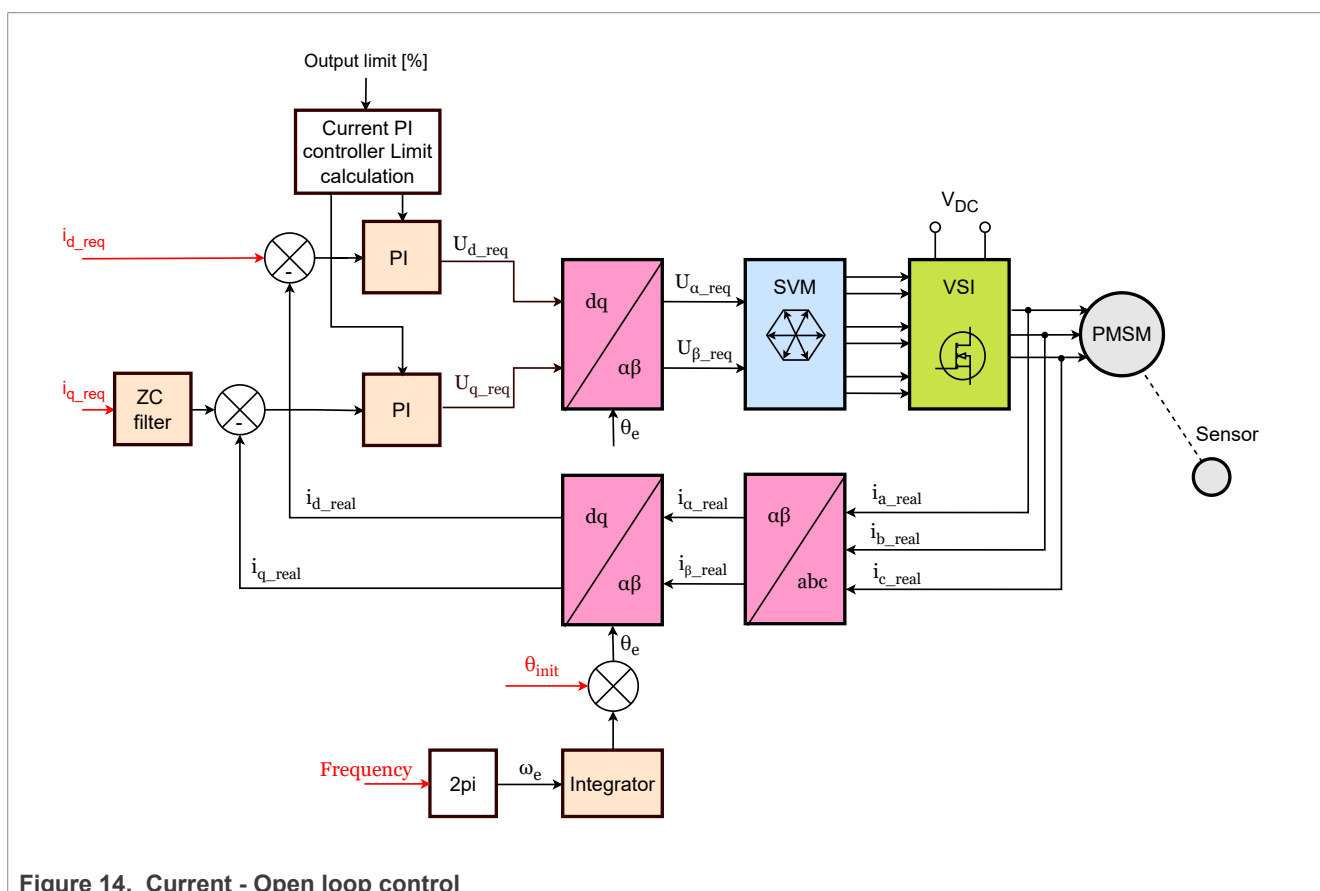

For run motor in Current - Open loop control, follow these steps:

1. Switch project tree subblock on "Openloop Control".
2. Switch variable "M1 MCAT Control" on "OPEN_LOOP".
3. Set variable "M1 Openloop Use I Control" to "1".
4. In variable "M1 Openloop Required Id" and "M1 Openloop Required Iq" set required values.
5. In variable "M1 Openloop Theta Electrical" set required initial position.
6. In variable "M1 Openloop Required Frequency Electrical" set required frequency.
7. Set variable "M1 Application Switch" to "1". Motor start spinning.
8. Observe motor speed, position, phase currents and other graphs predefined in subblock scopes and recorders.

8.3.3 Voltage control

The block diagram of the voltage FOC is shown in [Figure 15](#). Unlike the scalar control, the position feedback is closed using the BEMF observer and the stator voltage magnitude is not dependent on the motor speed. Both the d-axis and q-axis stator voltages can be specified in the "M1 MCAT Ud Required" and "M1 MCAT Uq Required" fields. This control method is useful for the BEMF observer functionality check.

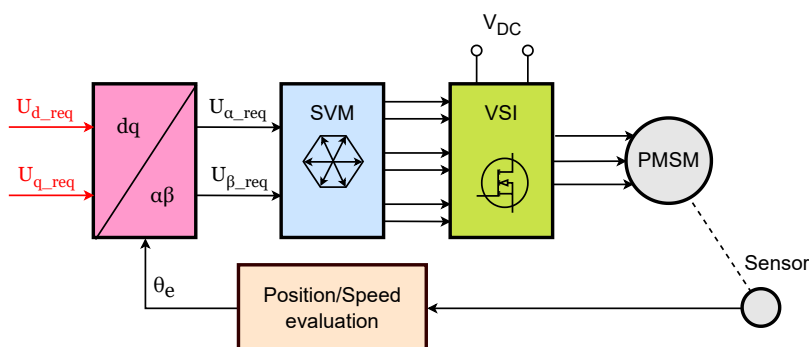


Figure 15. Voltage FOC control mode

For run motor in voltage control, follow these steps:

1. Switch project tree subblock on "Scalar & Voltage Control".
2. Switch variable "M1 MCAT Control" on "VOLTAGE_FOC".
3. In variable "M1 MCAT Uq Required" and "M1 MCAT Ud Required" set required voltages.
4. Set variable "M1 Application Switch" to "1". Motor start spinning.
5. Observe motor speed, position, phase currents and other graphs predefined in subblock scopes and recorders.

8.3.4 Current/Torque control

The current FOC (or torque) control requires the rotor position feedback and the currents transformed into a d-q reference frame. There are two reference variables ("M1 MCAT Id Required" and "M1 MCAT Iq Required") available for the motor control, as shown in [Figure 16](#). The d-axis current component "M1 MCAT Id Required" controls the rotor flux. The q-axis current component of the current "M1 MCAT Iq Required" generates torque and, by its application, the motor starts running. By changing the polarity of the current "M1 MCAT Iq Required", the motor changes the direction of rotation. Supposing the BEMF observer is tuned correctly, the current PI controllers can be tuned using the current FOC control structure.

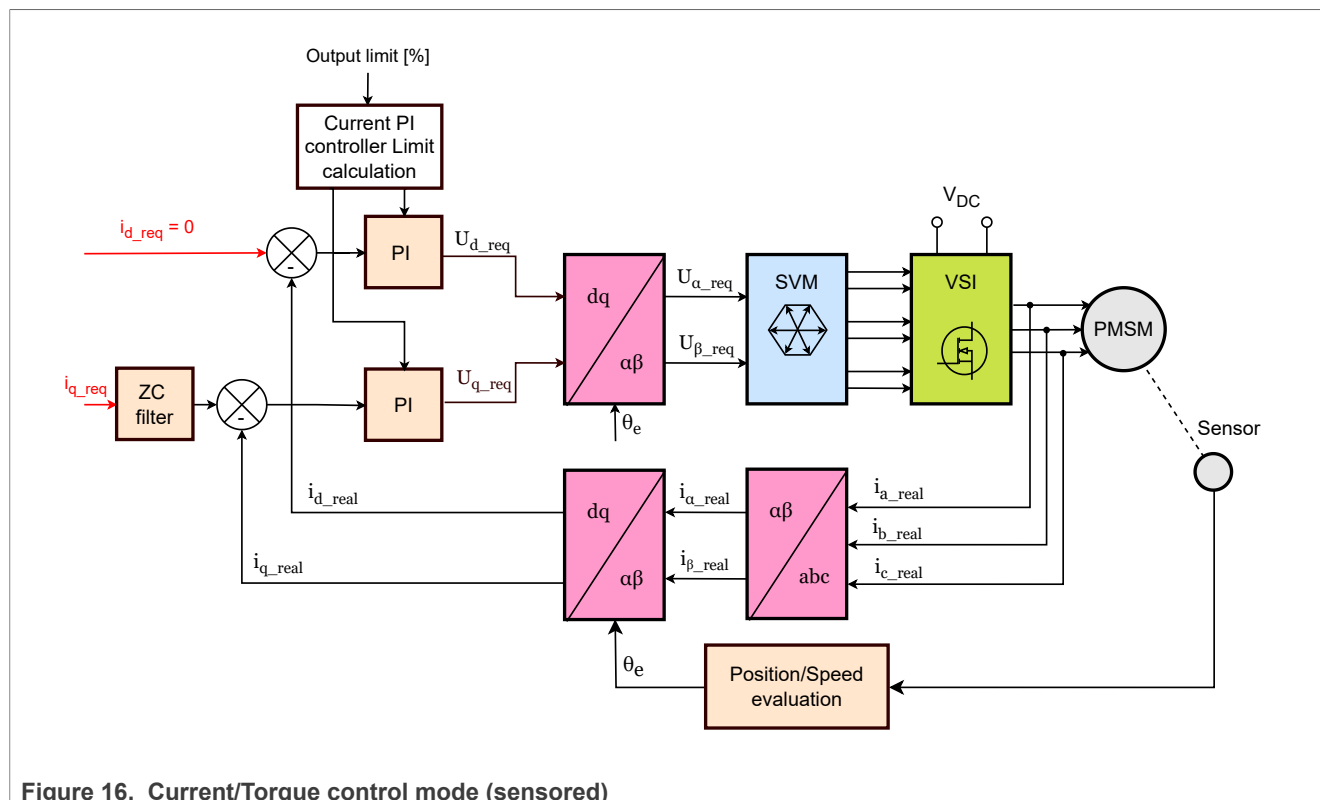


Figure 16. Current/Torque control mode (sensored)

For run motor in current control, follow these steps:

1. Switch project tree subblock on "Current Control".
2. Switch variable "M1 MCAT Control" on "CURRENT_FOC".
3. In variable "M1 MCAT Iq Required" and "M1 MCAT Id Required" set required currents.
4. Set variable "M1 Application Switch" to "1". Motor start spinning.
5. Observe motor speed, position, phase currents and other graphs predefined in subblock scopes and recorders.

8.3.5 Speed FOC control

As shown in [Figure 17](#), the speed PMSM sensor/sensorless FOC is activated by enabling the speed FOC control structure. Enter the required speed into the "M1 Speed Required" field. The d-axis current reference is held at 0 during the entire FOC operation.

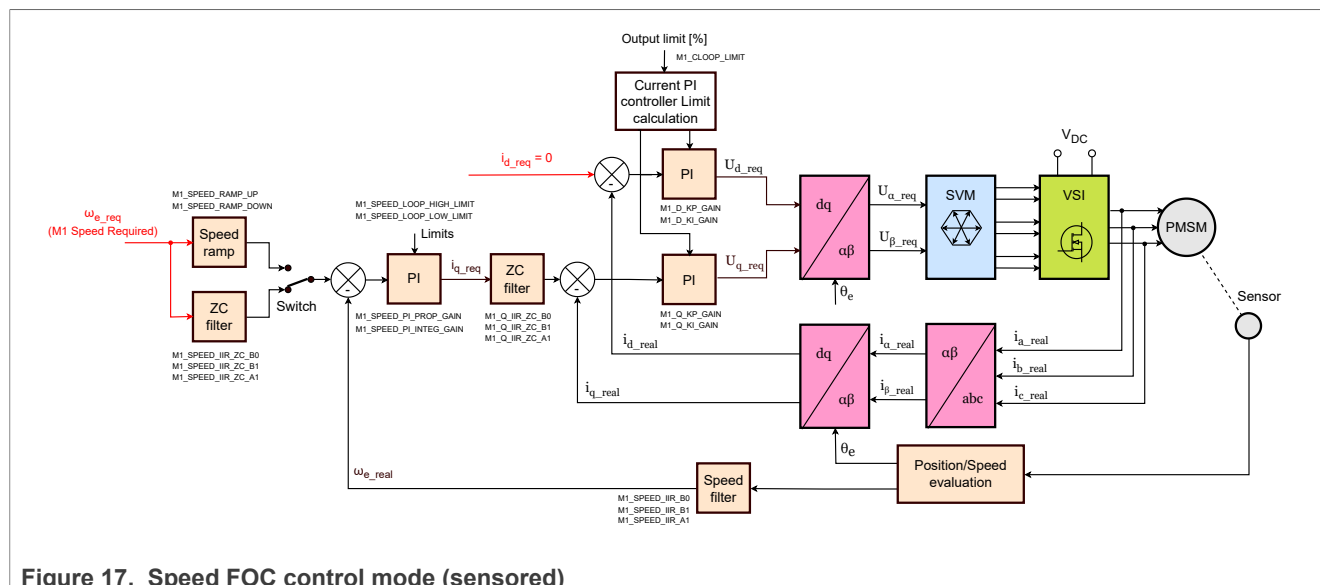


Figure 17. Speed FOC control mode (sensored)

For run motor in speed FOC control, follow these steps:

1. Switch project tree subblock on "Speed Control".
2. Switch variable "M1 MCAT Control" on "SPEED_FOC".
3. In variable "M1 Speed Required" set the required speed. (i.e. 1000rpm). The motor automatically starts spinning.
4. Observe motor speed, position, phase currents and other graphs predefined in subblock scopes and recorders.

8.4 Faults explanation

When the motor is running or during the tuning process, there may be several fault conditions. Therefore, the motor-control example has an integrated fault indication located in the variable watch of the "Motor M1" FreeMASTER subblock. If a fault is indicated, state machine enters the FAULT state.

Variable Watch			
	Name	Value	Unit
	M1 Fault Pending	b# 0000 0000	BIN
	M1 Fault Captured	b# 0000 0000	BIN
	M1 Fault Captured Over Current	Not captured	ENUM
	M1 Fault Captured DCBus Undervoltage	Not captured	ENUM
	M1 Fault Captured DCBus Overvoltage	Not captured	ENUM
	M1 Fault Captured Overload	Not captured	ENUM
	M1 Fault Captured Overspeed	Not captured	ENUM
	M1 Fault Captured Blocked Rotor	Not captured	ENUM
	M1 Fault Clear	No request	ENUM
	M1 Fault Enable DCBus Undervoltage	Enabled	ENUM
	M1 Fault Enable DCBus Overvoltage	Enabled	ENUM
	M1 Fault Enable Overload	Enabled	ENUM
	M1 Fault Enable Overspeed	Enabled	ENUM
	M1 Fault Enable Blocked Rotor	Enabled	ENUM

Figure 18. Faults in variable watch located in "Motor M1" subblock

8.4.1 Variable "M1 Fault Pending"

It shows actually persisting faults, which means that the fault indicated during fault conditions is accomplished. For example, if the source voltage is still under the undervoltage fault threshold, the undervoltage pending fault is shown. If the fault condition disappears, the fault pending is cleared automatically. "M1 Fault Pending" is shown in a binary format in the FreeMASTER variable watch. Each place in the variable denotes a different fault condition.

- b 0000 0001 - the overcurrent fault is indicated. If the overcurrent fault is present, the PWMs are automatically disabled. The fault occurs when the DC-Bus current exceeds the **I_{max}** value (current-sensing HW scale).
- b 0000 0010 - the undervoltage fault is indicated. The undervoltage fault occurs when the UDCBus voltage (source voltage) is lower than the **U DCB under** threshold.
- b 0000 0100 - the overvoltage fault is indicated. The overvoltage fault occurs when the UDCBus voltage (source voltage) is higher than the **U DCB over** threshold.
- b 0000 1000 - the overload fault is indicated. The overload fault occurs when the rotor is overloaded.
- b 0001 0000 - the overspeed fault is indicated. The overspeed fault occurs when the rotor speed exceeds the **N over** threshold.
- b 0010 0000 - the block rotor fault is indicated. The block rotor fault occurs when the back-EMF voltage is lower than the **E block** threshold and the duration of the drop is longer than **E block per**.

Variable Watch			
	Name	Value	Unit
	M1 Fault Pending	b# 0000 0010	BIN
	M1 Fault Captured	b# 0000 0010	BIN
	M1 Fault Captured Over Current	Not captured	ENUM
	M1 Fault Captured DCBus Undervoltage	Captured	ENUM
	M1 Fault Captured DCBus Overvoltage	Not captured	ENUM
	M1 Fault Captured Overload	Not captured	ENUM
	M1 Fault Captured Overspeed	Not captured	ENUM
	M1 Fault Captured Blocked Rotor	Not captured	ENUM
	M1 Fault Clear	No request	ENUM
	M1 Fault Enable DCBus Undervoltage	Enabled	ENUM
	M1 Fault Enable DCBus Overvoltage	Enabled	ENUM
	M1 Fault Enable Overload	Enabled	ENUM
	M1 Fault Enable Overspeed	Enabled	ENUM
	M1 Fault Enable Blocked Rotor	Enabled	ENUM

Figure 19. Undervoltage fault is indicated (pending)

8.4.2 Variable "M1 Fault Captured"

If any fault condition appears, the fault captured is indicated. Similar to fault pending, fault captured is shown in the BIN format, but every fault type has its own variable ("M1 Fault Captured Over Current" and others). For example, if the undervoltage fault condition is accomplished, fault captured is indicated. Fault captured is also indicated after the undervoltage fault condition disappears. The captured faults are cleared manually by writing "Clear [1]" to "M1 Fault Clear".

Variable Watch			
	Name	Value	Unit
	M1 Fault Pending	b# 0000 0000	BIN
	M1 Fault Captured	b# 0000 0010	BIN
	M1 Fault Captured Over Current	Not captured	ENUM
	M1 Fault Captured DCBus Undervoltage	Captured	ENUM
	M1 Fault Captured DCBus Overvoltage	Not captured	ENUM
	M1 Fault Captured Overload	Not captured	ENUM
	M1 Fault Captured Overspeed	Not captured	ENUM
	M1 Fault Captured Blocked Rotor	Not captured	ENUM
	M1 Fault Clear	No request	ENUM
	M1 Fault Enable DCBus Undervoltage	Enabled	ENUM
	M1 Fault Enable DCBus Overvoltage	Enabled	ENUM
	M1 Fault Enable Overload	Enabled	ENUM
	M1 Fault Enable Overspeed	Enabled	ENUM
	M1 Fault Enable Blocked Rotor	Enabled	ENUM

Figure 20. Undervoltage fault is captured

8.4.3 Variable "M1 Fault Enable"

The fault indication can be unwanted during the tuning process. Therefore, the fault indication can be disabled by writing "Disabled [0]" to the "M1 Fault Enable" variables.

Note: The overcurrent fault cannot be disabled.

Note: Fault thresholds are located in the "MCAT parameters" tab.

8.5 Initial motor parameters and hardware configuration

Motor control examples contain two or more configuration files: `m1_pmsm_appconfig.h`, `m2_pmsm_appconfig.h`, and so on. Each contains constants tuned for the selected motor (see supported motors in [Section 2](#)). The initial motor parameters and the hardware configuration (inverter) are to MCAT loaded from `m1_pmsm_appconfig.h` configuration file. There are three ways to change motor configuration corresponding to the connected motor.

1. The first way is rename the configuration file:
 - In the project example folder, find configuration file to be used.
 - Rename this configuration file to `m1_pmsm_appconfig.h`.
 - Rebuild project and load the code to the MCU.
2. The second way is to change motor configuration, as described in [Section 8.2](#).
3. The last way is change motor and hardware parameters manually:
 - Open the PMSM control application FreeMASTER project containing the dedicated MCAT plug-in module.
 - Select the "Parameters" tab.
 - Specify the parameters manually. The motor parameters can be obtained from the motor data sheet or using the PMSM parameters measurement procedure described in *PMSM Electrical Parameters Measurement* (document [AN4680](#)). All parameters provided in [Table 12](#) are accessible. The motor inertia J expresses the overall system inertia and can be obtained using a mechanical measurement. The J parameter is used to calculate the speed controller constant. However, the manual controller tuning can also be used to calculate this constant.

Table 12. MCAT motor parameters

Parameter	Units	Description	Typical range
pp	[-]	Motor pole pairs	1-10

Table 12. MCAT motor parameters...continued

Parameter	Units	Description	Typical range
Rs	[Ω]	1-phase stator resistance	0.3-50
Ld	[H]	1-phase direct inductance	0.00001-0.1
Lq	[H]	1-phase quadrature inductance	0.00001-0.1
Ke	[V.sec/rad]	BEMF constant	0.001-1
J	[kg.m ²]	System inertia	0.00001-0.1
Iph nom	[A]	Motor nominal phase current	0.5-8
Uph nom	[V]	Motor nominal phase voltage	10-300
N nom	[rpm]	Motor nominal speed	1000-2000

- Set the hardware scales—the modification of these two fields is not required when a reference to the standard power stage board is used. These scales express the maximum measurable current and voltage analog quantities.
- Check the fault limits—these fields are calculated using the motor parameters and hardware scales (see [Table 13](#)).

Table 13. Fault limits

Parameter	Units	Description	Typical range
U DCB trip	[V]	Voltage value at which the external braking resistor switch turns on	U DCB Over ~ U DCB max
U DCB under	[V]	Trigger value at which the undervoltage fault is detected	0 ~ U DCB Over
U DCB over	[V]	Trigger value at which the overvoltage fault is detected	U DCB Under ~ U max
N over	[rpm]	Trigger value at which the overspeed fault is detected	N nom ~ N max
N min	[rpm]	Minimal actual speed value for the sensorless control	(0.05~0.2) * N max

- Check the application scales—these fields are calculated using the motor parameters and hardware scales (see [Table 14](#)).

Table 14. Application scales

Parameter	Units	Description	Typical range
N max	[rpm]	Speed scale	>1.1 * N nom
E block	[V]	BEMF scale	ke* Nmax
kt	[Nm/A]	Motor torque constant	-

- Check the alignment parameters—these fields are calculated using the motor parameters and hardware scales. The parameters express the required voltage value applied to the motor during the rotor alignment and its duration.
- To save the modified parameters into the inner file, click the "Store data" button.

8.6 Identifying parameters of user motor

Because the model-based control methods of the PMSM drives provide high performance (for example, dynamic response, efficiency), obtaining an accurate model of a motor is an important part of the drive design and control. For the implemented FOC algorithms, it is necessary to know the value of the stator resistance R_s , direct inductance L_d , quadrature inductance L_q , and BEMF constant K_e . Unless the default PMSM motor described above is used, the motor parameter identification is the first step in the application tuning. This section shows how to identify user motor parameters using MID. MID is written in floating-point arithmetics. Each MID algorithm is detailed in [Section 8.7](#). MID is controlled via the FreeMASTER "Motor Identification" page shown in [Figure 21](#).

Name	Value	Unit
MID: On/Off	OFF	ENUM
MID: State	STOP	ENUM
APP: Switch request Spin/MID	No request	ENUM
MID: Status	MID is stopped	ENUM
MID: Measurement Type	PP_ASSIST	ENUM
MID: Fault	No fault	ENUM
APP: State	MID	ENUM
APP: Fault	No fault	ENUM
DIAG: Fault Captured	0	DEC
DIAG: Fault clear	0	DEC
MID: Measured Rs	0	Ohm
MID: Measured Ld	0	H
MID: Measured Lq	0	H
MID Pp IdReqOpenLoop	0.824799	A
MID Pp SpeedElReq	439.893	rpm
MID: Config El Mode Estim RL	0	DEC
MID: Config El I DC nominal	5	A
MID: Config El I DC positive max	6	A
MID: Config El I DC negative max	-6	A
MID: Config El I DC (estim Ld)	0	A
MID: Config El I DC (estim Lq)	5	A
MID: Config El DQ-switch	Ld meas	ENUM
MID: Config El I DC req (d-axis)	0	A
MID: Config El I DC req (q-axis)	0	A
MID: Config El I AC req	0	A
MID: Config El I AC frequency	0	Hz

Figure 21. MID FreeMASTER control

8.6.1 Switch between Spin and MID

Users can switch between two modes of application: *Spin* and *MID* (Motor Identification). *Spin* mode is used for control PMSM (see [Section 8.2](#)). *MID* mode is used for motor parameters identification (see [Motor parameter identification using MID](#)). The actual mode of application is shown in *APP: State* variable. The mode is changed by writing one to *APP: MID to Spin request* or *APP: Spin to MID request* variables. The transition between Spin

and MID can be done only if the actual mode is in a defined stop state (for example, MID not in progress or motor stopped). The result of the change mode request is shown in *APP: Fault* variable. MID fault occurs when parameters identification still runs, or the MID state machine is in the fault state. A spin fault occurs when *M1 Application switch* variable watch is ON, or *M1 Application state* variable watch is not STOP.

8.6.2 Motor parameter identification using MID

The whole MID is controlled via the FreeMASTER "Variable Watch". Motor Identification (MID) sub-block shown in [Figure 21](#). The motor parameter identification workflow is following:

1. Set the *MID: On/Off* variable to OFF.
2. Select the measurement type you want to perform via the *MID: Measurement Type* variable:
 - PP_ASSIST - Pole-pair identification assistant.
 - EL_PARAMS - Electrical parameters measurement.
3. Set the measurement configuration paramers in the *MID: Config* set of variables.
4. Start the measurement by setting *MID: On/Off* to ON.
5. Observe the *MID: Status* variable which indicates whether identification runs or not. Variable *MID: State* indicates actual state of the MID state machine. Variable *MID: Fault* indicates fault captured by estimation algorithm (e.g. incorrect measurement parameters). Variable is cleared automatically. Variable *DIAG: Fault Captured* indicates captured hardware faults (e.g. DC bus undervoltage). Variable is cleared by setting "On" to *DIAG: Fault clear* variable.
6. If the measurement finishes successfully, the measured motor parameters are shown in the *MID: Measured* set of variables and *MID: State* goes to STOP.

Table 15. MID: Fault variable

Fault mask	Description	Troubleshooting
b#0001	Error during initialization electrical parameters measurement.	Check whether inputs to the <i>MCAA_EstimRLInit_F16</i> are valid.
b#0010	Electrical parameters measurement fault. Some required value cannot be reached or wrong measurement configuration.	Check whether measurement configuration is valid.

Table 16. DIAG: Fault Captured variable

Fault mask	Description
b#0001	Overcurrent fault occurs.
b#0010	Undervoltage fault occurs.
b#0100	Overvoltage fault occurs.

8.7 MID algorithms

This section describes how each MID algorithm works.

8.7.1 Stator resistance measurement

The stator resistance R_s is averaged from the DC steps generated by the algorithm. The DC step levels are automatically derived from the currents inserted by the user. For more details, refer to the documentation of *AMCLIB_EstimRL* function from [AMMCLib](#).

8.7.2 Stator inductances measurement

Injection of the AC-DC currents is used for the inductances (L_d and L_q) estimation. Injected AC-DC currents are automatically derived from the currents inserted by the user. The default AC current frequency is 500 Hz. For more detail, refer to the documentation of `AMCLIB_EstimRL` function from [AMMCLib](#).

8.7.3 Number of pole-pair assistant

The number of pole-pairs can only be measured with a position sensor. However, there is a simple assistant to determine the number of pole-pairs (`PP_ASSIST`). The number of the pp assistant performs one electrical revolution, stops for a few seconds, and then repeats. Because the pp value is the ratio between the electrical and mechanical speeds, it can be determined as the number of stops per one mechanical revolution. It is recommended to refrain from counting the stops during the first mechanical revolution because the alignment occurs during the first revolution and affects the number of stops. During the `PP_ASSIST` measurement, the current loop is enabled, and the I_d current is controlled to *MID: Config Pp Id Meas*. The electrical position is generated by integrating the open-loop frequency *MID: Config Pp Freq El. Required*. If the rotor does not move after the start of `PP_ASSIST` assistant, stop the assistant, increase *MID: Config Pp Id Meas*, and restart the assistant.

8.8 Electrical parameters measurement control

This section describes how to control electrical parameters measurement, which contains measuring stator resistance R_s , direct inductance L_d and quadrature inductance L_q . There are available 4 modes of measurement which can be selected by *MID: Config El Mode Estim RL* variable.

Function *MCAA_EstimRLInit_F16* must be called before the first use of *MCAA_EstimRL_F16*. Function *MCAA_EstimRL_F16* must be called periodically with sampling period $F_SAMPLING$, which can be defined by user. Maximum sampling frequency $F_SAMPLING$ is 10 kHz. In the scopes under "Motor identification" FreeMASTER sub-block can be observed measured currents, estimated parameters etc.

8.8.1 Mode 0

This mode is automatic, inductances are measured at a single operating point. Rotor is not fixed. User has to specify nominal current (*MID: Config El I DC nominal* variable). The AC and DC currents are automatically derived from the nominal current. Frequency of the AC signal set to default 500 Hz.

The function will output stator resistance R_s , direct inductance L_d and quadrature inductance L_q .

8.8.2 Mode 1

DC stepping is automatic at this mode. Rotor is not fixed. Compared to the *Mode 0*, there will be performed an automatic measurement of the inductances for a defined number (*NUM_MEAS*) of different DC current levels using positive values of the DC current. The L_{dq} dependency map can be seen in the "Inductances (L_d , L_q)" recorder. User has to specify following parameters before parameters estimation:

- *MID: Config El I DC (estim Lq)* - Current to determine L_q . In most cases nominal current.
- *MID: Config El I DC positive max* - Maximum positive DC current for the L_{dq} dependency map measurement.

Injected AC and DC currents are automatically derived from the *MID: Config El I DC (estim Lq)* and *MID: Config El I DC positive max* currents. Frequency of the AC signal set to default 500 Hz.

The function will output stator resistance R_s , direct inductance L_d , quadrature inductance L_q and L_{dq} dependency map.

8.8.3 Mode 2

DC stepping is automatic at this mode. Rotor must be mechanically fixed after initial alignment with the first phase. Compared to the *Mode 1*, there will be performed an automatic measurement of the inductances for a defined number (*NUM_MEAS*) of different DC current levels using both positive and negative values of the DC current. The estimated inductances can be seen in the "Inductances (*L_d*, *L_q*)" recorder. User has to specify following parameters before parameters estimation:

- *MID: Config El I DC (estim *L_d*)* - Current to determine *L_d*. In most cases 0 A.
- *MID: Config El I DC (estim *L_q*)* - Current to determine *L_q*. In most cases nominal current.
- *MID: Config El I DC positive max* - Maximum positive DC current for the *L_{dq}* dependency map measurement. In most cases nominal current.
- *MID: Config El I DC negative max* - Maximum negative DC current for the *L_{dq}* dependency map measurement.

Injected AC and DC currents are automatically derived from the *MID: Config El I DC (estim *L_d*)*, *MID: Config El I DC (estim *L_q*)*, *MID: Config El I DC positive max* and *MID: Config El I DC negative max* currents. Frequency of the AC signal set to default 500 Hz.

The function will output stator resistance *R_s*, direct inductance *L_d*, quadrature inductance *L_q* and *L_{dq}* dependency map.

8.8.4 Mode 3

This mode is manual. Rotor must be mechanically fixed after alignment with the first phase. *R_s* is not calculated at this mode. The estimated inductances can be observed in the "*L_d*" or "*L_q*" scopes. The following parameters can be changed during the runtime:

- *MID: Config El DQ-switch* - Axis switch for AC signal injection (0 for injection AC signal to d-axis, 1 for injection AC signal to q-axis).
- *MID: Config El I DC req (d-axis)* - Required DC current in d-axis.
- *MID: Config El I DC req (q-axis)* - Required DC current in q-axis.
- *MID: Config El I AC req* - Required AC current injected to the d-axis or q-axis.
- *MID: Config El I AC frequency* - Required frequency of the AC current injected to the d-axis or q-axis.

8.9 Control parameters tuning

To check correct current measuring and proper working of back EMF observer, follow the steps below:

1. Select the scalar control in the "M1 MCAT Control" FreeMASTER variable watch.
2. Set the "M1 Application Switch" variable to "ON". The application state changes to "RUN".
3. Set the required frequency value in the "M1 Scalar Freq Required" variable; for example, 15 Hz in the "Scalar & Voltage Control" FreeMASTER project tree. The motor starts running.
4. Select the "Phase Currents" recorder from the "Scalar & Voltage Control" FreeMASTER project tree.
5. The optimal ratio for the V/Hz profile can be found by changing the V/Hz factor directly using MCAT input "Scalar V/Hz factor ratio". The shape of the motor currents should be close to a sinusoidal shape ([Figure 22](#)).

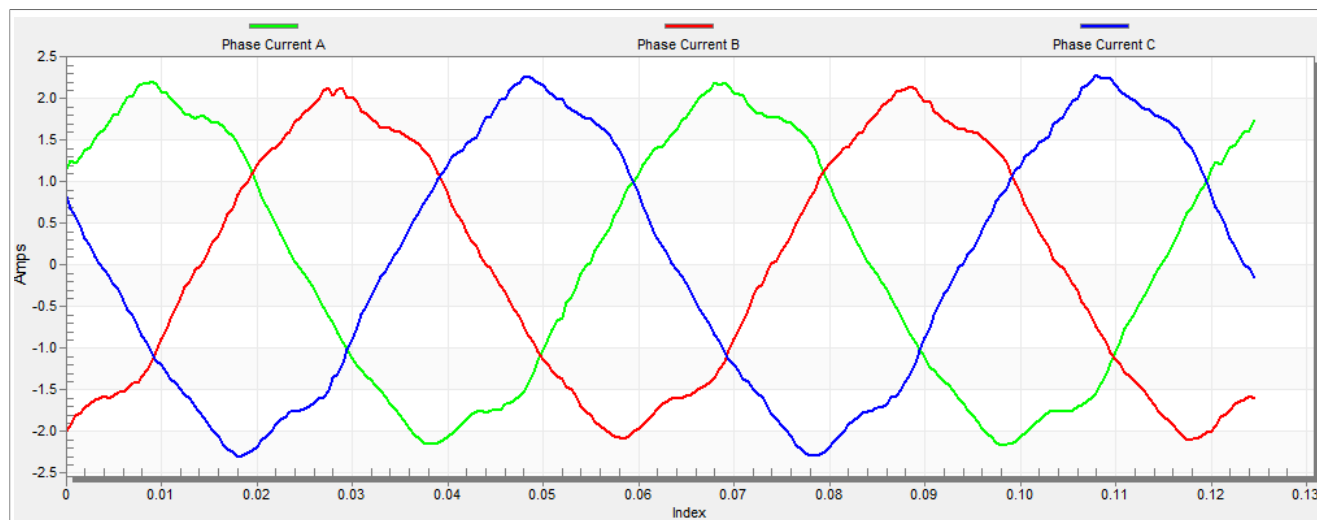


Figure 22. Phase currents

6. Select the "Position" recorder to check the observer functionality. The difference between the "Position Electrical Scalar" and the "Position Estimated" should be minimal (see [Figure 23](#)) for the Back-EMF position and speed observer to work properly. The position difference depends on the motor load. The higher the load, the bigger the difference between the positions due to the load angle.

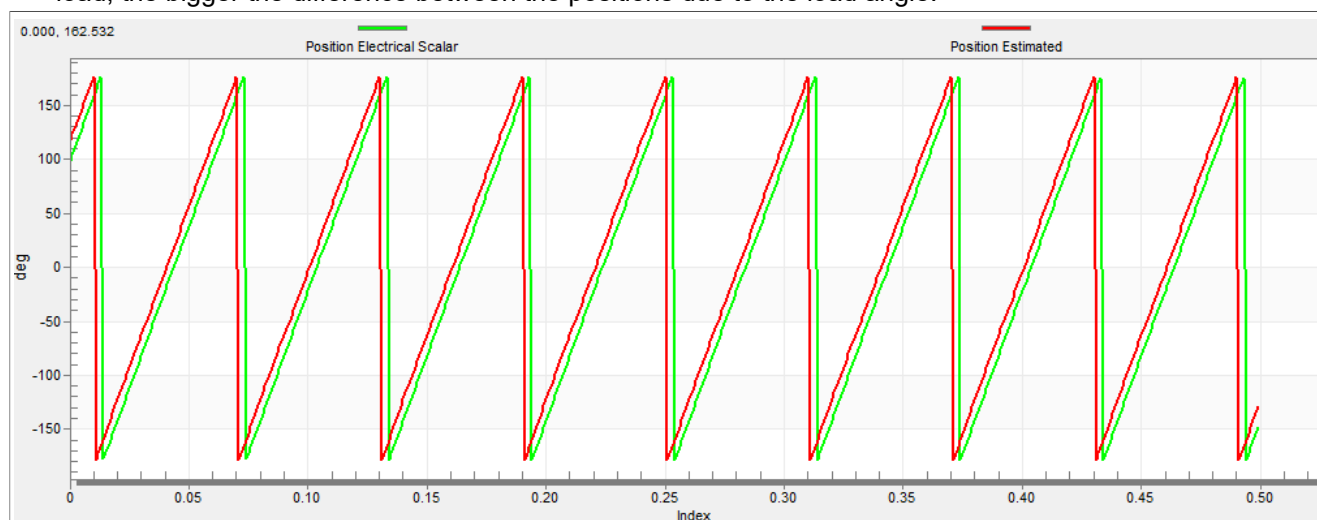


Figure 23. Generated and estimated positions

7. If an opposite speed direction is required, set a negative speed value into the "M1 Scalar Freq Required" variable.
8. The proper observer functionality and the measurement of analog quantities is expected at this step.
9. Enable the voltage FOC mode in the "M1 MCAT Control" variable while the main application switch "M1 Application Switch" is turned off.
10. Switch on the main application switch on and set a non-zero value in the "M1 MCAT Uq Required" variable. The FOC algorithm uses the estimated position to run the motor.

8.9.1 Alignment tuning

For the alignment parameters, navigate to the "Parameters" MCAT tab. The alignment procedure sets the rotor to an accurate initial position and enables you to apply full startup torque to the motor. A correct initial position is

needed mainly for high startup loads (compressors, washers, and so on). The alignment aims to have the rotor in a stable position, without any oscillations before the startup.

- The alignment voltage is the value applied to the d-axis during the alignment. Increase this value for a higher shaft load.
- The alignment duration expresses the time when the alignment routine is called. Tune this parameter to eliminate rotor oscillations or movement at the end of the alignment process.

8.9.2 Current loop tuning

The parameters for the current D, Q, and PI controllers are fully calculated using the motor parameters and no action is required in this mode. If the calculated loop parameters do not correspond to the required response, the bandwidth and attenuation parameters can be tuned.

1. Select “Openloop Control” in the FreeMASTER project tree, set “M1 MCAT Control” to “OPENLOOP_CTRL” and switch “M1 Openloop Use I Control” on.
2. Turn the application on by switching “M1 Application Switch” on and then set “M1 Openloop Required Id” for rotor alignment. (Rotor alignment always uses Id, even when you are tuning the Q axis regulator)
3. Mechanically lock the motor shaft and turn the application off.
4. Set the required loop bandwidth and attenuation in MCAT “Current loop” tab and then click the “Update target” button. The tuning loop bandwidth parameter defines how fast the loop response is while the tuning loop attenuation parameter defines the actual overshoot magnitude.
5. Select “Current Controller Id” recorder in project tree, turn the application on and set the required step amplitude in “M1 Openloop Required Id”. Observe the step response in the recorder.
6. Tune the loop bandwidth and attenuation until you achieve the required response. The example waveforms show the correct and incorrect settings of the current loop parameters:
 - The loop bandwidth is low (100 Hz) and the settling time of the Id current is long ([Figure 24](#)).

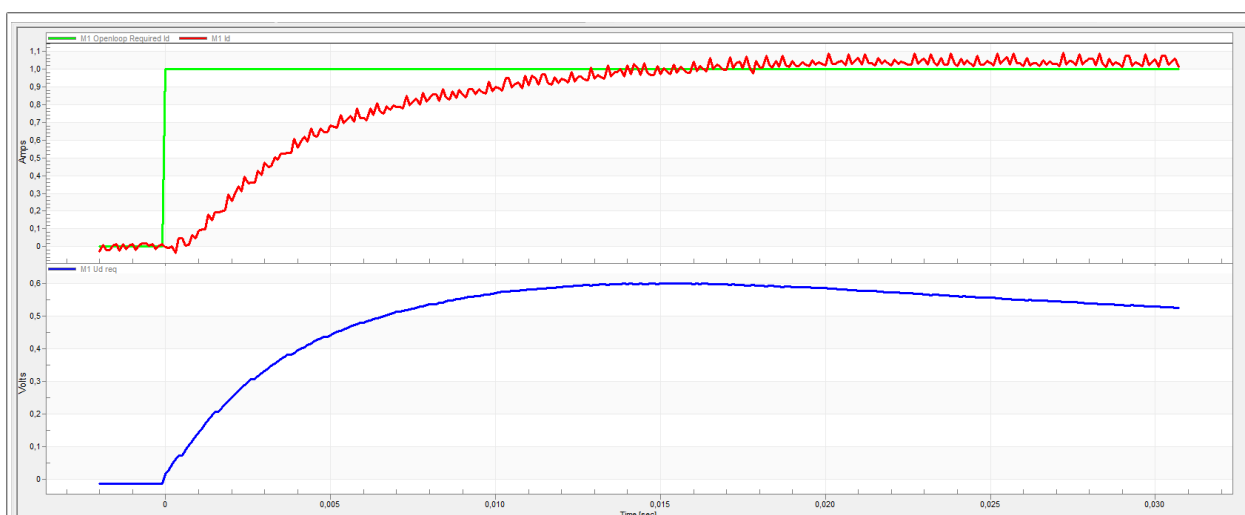


Figure 24. Slow step response of the Id current controller

- The loop bandwidth (300 Hz) is optimal and the response time of the Id current is sufficient ([Figure 25](#)).

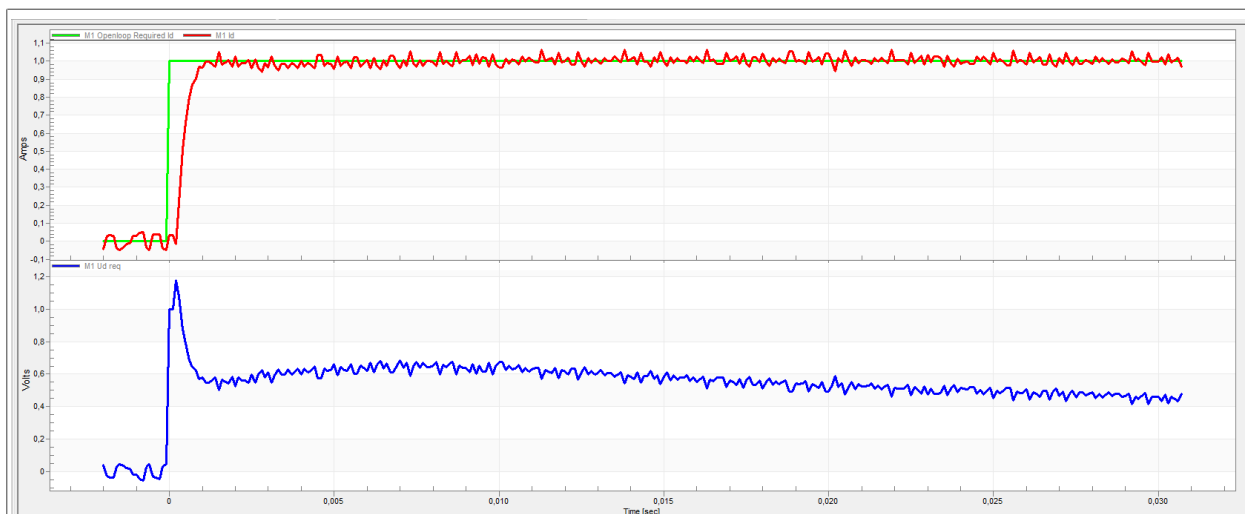


Figure 25. Optimal step response of the Id current controller

- The loop bandwidth is high (700 Hz) and the response time of the Id current is very fast, but with oscillations and overshoot ([Figure 26](#)).

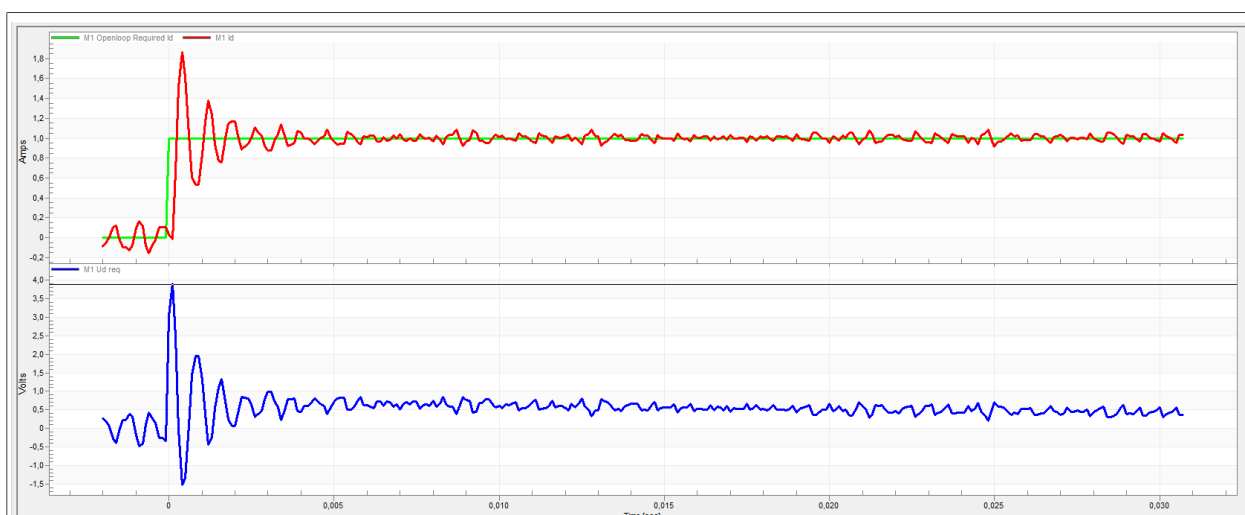


Figure 26. Fast step response of the Id current controller

8.9.3 Speed ramp tuning

To tune speed ramp parameters, follow the steps below:

1. The speed command is applied to the speed controller through a speed ramp. The ramp function contains two increments (up and down) which express the motor acceleration and deceleration per second. If the increments are very high, they can cause an overcurrent fault during acceleration and an overvoltage fault during deceleration. In the "Speed" scope, you can see whether the "Speed Actual Filtered" waveform shape equals the "Speed Ramp" profile.
2. The increments are common for the scalar and speed control. The increment fields are in the "Speed loop" tab and accessible in both tuning modes. Clicking the "Update target" button applies the changes to the MCU. An example speed profile is shown in [Figure 27](#). The ramp increment down is set to 500 rpm/sec and the increment up is set to 3000 rpm/sec.
3. The startup ramp increment is in the "Sensorless" tab and its value is higher than the speed loop ramp.

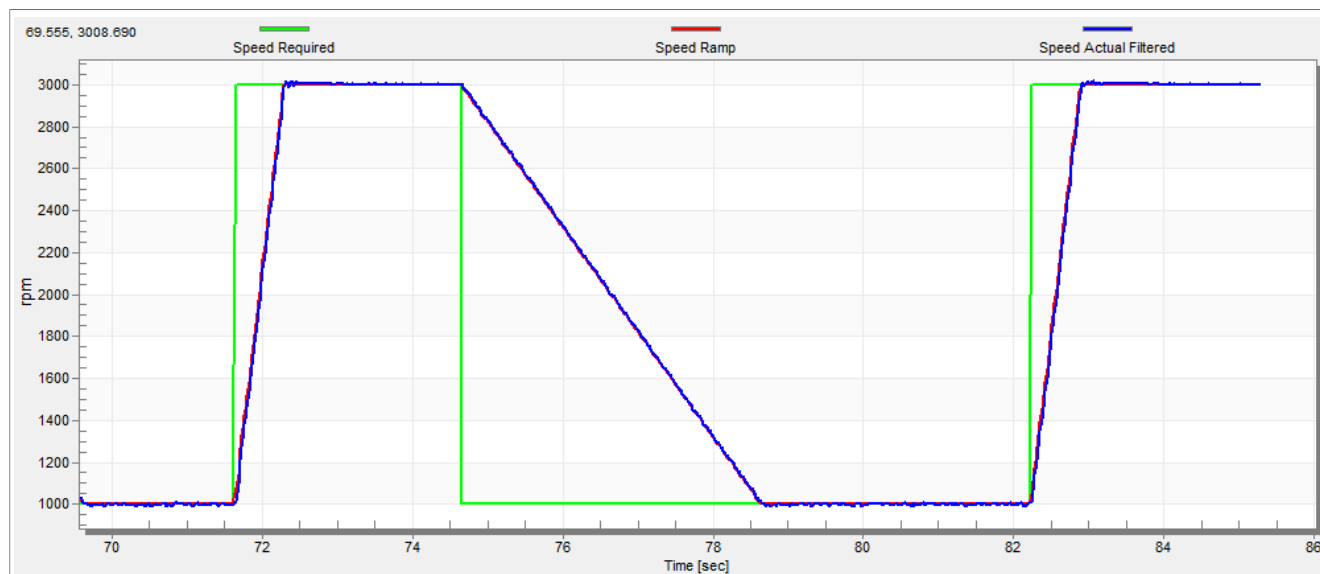


Figure 27. Speed profile

8.9.4 Open loop startup

To tune open loop startup parameters, follow the steps below:

1. The startup process can be tuned by a set of parameters located in the "Sensorless" tab. Two of them (ramp increment and current) are accessible in both tuning modes. The startup tuning can be processed in all control modes besides the scalar control. Setting the optimal values results in a proper motor startup. An example startup state of low-dynamic drives (fans, pumps) is shown in [Figure 28](#).
2. Select the "Startup" recorder from the FreeMASTER project tree.
3. Set the startup ramp increment typically to a higher value than the speed-loop ramp increment.
4. Set the startup current according to the required startup torque. For drives such as fans or pumps, the startup torque is not very high and can be set to 15 % of the nominal current.
5. Set the required merging speed. When the open-loop and estimated position merging starts, the threshold is mostly set in the range of 5 % ~ 10 % of the nominal speed.
6. Set the merging coefficient—in the position merging process duration, 100 % corresponds to a one of an electrical revolution. The higher the value, the faster the merge. Values close to 1 % are set for the drives where a high startup torque and smooth transitions between the open loop and the closed loop are required.
7. To apply the changes to the MCU, click the "Update Target" button.
8. Select "SPEED_FOC" in the "M1 MCAT Control" variable.
9. Set the required speed higher than the merging speed.
10. Check the startup response in the recorder.
11. Tune the startup parameters until you achieve an optimal response.
12. If the rotor does not start running, increase the startup current.
13. If the merging process fails (the rotor is stuck or stopped), decrease the startup ramp increment, increase the merging speed, and set the merging coefficient to 5 %.

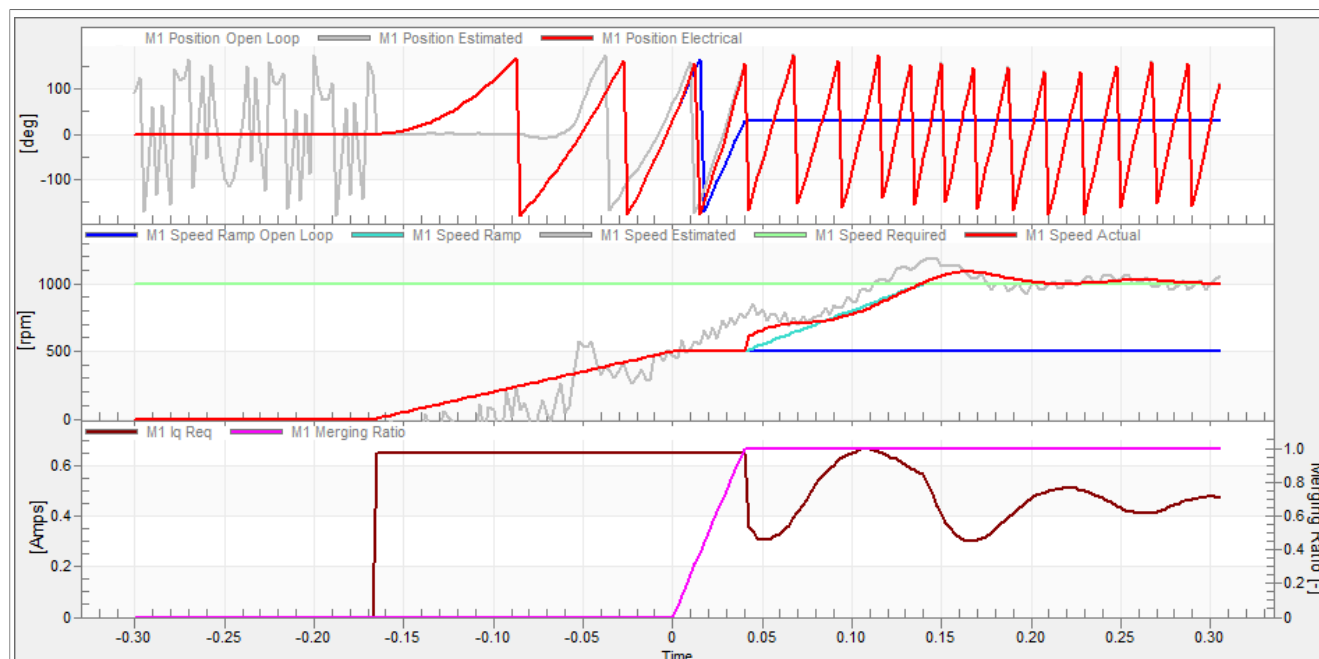


Figure 28. Motor startup

8.9.5 BEMF observer tuning

The bandwidth and attenuation parameters of the BEMF and tracking observer can be tuned. To tune the bandwidth and attenuation parameters, follow the steps below:

1. Navigate to the "Sensorless" MCAT tab.
2. Set the required bandwidth and attenuation of the BEMF observer. The bandwidth is typically set to a value close to the current loop bandwidth.
3. Set the required bandwidth and attenuation of the tracking observer. The bandwidth is typically set in the range of 10 – 20 Hz for most low-dynamic drives (fans, pumps).
4. To apply the changes to the MCU, click the "Update target" button.
5. Select the "Observer" recorder from the FreeMASTER project tree and check the observer response in the "Observer" recorder.

8.9.6 Speed PI controller tuning

The motor speed control loop is a first-order function with a mechanical time constant that depends on the motor inertia and friction. If the mechanical constant is available, the PI controller constants can be tuned using the loop bandwidth and attenuation. Otherwise, the manual tuning of the P and I portions of the speed controllers is available to obtain the required speed response (see [Figure 29](#)). There are dozens of approaches to tune the PI controller constants. To set and tune the speed PI controller for a PM synchronous motor, follow the steps below:

1. Select the "Speed Controller" option from the FreeMASTER project tree.
2. Select the "Speed loop" tab.
3. Check the "Manual Constant Tuning" option—that is, the "Bandwidth" and "Attenuation" fields are disabled and the "SL_Kp" and "SL_Ki" fields are enabled.
4. Tune the proportional gain:
 - Set the "SL_Ki" integral gain to 0.
 - Set the speed ramp to 1000 rpm/sec (or higher).

- Run the motor at a convenient speed (about 30 % of the nominal speed).
- Set a step in the required speed to 40 % of N_{nom} .
- Adjust the proportional gain "SL_Kp" until the system responds to the required value properly and without any oscillations or excessive overshoot:
 - If the "SL_Kp" field is set low, the system response is slow.
 - If the "SL_Kp" field is set high, the system response is tighter.
 - When the "SL_Ki" field is 0, the system most probably does not achieve the required speed.
 - To apply the changes to the MCU, click the "Update Target" button.
- 5. Tune the integral gain:
 - Increase the "SL_Ki" field slowly to minimize the difference between the required and actual speeds to 0.
 - Adjust the "SL_Ki" field such that you do not see any oscillation or large overshoot of the actual speed value while the required speed step is applied.
 - To apply the changes to the MCU, click the "Update target" button.
- 6. Tune the loop bandwidth and attenuation until the required response is received. The example waveforms with the correct and incorrect settings of the speed loop parameters are shown in the following figures:
 - The "SL_Ki" value is low and the "Speed Actual Filtered" does not achieve the "Speed Ramp".

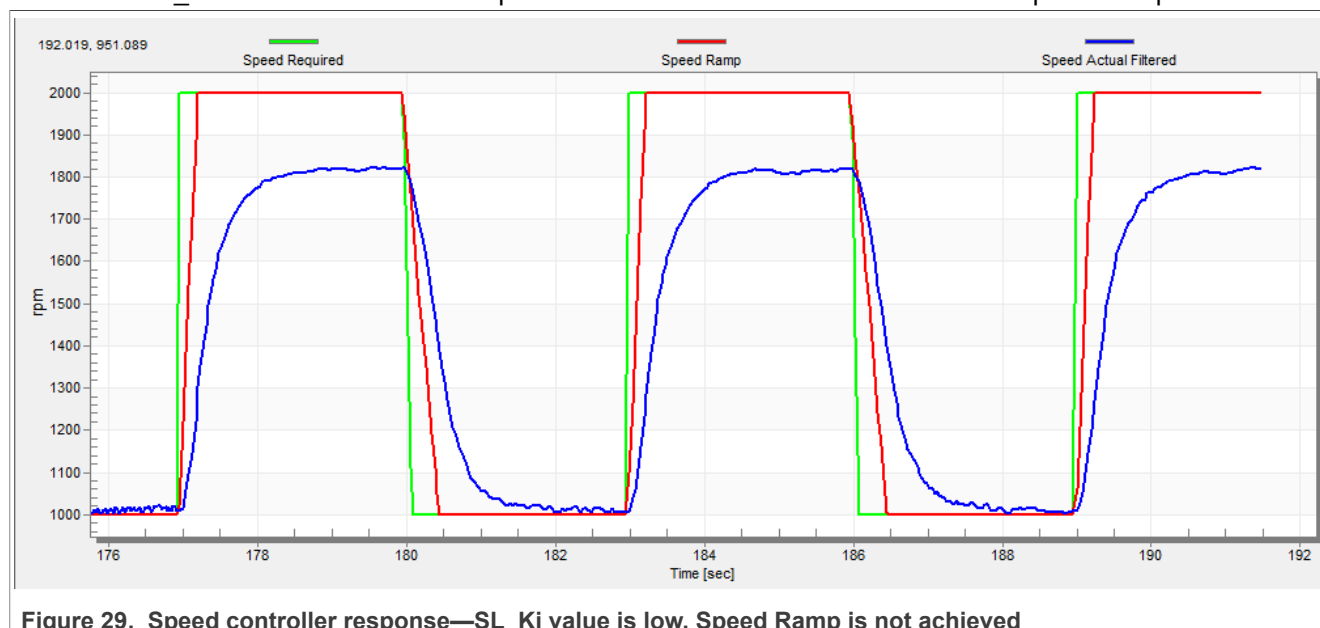


Figure 29. Speed controller response—SL_Ki value is low, Speed Ramp is not achieved

- The "SL_Kp" value is low, the "Speed Actual Filtered" greatly overshoots, and the long settling time is unwanted.

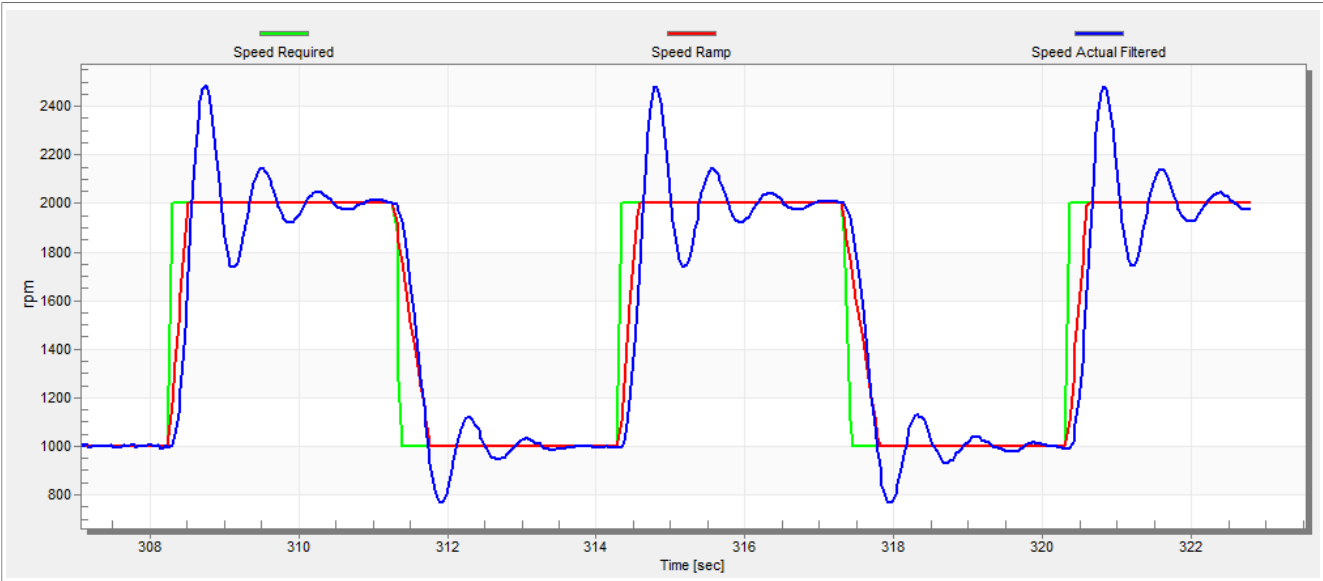


Figure 30. Speed controller response— SL_Kp value is low, Speed Actual Filtered greatly overshoots

- The speed loop response has a small overshoot and the "Speed Actual Filtered" settling time is sufficient. Such response can be considered optimal.

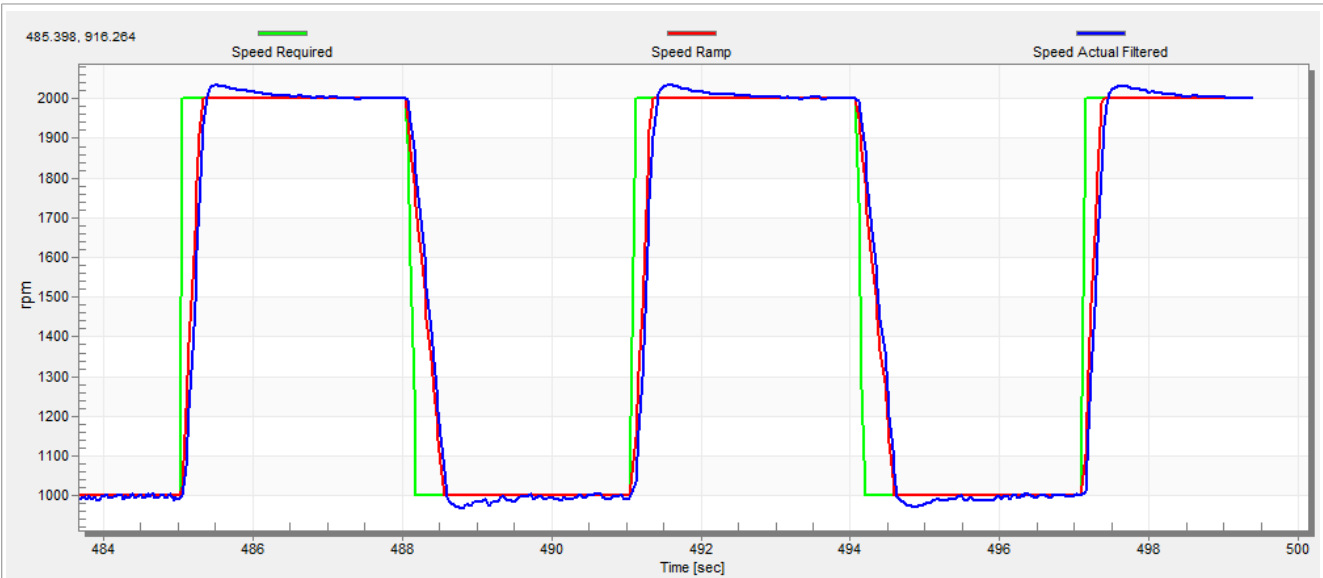


Figure 31. Speed controller response—speed loop response with a small overshoot

9 Conclusion

This application note describes the implementation of the sensor and sensorless field-oriented control of a 3-phase PMSM. The motor control software is implemented on NXP TWR-56F8200 board with the . The hardware-dependent part of the control software is described in [Section 2](#). The motor-control application timing, and the peripheral initialization are described in [Section 3](#). The motor user interface and remote control using FreeMASTER are described in [Section 7](#). The motor parameters identification theory and the identification algorithms are described in [Section 8.7](#).

10 Acronyms and abbreviations

[Table 17](#) lists the acronyms and abbreviations used in this document.

Table 17. Acronyms and abbreviations

Acronym	Meaning
ADC	Analog-to-Digital Converter
ACIM	Asynchronous Induction Motor
ADC_ETC	ADC External Trigger Control
AN	Application Note
BLDC	Brushless DC motor
CCM	Clock Controller Module
CPU	Central Processing Unit
DC	Direct Current
DRM	Design Reference Manual
ENC	Encoder
FOC	Field-Oriented Control
GPIO	General-Purpose Input/Output
LPIT	Low-power Periodic Interrupt Timer
LPUART	Low-power Universal Asynchronous Receiver/Transmitter
MCAT	Motor Control Application Tuning tool
MCDRV	Motor Control Peripheral Drivers
MCU	Microcontroller
PDB	Programmable Delay Block
PI	Proportional Integral controller
PLL	Phase-Locked Loop
PMSM	Permanent Magnet Synchronous Machine
PWM	Pulse-Width Modulation
QD	Quadrature Decoder
TMR	Quad Timer
USB	Universal Serial Bus
XBAR	Inter-Peripheral Crossbar Switch
IOPAMP	Internal operational amplifier

11 References

These references are available on www.nxp.com:

- *Sensorless PMSM Field-Oriented Control* (document [DRM148](#))
- *Motor Control Application Tuning (MCAT) Tool for 3-Phase PMSM* (document [AN4642](#))

12 Useful links

- MCUXpresso SDK for Motor Control www.nxp.com/sdkmotorcontrol
- [Motor Control Application Tuning \(MCAT\) Tool](#)
- [MCUXpresso IDE - Importing MCUXpresso SDK](#)
- [MCUXpresso Config Tool](#)
- [MCUXpresso SDK Builder](#) (SDK examples in several IDEs)
- [Model-Based Design Toolbox \(MBDT\)](#)

13 Revision history

This section summarizes the changes done to the document since the initial release.

Table 18. Revision history

Document ID	Release date	Description
UG10257 v.1.0	03 July 2025	New document ID (before PMSMTWR56F8200)

Legal information

Definitions

Draft — A draft status on a document indicates that the content is still under internal review and subject to formal approval, which may result in modifications or additions. NXP Semiconductors does not give any representations or warranties as to the accuracy or completeness of information included in a draft version of a document and shall have no liability for the consequences of use of such information.

Disclaimers

Limited warranty and liability — Information in this document is believed to be accurate and reliable. However, NXP Semiconductors does not give any representations or warranties, expressed or implied, as to the accuracy or completeness of such information and shall have no liability for the consequences of use of such information. NXP Semiconductors takes no responsibility for the content in this document if provided by an information source outside of NXP Semiconductors.

In no event shall NXP Semiconductors be liable for any indirect, incidental, punitive, special or consequential damages (including - without limitation - lost profits, lost savings, business interruption, costs related to the removal or replacement of any products or rework charges) whether or not such damages are based on tort (including negligence), warranty, breach of contract or any other legal theory.

Notwithstanding any damages that customer might incur for any reason whatsoever, NXP Semiconductors' aggregate and cumulative liability towards customer for the products described herein shall be limited in accordance with the Terms and conditions of commercial sale of NXP Semiconductors.

Right to make changes — NXP Semiconductors reserves the right to make changes to information published in this document, including without limitation specifications and product descriptions, at any time and without notice. This document supersedes and replaces all information supplied prior to the publication hereof.

Suitability for use — NXP Semiconductors products are not designed, authorized or warranted to be suitable for use in life support, life-critical or safety-critical systems or equipment, nor in applications where failure or malfunction of an NXP Semiconductors product can reasonably be expected to result in personal injury, death or severe property or environmental damage. NXP Semiconductors and its suppliers accept no liability for inclusion and/or use of NXP Semiconductors products in such equipment or applications and therefore such inclusion and/or use is at the customer's own risk.

Applications — Applications that are described herein for any of these products are for illustrative purposes only. NXP Semiconductors makes no representation or warranty that such applications will be suitable for the specified use without further testing or modification.

Customers are responsible for the design and operation of their applications and products using NXP Semiconductors products, and NXP Semiconductors accepts no liability for any assistance with applications or customer product design. It is customer's sole responsibility to determine whether the NXP Semiconductors product is suitable and fit for the customer's applications and products planned, as well as for the planned application and use of customer's third party customer(s). Customers should provide appropriate design and operating safeguards to minimize the risks associated with their applications and products.

NXP Semiconductors does not accept any liability related to any default, damage, costs or problem which is based on any weakness or default in the customer's applications or products, or the application or use by customer's third party customer(s). Customer is responsible for doing all necessary testing for the customer's applications and products using NXP Semiconductors products in order to avoid a default of the applications and the products or of the application or use by customer's third party customer(s). NXP does not accept any liability in this respect.

Terms and conditions of commercial sale — NXP Semiconductors products are sold subject to the general terms and conditions of commercial sale, as published at <https://www.nxp.com/profile/terms>, unless otherwise agreed in a valid written individual agreement. In case an individual agreement is concluded only the terms and conditions of the respective agreement shall apply. NXP Semiconductors hereby expressly objects to applying the customer's general terms and conditions with regard to the purchase of NXP Semiconductors products by customer.

Export control — This document as well as the item(s) described herein may be subject to export control regulations. Export might require a prior authorization from competent authorities.

Suitability for use in non-automotive qualified products — Unless this document expressly states that this specific NXP Semiconductors product is automotive qualified, the product is not suitable for automotive use. It is neither qualified nor tested in accordance with automotive testing or application requirements. NXP Semiconductors accepts no liability for inclusion and/or use of non-automotive qualified products in automotive equipment or applications.

In the event that customer uses the product for design-in and use in automotive applications to automotive specifications and standards, customer (a) shall use the product without NXP Semiconductors' warranty of the product for such automotive applications, use and specifications, and (b) whenever customer uses the product for automotive applications beyond NXP Semiconductors' specifications such use shall be solely at customer's own risk, and (c) customer fully indemnifies NXP Semiconductors for any liability, damages or failed product claims resulting from customer design and use of the product for automotive applications beyond NXP Semiconductors' standard warranty and NXP Semiconductors' product specifications.

HTML publications — An HTML version, if available, of this document is provided as a courtesy. Definitive information is contained in the applicable document in PDF format. If there is a discrepancy between the HTML document and the PDF document, the PDF document has priority.

Translations — A non-English (translated) version of a document, including the legal information in that document, is for reference only. The English version shall prevail in case of any discrepancy between the translated and English versions.

Security — Customer understands that all NXP products may be subject to unidentified vulnerabilities or may support established security standards or specifications with known limitations. Customer is responsible for the design and operation of its applications and products throughout their lifecycles to reduce the effect of these vulnerabilities on customer's applications and products. Customer's responsibility also extends to other open and/or proprietary technologies supported by NXP products for use in customer's applications. NXP accepts no liability for any vulnerability. Customer should regularly check security updates from NXP and follow up appropriately. Customer shall select products with security features that best meet rules, regulations, and standards of the intended application and make the ultimate design decisions regarding its products and is solely responsible for compliance with all legal, regulatory, and security related requirements concerning its products, regardless of any information or support that may be provided by NXP.

NXP has a Product Security Incident Response Team (PSIRT) (reachable at PSIRT@nxp.com) that manages the investigation, reporting, and solution release to security vulnerabilities of NXP products.

NXP B.V. — NXP B.V. is not an operating company and it does not distribute or sell products.

Trademarks

Notice: All referenced brands, product names, service names, and trademarks are the property of their respective owners.

NXP — wordmark and logo are trademarks of NXP B.V.

AMBA, Arm, Arm7, Arm7TDMI, Arm9, Arm11, Artisan, big.LITTLE, Cordio, CoreLink, CoreSight, Cortex, DesignStart, DynamIQ, Jazelle, Keil, Mali, Mbed, Mbed Enabled, NEON, POP, RealView, SecurCore, Socrates, Thumb, TrustZone, ULINK, ULINK2, ULINK-ME, ULINK-PLUS, ULINKpro, µVision, Versatile — are trademarks and/or registered trademarks of Arm Limited (or its subsidiaries or affiliates) in the US and/or elsewhere. The related technology may be protected by any or all of patents, copyrights, designs and trade secrets. All rights reserved.

BISS — is a trademark of iC-Haus GmbH.

CodeWarrior — is a trademark of NXP B.V.

EdgeLock — is a trademark of NXP B.V.

EdgeVerse — is a trademark of NXP B.V.

IAR — is a trademark of IAR Systems AB.

J-Link — is a trademark of SEGGER Microcontroller GmbH.

Kinetis — is a trademark of NXP B.V.

Tower — is a trademark of NXP B.V.

Tables

Tab. 1.	Available example type, supported motors and control methods	2	Tab. 10.	Speed loop tab input	25
Tab. 2.	Linux 45ZWN24-40 motor parameters	3	Tab. 11.	Sensorless tab input	26
Tab. 3.	TWR-MC-LV3PH jumper setting	5	Tab. 12.	MCAT motor parameters	34
Tab. 4.	TWR-56F8200 jumper settings	6	Tab. 13.	Fault limits	35
Tab. 5.	Maximum CPU load (fast loop)	10	Tab. 14.	Application scales	35
Tab. 6.	Memory usage	10	Tab. 15.	MID: Fault variable	37
Tab. 7.	Constants used in equations	21	Tab. 16.	DIAG: Fault Captured variable	37
Tab. 8.	Parameters tab inputs	21	Tab. 17.	Acronyms and abbreviations	48
Tab. 9.	Current loop tab input	24	Tab. 18.	Revision history	51

Figures

Fig. 1.	Linux 45ZWN24-40 permanent magnet synchronous motor	3	Fig. 18.	Faults in variable watch located in "Motor M1" subblock	32
Fig. 2.	Motor-control development platform block diagram	4	Fig. 19.	Undervoltage fault is indicated (pending)	33
Fig. 3.	TWR-MC-LV3PH board	5	Fig. 20.	Undervoltage fault is captured	34
Fig. 4.	TWR-56F8200 with jumper settings	6	Fig. 21.	MID FreeMASTER control	36
Fig. 5.	MC56F82xxx block diagram	8	Fig. 22.	Phase currents	40
Fig. 6.	Hardware timing and synchronization on MC56F82748	9	Fig. 23.	Generated and estimated positions	40
Fig. 7.	Directory tree	11	Fig. 24.	Slow step response of the Id current controller	41
Fig. 8.	Green "GO" button placed in top left-hand corner	17	Fig. 25.	Optimal step response of the Id current controller	42
Fig. 9.	FreeMASTER—communication is established successfully	17	Fig. 26.	Fast step response of the Id current controller	42
Fig. 10.	FreeMASTER communication setup window	18	Fig. 27.	Speed profile	43
Fig. 11.	FreeMASTER + MCAT layout	20	Fig. 28.	Motor startup	44
Fig. 12.	Scalar control mode	28	Fig. 29.	Speed controller response—SL_Ki value is low, Speed Ramp is not achieved	45
Fig. 13.	Voltage - Open loop control	28	Fig. 30.	Speed controller response—SL_Kp value is low, Speed Actual Filtered greatly overshoots	46
Fig. 14.	Current - Open loop control	29	Fig. 31.	Speed controller response—speed loop response with a small overshoot	46
Fig. 15.	Voltage FOC control mode	30			
Fig. 16.	Current/Torque control mode (sensored)	31			
Fig. 17.	Speed FOC control mode (sensored)	32			

Contents

1	Introduction	2	8.9	Control parameters tuning	39
2	Hardware setup	3	8.9.1	Alignment tuning	40
2.1	Linux motor	3	8.9.2	Current loop tuning	41
2.2	TWR-MC-LV3PH	3	8.9.3	Speed ramp tuning	42
2.3	TWR-56F8200	6	8.9.4	Open loop startup	43
2.3.1	Hardware assembling	7	8.9.5	BEMF observer tuning	44
3	Processors features and peripheral settings	8	8.9.6	Speed PI controller tuning	44
3.1	MC56F82xxx	8	9	Conclusion	47
3.1.1	MC56F82748 hardware timing and synchronization	8	10	Acronyms and abbreviations	48
3.1.2	MC56F82748 peripheral settings	9	11	References	49
3.2	CPU load and memory usage	9	12	Useful links	50
4	SDK package project file and IDE workspace structure	11	13	Revision history	51
4.1	PMSM project structure	11		Legal information	52
5	Github project structure	13			
6	Motor-control peripheral initialization	14			
7	User interface	16			
8	Remote control using FreeMASTER	17			
8.1	Establishing FreeMASTER communication	17			
8.2	Motor Control Application Tuning interface (MCAT)	18			
8.2.1	MCAT tabs description	20			
8.2.1.1	Application concept	21			
8.2.1.2	Parameters	21			
8.2.1.3	Current loop	24			
8.2.1.4	Speed loop	25			
8.2.1.5	Sensorless	26			
8.3	Motor Control Modes - How to run motor	27			
8.3.1	Scalar control	27			
8.3.2	Open loop control mode	28			
8.3.3	Voltage control	30			
8.3.4	Current/Torque control	30			
8.3.5	Speed FOC control	31			
8.4	Faults explanation	32			
8.4.1	Variable "M1 Fault Pending"	33			
8.4.2	Variable "M1 Fault Captured"	33			
8.4.3	Variable "M1 Fault Enable"	34			
8.5	Initial motor parameters and hardware configuration	34			
8.6	Identifying parameters of user motor	36			
8.6.1	Switch between Spin and MID	36			
8.6.2	Motor parameter identification using MID	37			
8.7	MID algorithms	37			
8.7.1	Stator resistance measurement	37			
8.7.2	Stator inductances measurement	38			
8.7.3	Number of pole-pair assistant	38			
8.8	Electrical parameters measurement control	38			
8.8.1	Mode 0	38			
8.8.2	Mode 1	38			
8.8.3	Mode 2	39			
8.8.4	Mode 3	39			

Please be aware that important notices concerning this document and the product(s) described herein, have been included in section 'Legal information'.